

# Proposed Rules

Federal Register

Vol. 86, No. 117

Tuesday, June 22, 2021

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2021-0506; Project Identifier MCAI-2021-00200-T]

RIN 2120-AA64

#### Airworthiness Directives; Airbus SAS Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede Airworthiness Directive (AD) 2013-25-11, which applies to all Airbus SAS Model A318-111, -112, -121, and -122 airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-111, -211, -212, -214, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. AD 2013-25-11 requires repetitive inspections of the 80VU rack lower lateral fittings, upper fittings, and shelves for damage, repetitive inspections of the 80VU rack lower central support for cracking, and corrective action if necessary. AD 2013-25-11 also specifies optional terminating action for the repetitive inspections. Since the FAA issued AD 2013-25-11, new damage was reported on airplanes that had complied with certain actions in that AD. This proposed AD would expand the applicability, remove the optional terminating action, and require new repetitive inspections, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by August 6, 2021.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR

11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** 202-493-2251.
- **Mail:** U.S. Department of

Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that will be incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0506.

#### Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0506; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

**FOR FURTHER INFORMATION CONTACT:** Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email [sanjay.ralhan@faa.gov](mailto:sanjay.ralhan@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No.

FAA-2021-0506; Project Identifier MCAI-2021-00200-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this proposed AD.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email [sanjay.ralhan@faa.gov](mailto:sanjay.ralhan@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

#### Background

The FAA issued AD 2013-25-11, Amendment 39-17707 (78 FR 78705, December 27, 2013) (AD 2013-25-11), which applies to all Airbus SAS Model A318-111, -112, -121, and -122 airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133

airplanes; Model A320-111, -211, -212, -214, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. AD 2013-25-11 requires repetitive inspections of the 80VU rack lower lateral fittings, upper fittings, and shelves for damage, repetitive inspections of the 80VU rack lower central support for cracking, and corrective action if necessary. AD 2013-25-11 also specifies optional terminating action for the repetitive inspections. The FAA issued AD 2013-25-11 to address damage or cracking of the 80VU fittings and supports, which could lead to possible disconnection of the cable harnesses to one or more computers, and if occurring during a critical phase of flight, could result in reduced control of the airplane.

#### Actions Since AD 2013-25-11 Was Issued

Since the FAA issued AD 2013-25-11, new damage was reported on airplanes that had accomplished the actions specified in Airbus Service Bulletin A320-53-1215 and Airbus Service Bulletin A320-25-1557, which AD 2013-25-11 specified as optional terminating action for the repetitive inspections. Damage was also found on airplanes on which Airbus mod 34804 (which provides the same modifications specified in Airbus Service Bulletin A320-53-1215 and Airbus Service Bulletin A320-25-1557) was embodied. Additional airplane models have also been determined to be subject to the unsafe condition. The FAA has therefore determined that new repetitive inspections of the 80VU rack are necessary to address the unsafe condition, and the applicability needs to be revised to include the additional airplane models.

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2021-0045, dated February 16, 2021 (EASA AD 2021-0045) (also referred to as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for all Airbus SAS Model A318-111, A318-112, A319-111, A319-112, A319-113, A319-114, A319-115, A319-131, A319-132, A319-133, A320-211, A320-212, A320-214, A320-215, A320-216, A320-231, A320-232, A320-233, A321-111, A321-112, A321-

131, A321-211, A321-212, A321-213, A321-231 and A321-232 airplanes. EASA AD 2021-0045 supersedes EASA AD 2012-0134 (which corresponds to FAA AD 2013-25-11). Model A320-215 airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this AD therefore does not include those airplanes in the applicability.

This proposed AD was prompted by reports of damaged lower lateral fittings of the 80VU rack, and reports of new damage on airplanes on which certain optional service information had been accomplished. The FAA is proposing this AD to address damage or cracking of the 80VU fittings and supports, which could lead to possible disconnection of the cable harnesses to one or more computers, and if occurring during a critical phase of flight, could result in reduced control of the airplane. See the MCAI for additional background information.

#### Related Service Information Under 1 CFR Part 51

EASA AD 2021-0045 describes procedures for repetitive special detailed inspections of the 80VU rack lower lateral fittings, lower central support, upper fittings, central post, and shelves attachments for discrepancies (including broken fittings, missing bolts, an electronics rack FIN 80VU that is in contact with structure, any bush that has migrated, burred material, and cracks), and corrective action if necessary. Corrective actions include modification, repair, and replacement. EASA AD 2021-0045 also describes procedures for reporting inspection results to Airbus.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI referenced above. The FAA is proposing this AD because the FAA evaluated all pertinent

information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in EASA AD 2021-0045 described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this AD.

#### Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA initially worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has since coordinated with other manufacturers and civil aviation authorities (CAAs) to use this process. As a result, EASA AD 2021-0045 will be incorporated by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2021-0045 in its entirety, through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in the EASA AD does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in the EASA AD. Service information specified in EASA AD 2021-0045 that is required for compliance with EASA AD 2021-0045 will be available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0506 after the FAA final rule is published.

#### Costs of Compliance

The FAA estimates that this proposed AD affects 1,528 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

#### ESTIMATED COSTS FOR REQUIRED ACTIONS \*

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Retained actions from AD 2013-25-11.	87 work-hours × \$85 per hour = \$7,395.	\$2,592	\$9,987	\$15,260,136

ESTIMATED COSTS FOR REQUIRED ACTIONS \*—Continued

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
New proposed actions .....	Up to 8 work-hours × \$85 per hour = Up to \$680.	\$0	Up to \$680	Up to \$1,039,040

\* Table does not include estimated costs for reporting.

The FAA estimates that it would take about 1 work-hour per product to comply with the proposed reporting requirement in this proposed AD. The average labor rate is \$85 per hour. Based

on these figures, the FAA estimates the cost of reporting the inspection results on U.S. operators to be \$129,880, or \$85 per product.

The FAA estimates the following costs to do any necessary on-condition

actions that would be required based on the results of any required actions. The FAA has no way of determining the number of aircraft that might need these on-condition actions:

ESTIMATED COSTS OF ON-CONDITION ACTIONS

Action	Labor cost	Parts cost	Cost per product
Repair .....	122 work-hours × \$85 per hour = \$10,370 .....	\$4,150	\$14,520
Replacement .....	Up to 189 work-hours × \$85 per hour = Up to \$16,065 .....	Up to \$6,928	Up to \$22,993
Modification .....	189 work-hours × \$85 per hour = \$16,065 .....	\$7,407	\$23,472

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators. The FAA does not control warranty coverage for affected operators. As a result, the FAA has included all known costs in the cost estimate.

**Paperwork Reduction Act**

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this proposed AD is 2120–0056. The paperwork cost associated with this proposed AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this proposed AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177–1524.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of

the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by:
  - a. Removing Airworthiness Directive (AD) 2013–25–11, Amendment 39–17707 (78 FR 78705, December 27, 2013), and
  - b. Adding the following new AD:

**Airbus SAS:** Docket No. FAA–2021–0506; Project Identifier MCAI–2021–00200–T.

**(a) Comments Due Date**

The FAA must receive comments on this airworthiness directive (AD) by August 6, 2021.

**(b) Affected ADs**

This AD replaces AD 2013–25–11, Amendment 39–17707 (78 FR 78705, December 27, 2013) (AD 2013–25–11).

**(c) Applicability**

This AD applies to all Airbus SAS airplanes, certificated in any category, identified in paragraphs (c)(1) through (4) of this AD.

- (1) Model A318–111 and –112 airplanes.

(2) Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes.

(3) Model A320–211, –212, –214, –216, –231, –232, and –233 airplanes.

(4) Model A321–111, –112, –131, –211, –212, –213, –231, and –232 airplanes.

#### (d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/furnishings.

#### (e) Reason

This AD was prompted by reports of damaged lower lateral fittings of the 80VU rack, and reports of new damage on airplanes on which certain optional service information had been accomplished. The FAA is issuing this AD to address damage or cracking of the 80VU fittings and supports, which could lead to possible disconnection of the cable harnesses to one or more computers, and if occurring during a critical phase of flight, could result in reduced control of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2021–0045, dated February 16, 2021 (EASA AD 2021–0045).

#### (h) Exceptions to EASA AD 2021–0045

(1) Where EASA AD 2021–0045 refers to its effective date, this AD requires using the effective date of this AD.

(2) The remarks section of EASA AD 2021–0045 does not apply to this AD.

(3) Where paragraph (2) of EASA AD 2021–0045 specifies “any discrepancy,” for this AD “any discrepancy” includes broken fittings, missing bolts, an electronics rack FIN 80VU that is in contact with structure, any bush that has migrated, burred material, and cracks.

(4) Paragraph (4) of EASA AD 2021–0045 specifies to report inspection results to Airbus within a certain compliance time. For this AD, report inspection results at the applicable time specified in paragraph (h)(4)(i) or (ii) of this AD.

(i) If the inspection was done on or after the effective date of this AD: Submit the report within 90 days after the inspection.

(ii) If the inspection was done before the effective date of this AD: Submit the report within 90 days after the effective date of this AD.

#### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending

information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov).

(i) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(ii) AMOCs approved previously for AD 2013–25–11 are approved as AMOCs for the corresponding provisions of EASA AD 2021–0045 that are required by paragraph (g) of this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: For any service information referenced in EASA AD 2021–0045 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(4) *Paperwork Reduction Act Burden Statement*: A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120–0056. Public reporting for this collection of information is estimated to be approximately 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. All responses to this collection of information are mandatory as required by this AD. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden to Information Collection Clearance Officer, Federal Aviation Administration, 10101 Hillwood Parkway, Fort Worth, TX 76177–1524.

#### (j) Related Information

(1) For information about EASA AD 2021–0045, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu);

internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0506.

(2) For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3223; email [sanjay.ralhan@faa.gov](mailto:sanjay.ralhan@faa.gov).

Issued on June 15, 2021.

#### Gaetano A. Scirtino,

*Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2021–13057 Filed 6–21–21; 8:45 am]

BILLING CODE 4910–13–P

## ENVIRONMENTAL PROTECTION AGENCY

### 40 CFR Part 52

[EPA–R08–OAR–2021–0262; FRL–10025–02–Region 8]

### Approval and Promulgation of Implementation Plans; Colorado; Revisions to Regulation Number 7; Aerospace, Oil and Gas, and Other RACT Requirements for 2008 8-Hour Ozone Standard for the Denver Metro/ North Front Range Nonattainment Area

**AGENCY:** Environmental Protection Agency (EPA).

**ACTION:** Proposed rule.

**SUMMARY:** The Environmental Protection Agency (EPA) is proposing approval of State Implementation Plan (SIP) revisions submitted by the State of Colorado on May 14, 2018, May 8, 2019, and May 13, 2020. The revisions are to Colorado Air Quality Control Commission (Commission or AQCC) Regulation Number 7 (Reg. 7). The revisions to Reg. 7 address Colorado’s SIP obligation to require reasonably available control technology (RACT) for sources covered by the 2016 oil & natural gas control techniques guidelines (CTG or CTGs) for Moderate nonattainment areas under the 2008 ozone National Ambient Air Quality Standard (NAAQS); update RACT requirements for major sources of volatile organic compounds (VOC) and nitrogen oxides (NO<sub>x</sub>); reorganize the regulation; add incorporation by reference dates to rules and reference