

phone: 847-294-7377; fax: 847-294-7384; email: [mark.grace@faa.gov](mailto:mark.grace@faa.gov).

(2) For service information identified in this AD, contact Hartzell Propeller Inc., 1 Propeller Place, Piqua, OH 45356-2634; phone: 937-778-4379; fax: 937-778-4391; email: [techsupport@hartzellprop.com](mailto:techsupport@hartzellprop.com). You may view this service information at the FAA, 12 New England Executive Park, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

Issued in Burlington, Massachusetts, on March 19, 2013.

**Colleen M. D'Alessandro,**

*Assistant Manager, Engine & Propeller Directorate, Aircraft Certification Service.*

[FR Doc. 2013-06843 Filed 3-25-13; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2013-0209; Directorate Identifier 2012-NM-127-AD]

RIN 2120-AA64

#### Airworthiness Directives; Bombardier, Inc. Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to supersede an existing airworthiness directive (AD) that applies to certain Bombardier, Inc. Model DHC-8-100, -200, and -300 series airplanes. The existing AD currently requires replacing certain parking brake accumulators. Since we issued that AD, we have determined that it is necessary to protect the hydraulic system and airplane structure from possible damage by any faulty screw cap or end cap of any accumulator. This proposed AD would require installing restraint devices around the parking brake accumulator end caps. We are proposing this AD to prevent failure of the parking brake accumulator screw cap or end cap resulting in loss of the number 2 hydraulic system and damage to airplane structures, which could adversely affect the controllability of the airplane.

**DATES:** Send comments on or before April 25, 2013.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Cesar Gomez, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office, 1600 Stewart Avenue Suite 410, Westbury, New York 11590; telephone (516) 228-7318; fax (516) 794-5531.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2013-0209; Directorate Identifier 2012-NM-127-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

On June 28, 2012, we issued AD 2012-14-04, Amendment 39-17118 (77 FR 42956, July 23, 2012). That AD required actions intended to address an unsafe condition on certain Model DHC-8-100, -200, and -300 series airplanes.

Since we issued AD 2012-14-04, Amendment 39-17118 (77 FR 42956, July 23, 2012), we have determined that it is necessary to protect the hydraulic system and airplane structure from possible damage by any faulty screw cap or end cap of any accumulator. Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2011-29R1, dated May 24, 2012 (referred to after this as "the MCAI"), to correct an unsafe condition for the specified products. The MCAI states:

Seven cases of on-ground hydraulic accumulator screw cap or end cap failure have been experienced on CL-600-2B19 (CRJ) aeroplanes, resulting in loss of the associated hydraulic system and high-energy impact damage to adjacent systems and structure. To date, the lowest number of flight cycles accumulated at the time of failure has been 6991.

Although there have been no failures to date on any DHC-8 aeroplanes, similar accumulators to those installed on the CL-600-2B19, Part Numbers (P/N) 0860162001 and 0860162002 (Parking Brake Accumulator), are installed on the aeroplanes listed in the Applicability section of this [TCCA] directive.

A detailed analysis of the systems and structure in the potential line of trajectory of a failed screw cap/end cap for the accumulator has been conducted. It has identified that the worst-case scenarios would be the loss of number 2 hydraulic system, and damage to aeroplane structures.

This [original TCCA] directive [which corresponds to FAA AD 2012-14-04, Amendment 39-17118 (77 FR 42956, July 23, 2012)] gives instructions to determine the part number and serial number of the existing parking brake accumulator, and where applicable, replace the accumulator.

Revision 1 of this [TCCA] AD mandates the installation of restraint devices around [all] the parking brake accumulator end caps to hold them in place in the event of an end cap failure.

Uncontained failure of the parking brake accumulator screw caps and/or end caps could result in loss of the number 2 hydraulic system, and damage to airplane structures, and could adversely

affect the controllability of the airplane. You may obtain further information by examining the MCAI in the AD docket.

#### Relevant Service Information

Bombardier, Inc. has issued Service Bulletin 8–32–169, Revision A, dated December 16, 2011. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

#### FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Costs of Compliance

Based on the service information, we estimate that this proposed AD would affect about 129 products of U.S. registry.

The actions that are required by AD 2012–14–04, Amendment 39–17118 (77 FR 42956, July 23, 2012), and retained in this proposed AD take about 2 work-hours per product, at an average labor rate of \$85 per work hour. Based on these figures, the estimated cost of the currently required actions is \$170 per product.

We estimate that it would take about 15 work-hours per product to comply with the new basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts cost \$5,302 per product. Where the service information lists required parts costs that are covered under warranty, we have assumed that there will be no charge for these parts. As we do not control warranty coverage for affected parties, some parties may incur costs higher than estimated here. Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$848,433, or \$6,577 per product.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by removing airworthiness directive (AD) 2012–14–04, Amendment 39–17118 (77 FR July 23, 2012), and adding the following new AD:

**Bombardier, Inc.:** Docket No. FAA–2013–0209; Directorate Identifier 2012–NM–127–AD.

#### (a) Comments Due Date

We must receive comments by May 10, 2013.

#### (b) Affected ADs

This AD supersedes AD 2012–14–04, Amendment 39–17118 (77 FR 42956, July 23, 2012).

#### (c) Applicability

This AD applies to Bombardier, Inc. Model DHC–8–101, –102, –103, –106, –201, –202, –301, –311, and –315 airplanes, certificated in any category, serial numbers 003 and subsequent.

#### (d) Subject

Air Transport Association (ATA) of America Code 32, Landing gear.

#### (e) Reason

This AD was prompted by reports of hydraulic accumulator screw cap or end cap failure. We are issuing this AD to prevent failure of the parking brake accumulator screw caps or end caps resulting in loss of the number 2 hydraulic system and damage to airplane structures, which could adversely affect the controllability of the airplane.

#### (f) Compliance

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### (g) Retained Inspection and Replacement

This paragraph restates the requirements of paragraph (g) of AD 2012–14–04, Amendment 39–17118 (77 FR 42956, July 23, 2012), with no changes. Within 2,000 flight hours or 12 months after August 27, 2012 (the effective date of AD 2012–14–04), whichever occurs first: Inspect to determine the part number (P/N) and serial number of the parking brake hydraulic accumulator, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 8–32–170, dated February 25, 2011. A review of airplane maintenance records is acceptable in lieu of this inspection if the part number and serial number of the parking brake hydraulic accumulator can be conclusively determined from that review.

(1) For accumulators not having P/N 0860162001 or 0860162002: No further action is required by this paragraph.

(2) For accumulators having P/N 0860162001 or 0860162002: Before further flight, do the applicable actions specified in paragraphs (g)(2)(i) and (g)(2)(ii) of this AD.

(i) If the serial number is listed in the table in paragraph 3.B.(2) of Bombardier Service Bulletin 8–32–170, dated February 25, 2011: No further action is required by this paragraph.

(ii) If the serial number is not listed in the table in paragraph 3.B.(2) of Bombardier Service Bulletin 8–32–170, dated February 25, 2011: Within 2,000 flight hours or 12 months after August 27, 2012 (the effective date of AD 2012–14–04, Amendment 39–17118 (77 FR 42956, July 23, 2012)),

whichever occurs first, replace the accumulator with a new non-suspect accumulator, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 8–32–172, dated March 15, 2011.

#### (h) Retained Parts Installation Prohibition

This paragraph restates the requirements of paragraph (h) of AD 2012–14–04, Amendment 39–17118 (77 FR 42956, July 23, 2012), with no changes. As of August 27, 2012 (the effective date of AD 2012–14–04), no person may install a parking brake accumulator, P/N 0860162001 or 0860162002 with a serial number that is not listed in the table in paragraph 3.B.(2) of Bombardier Service Bulletin 8–32–170, dated February 25, 2011, on any airplane.

#### (i) New Requirement of this AD: Install Restraint Devices on All Airplanes

Within 6,000 flight hours or 36 months after the effective date of this AD, whichever occurs first: Install restraint devices around the parking brake hydraulic accumulator end caps by incorporating Bombardier ModSum 8Q101901, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 8–32–169, Revision A, dated December 16, 2011.

#### (j) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (i) of this AD, if those actions were performed before the effective date of this AD using Bombardier Service Bulletin 8–32–169, dated November 25, 2011, which is not incorporated by reference in this AD.

#### (k) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York Aircraft Certification Office (ACO), ANE–170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300; fax 516–794–5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

#### (l) Related Information

(1) Refer to MCAI Canadian Airworthiness Directive CF–2011–29R1, dated May 24, 2012; and the service information identified in paragraphs (m)(1)(i) through (m)(1)(v) of this AD; for related information.

(i) Bombardier Service Bulletin 8–32–169, Revision A, dated December 16, 2011.

(ii) Bombardier Service Bulletin 8–32–170, dated February 25, 2011.

(iii) Bombardier Service Bulletin 8–32–172, dated March 15, 2011.

(2) For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416–375–4000; fax 416–375–4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on March 5, 2013.

Ali Bahrami,

Manager, Transport Airplane Directorate,  
Aircraft Certification Service.

[FR Doc. 2013–05813 Filed 3–25–13; 8:45 am]

BILLING CODE 4910–13–P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Docket No. FAA–2012–1345; Airspace  
Docket No. 12–ANM–31]

#### Proposed Modification of Class D and Class E Airspace and Establishment of Class E Airspace; Pasco, WA

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to establish Class E surface airspace at Tri-Cities Airport, Pasco, WA. Controlled airspace is necessary to accommodate aircraft using Area Navigation (RNAV) Global Positioning System (GPS) standard instrument approach procedures at Tri-Cities Airport, Pasco, WA. This action also would modify the Class D airspace and Class E airspace by adjusting the geographic coordinates of Tri-Cities Airport and Kennewick, Vista Field Airport. This will also correct the airport name from Vista Airport, Kennewick, WA to Kennewick, Vista Field Airport, WA. The FAA is proposing this action to enhance the safety and management of aircraft operations at Tri-Cities Airport, Pasco, WA.

**DATES:** Comments must be received on or before May 10, 2013.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590; telephone (202) 366–9826. You must identify FAA Docket No. FAA–2012–1345; Airspace Docket No. 12–ANM–31, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>.

#### FOR FURTHER INFORMATION CONTACT:

Eldon Taylor, Federal Aviation Administration, Operations Support Group, Western Service Center, 1601 Lind Avenue SW., Renton, WA 98057; telephone (425) 203–4537.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments, as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal.

Communications should identify both docket numbers (FAA Docket No. FAA 2012–1345 and Airspace Docket No. 12–ANM–31) and be submitted in triplicate to the Docket Management System (see **ADDRESSES** section for address and phone number). You may also submit comments through the Internet at <http://www.regulations.gov>.

Commenters wishing the FAA to acknowledge receipt of their comments on this action must submit with those comments a self-addressed stamped postcard on which the following statement is made: “Comments to FAA Docket No. FAA–2012–1345 and Airspace Docket No. 12–ANM–31”. The postcard will be date/time stamped and returned to the commenter.

All communications received on or before the specified closing date for comments will be considered before taking action on the proposed rule. The proposal contained in this action may be changed in light of comments received. All comments submitted will be available for examination in the public docket both before and after the closing date for comments. A report summarizing each substantive public contact with FAA personnel concerned