

**(c) Applicability**

This AD applies to all Continental Motors, Inc. (CMI) model -520 and -550 reciprocating engines, and to all other CMI engine models approved for the use of model -520 and -550 cylinder assemblies such as the CMI model -470 when modified by supplemental type certificate (STC), with Continental Motors Inc., San Antonio (formerly Airmotive Engineering Corp.), replacement parts manufacturer approval (PMA) cylinder assemblies, marketed by Engine Components International Division (hereinafter referred to as ECi), part number (P/N) AEC 631397, with ECi Class 71 or Class 76, serial number (S/N) 1 through S/N 61176, installed.

**(d) Unsafe Condition**

This AD was prompted by multiple failure reports of cylinder head-to-barrel separations and cracked and leaking aluminum cylinder heads. We are issuing this AD to prevent failure of the cylinder assemblies, which could lead to failure of the engine, in-flight shutdown, and loss of control of the airplane.

**(e) Compliance**

Comply with this AD within the compliance times specified, unless already done.

(1) Review the engine maintenance records to determine if any affected cylinder assemblies are installed.

(2) If you cannot determine based on review of engine maintenance records if any affected cylinder assemblies are installed, comply with paragraph (e)(4) of this AD.

(3) If you do not have any of the affected ECi cylinder assemblies installed on your engine, no further action is required.

(4) Cylinder Identification and Serial Number Location

(i) Check the cylinder assembly P/N and Class number. The ECi cylinder assembly, P/N AEC 631397, Class 71 or Class 76, is stamped on the bottom flange of the cylinder barrel. Guidance on the P/N and Class number description and location can be found in ECi Service Instruction No. 99-8-1, Revision 9, dated February 23, 2009.

(ii) If you cannot see the cylinder assembly P/N when the cylinder assembly is installed on the engine, you may use the following alternative method of identification:

(A) Remove the cylinder assembly rocker box cover.

(B) Find the letters ECi, cast into the cylinder head between the valve stems.

(C) Check the cylinder head casting P/N. Affected cylinder assemblies have the cylinder head casting, P/N AEC 65385, cast into the cylinder head between the valve stems.

(D) Find the cylinder assembly S/N as specified in paragraphs (e)(4)(iii) or (e)(4)(iv) of this AD, as applicable.

(iii) For ECi cylinder assemblies, P/N AEC 631397, manufactured through 2008, find the cylinder assembly S/N stamped on the intake port boss two inches down from the top edge of the head.

(iv) For ECi cylinder assemblies, P/N AEC 631397, manufactured on or after January 1, 2009, find the cylinder assembly S/N stamped just below the top edge of the head on the exhaust port side.

(5) Removal From Service

(i) For any affected cylinder assembly with 680 or fewer operating hours time-in-service (TIS) since new on the effective date of this AD, remove the cylinder assembly from service before reaching 1,000 operating hours TIS since new.

(ii) For any affected cylinder assembly with more than 680 operating hours TIS since new and 1,000 or fewer operating hours TIS since new on the effective date of this AD, remove the cylinder assembly from service within the next 320 operating hours TIS or within 1,160 operating hours TIS since new, whichever occurs first.

(iii) For any affected cylinder assembly with more than 1,000 operating hours TIS since new on the effective date of this AD, remove the cylinder assembly from service within the next 160 operating hours or at next engine overhaul, whichever occurs first.

(iv) For any affected cylinder assembly that has been overhauled, remove the cylinder assembly from service within the next 80 operating hours TIS after the effective date of this AD.

**(f) Installation Prohibitions**

After the effective date of this AD:

(1) Do not repair, or reinstall onto any engine, any cylinder assembly removed per this AD.

(2) Do not install any affected ECi cylinder assembly that has been overhauled, into any engine.

(3) Do not install any engine that has one or more affected overhauled ECi cylinder assemblies, onto any aircraft.

(4) Do not return to service any aircraft that has an engine installed with an ECi cylinder assembly subject to this AD, if the cylinder assembly has 1,000 or more operating hours TIS.

**(g) Alternative Methods of Compliance (AMOCs)**

The Manager, Delegation Systems Certification Office or Fort Worth Aircraft Certification Office, may approve AMOCs for this AD. Use the procedures found in 14 CFR 39.19 to make your request.

**(h) Related Information**

(1) For more information about this AD, contact Jurgen E. Priester, Aerospace Engineer, Delegation Systems Certification Office, FAA, Rotorcraft Directorate, 10101 Hillwood Parkway, Fort Worth, TX 76177; phone: 817-222-5190; fax: 817-222-5785; email: [jurgen.e.priester@faa.gov](mailto:jurgen.e.priester@faa.gov).

(2) For ECi Service Instruction No. 99-8-1, Revision 9, dated February 23, 2009, which is not incorporated by reference in this AD, contact Continental Motors—San Antonio, 9503 Middlex Drive, San Antonio, TX 78217; phone: 210-820-8101; Internet: <http://www.continentalsanantonio.com>.

(3) You may view this service information at the FAA, Engine & Propeller Directorate, 1200 District Avenue, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

**(i) Material Incorporated by Reference**

None.

Issued in Burlington Massachusetts, on July 19, 2016.

**Colleen M. D'Alessandro,**  
Manager, Engine & Propeller Directorate,  
Aircraft Certification Service.

[FR Doc. 2016-18708 Filed 8-10-16; 8:45 am]

BILLING CODE 4910-13-P

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA-2016-5856; Airspace  
Docket No. 16-AGL-9]

**Establishment of Class E Airspace;  
Park River, ND**

**AGENCY:** Federal Aviation  
Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action establishes Class E airspace in Park River, ND. Controlled airspace is necessary to accommodate new Standard Instrument Approach Procedures developed at Park River-W C Skjerven Field, Park River, ND, for the safety and management of Instrument Flight Rules (IFR) operations at the airport. Additionally, to correct airport name to correspond with the NASR in the header and legal description.

**DATES:** Effective 0901 UTC, November 10, 2016. The Director of the Federal Register approves this incorporation by reference action under title 1, Code of Federal Regulations, part 51, subject to the annual revision of FAA Order 7400.9 and publication of conforming amendments.

**ADDRESSES:** FAA Order 7400.9Z, Airspace Designations and Reporting Points, and subsequent amendments can be viewed on line at [http://www.faa.gov/air\\_traffic/publications/](http://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC, 20591; telephone: 202-267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

FAA Order 7400.9, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

**FOR FURTHER INFORMATION CONTACT:**  
Rebecca Shelby, Federal Aviation  
Administration, Operations Support

Group, Central Service Center, 10101 Hillwood Parkway, Fort Worth, TX, 76177; telephone (817) 222-5857.

#### SUPPLEMENTARY INFORMATION:

##### Authority for This Rulemaking

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part, A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it establishes controlled airspace at Park River-W C Skjerven Field, Park River, ND.

##### History

On May 24, 2016, the FAA published in the **Federal Register** a notice of proposed rulemaking (NPRM) to establish Class E Airspace in the Park River, ND area. (81 FR 32679) FAA-2016-5856. Interested parties were invited to participate in this rulemaking effort by submitting written comments on the proposal to the FAA. No comments were received.

Class E airspace designations are published in paragraph 6005 of FAA Order 7400.9Z dated August 6, 2015, and effective September 15, 2015, which is incorporated by reference in 14 CFR part 71.1. The Class E airspace designations listed in this document will be published subsequently in the Order.

##### Availability and Summary of Documents for Incorporation by Reference

This document amends FAA Order 7400.9Z, Airspace Designations and Reporting Points, dated August 6, 2015, and effective September 15, 2015. FAA Order 7400.9Z is publicly available as listed in the **ADDRESSES** section of this document. FAA Order 7400.9Z lists Class A, B, C, D, and E airspace areas, air traffic service routes, and reporting points.

##### The Rule

This amendment to Title 14, Code of Federal Regulations (14 CFR) part 71 establishes Class E airspace extending upward from 700 feet above the surface within a 7-mile radius of Park River-W C Skjerven Field, Park River, ND, to accommodate new standard instrument

approach procedures. Controlled airspace is needed for the safety and management of IFR operations at the airport. Additionally, this corrects the airport name to coordinate with the NASR, previously listed in the NPRM header and legal description as Park River Airport-WC Skjerven Field to Park River-W C Skjerven Field.

Class E airspace areas are published in Section 6005 of FAA Order 7400.9Z, dated August 6, 2015, and effective September 15, 2015, which is incorporated by reference in 14 CFR 71.1. The Class E airspace designations listed in this document will be published subsequently in the Order.

##### Regulatory Notices and Analyses

The FAA has determined that this regulation only involves an established body of technical regulations for which frequent and routine amendments are necessary to keep them operationally current, is non-controversial and unlikely to result in adverse or negative comments. It, therefore: (1) Is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034; February 26, 1979); and (3) does not warrant preparation of a Regulatory Evaluation as the anticipated impact is so minimal. Since this is a routine matter that only affects air traffic procedures and air navigation, it is certified that this rule, when promulgated, does not have a significant economic impact on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

##### Environmental Review

The FAA has determined that this action qualifies for categorical exclusion under the National Environmental Policy Act in accordance with FAA Order 1050.1F, "Environmental Impacts: Policies and Procedures," paragraph 5-6.5a. This airspace action is not expected to cause any potentially significant environmental impacts, and no extraordinary circumstances exist that warrant preparation of an environmental assessment.

##### Lists of Subjects in 14 CFR Part 71

Airspace, Incorporation by reference, Navigation (air).

##### Adoption of the Amendment

In consideration of the foregoing, the Federal Aviation Administration amends 14 CFR part 71 as follows:

## PART 71—DESIGNATION OF CLASS A, B, C, D, AND E AIRSPACE AREAS; AIR TRAFFIC SERVICE ROUTES; AND REPORTING POINTS

■ 1. The authority citation for Part 71 continues to read as follows:

**Authority:** 49 U.S.C. 106(f), 106(g); 40103, 40113, 40120, E.O. 10854, 24 FR 9565, 3 CFR, 1959-1963 Comp., p. 389.

### § 71.1 [Amended]

■ 2. The incorporation by reference in 14 CFR 71.1 of FAA Order 7400.9Z, Airspace Designations and Reporting Points, dated August 6, 2015, effective September 15, 2015, is amended as follows:

*Paragraph 6005 Class E Airspace Areas Extending Upward From 700 Feet or More Above the Surface of the Earth.*

\* \* \* \* \*

#### AGL ND E5 Park River, ND [New]

Park River-W C Skjerven Field  
(Lat. 48°23'39" N., long. 097°46'51" W.)

That airspace extending upward from 700 feet above the surface within a 7-mile radius of Park River-W C Skjerven Field.

Issued in Fort Worth, TX, on July 28, 2016.

**Walter Tweedy,**

*Acting Manager, Operations Support Group,  
ATO Central Service Center.*

[FR Doc. 2016-18772 Filed 8-10-16; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Docket No. FAA-2016-4629; Airspace  
Docket No. 16-AGL-8]

#### Amendment of Class E Airspace for the Following Michigan Towns; Alma, MI; Bellaire, MI; Cadillac, MI; Drummond Island, MI; Gladwin, MI; Holland, MI; and Three Rivers, MI

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action modifies Class E airspace extending upward from 700 feet above the surface at Gratiot Community Airport, Alma, MI; Antrim County Airport, Bellaire, MI; Wexford County Airport, Cadillac, MI; Drummond Island Airport, Drummond Island, MI; Charles C. Zettel Memorial Airport, Gladwin, MI; Park Township Airport and West Michigan Regional Airport, Holland, MI; and Three Rivers Municipal Dr. Haines Airport, Three Rivers, MI. Decommissioning of non-directional radio beacons (NDB),