

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2022-1581; Project Identifier MCAI-2022-00803-T]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to supersede Airworthiness Directive (AD) 2019-18-07, which applies to certain Airbus SAS Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. AD 2019-18-07 requires repetitive rototest inspections of the open tack holes and rivet holes at the cargo floor support fittings of the fuselage, including doing all applicable related investigative actions and repair if necessary. AD 2019-18-07 also adds actions (modification) for certain airplanes. Since the FAA issued AD 2019-18-07, it was determined that certain airplanes need to do additional work. This proposed AD would continue to require the actions in AD 2019-18-07 and would require additional work for certain airplanes, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by January 27, 2023.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to *regulations.gov*. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at *regulations.gov* under Docket No. FAA-2022-1581; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For material that is proposed for IBR in this NPRM, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email *ADs@easa.europa.eu*; website *easa.europa.eu*. You may find this material on the EASA website at *ad.easa.europa.eu*. It is also available at *regulations.gov* under Docket No. FAA-2022-1581.

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

FOR FURTHER INFORMATION CONTACT: Hye Yoon Jang, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 817-222-5584; email *hye.yoon.jang@faa.gov*.

SUPPLEMENTARY INFORMATION:**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2022-1581; Project Identifier MCAI-2022-00803-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to *regulations.gov*, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and

actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Hye Yoon Jang, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 817-222-5584; email *hye.yoon.jang@faa.gov*. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA issued AD 2019-18-07, Amendment 39-19734 (84 FR 50721, September 26, 2019) (AD 2019-18-07), for certain Airbus SAS Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. AD 2019-18-07 was prompted by MCAI originated by EASA, which is the Technical Agent for the Member States of the European Union. EASA issued AD 2018-0233R1, dated November 28, 2018 (EASA AD 2018-0233R1), to correct an unsafe condition.

AD 2019-18-07 requires repetitive rototest inspections of the open tack holes and rivet holes at the cargo floor support fittings of the fuselage, including doing all applicable related investigative actions, and repair if necessary. AD 2019-18-07 also adds actions (modification) for certain airplanes. The FAA issued AD 2019-18-07 to address cracking in the open tack holes and rivet holes at the cargo floor support fittings of the fuselage. This condition, if not addressed, could affect the structural integrity of the airplane.

AD 2019-18-07 superseded AD 2015-17-14, Amendment 39-18247 (80 FR 52182, August 28, 2015) (AD 2015-17-14). AD 2019-18-07 was based on further analysis and widespread fatigue damage (WFD) evaluations which identified the need to reduce the initial compliance times and repetitive intervals specified in AD 2015-17-14

for the inspections for certain airplanes, and to add work for certain airplanes.

Actions Since AD 2019–18–07 Was Issued

Since the FAA issued AD 2019–18–07, EASA superseded EASA AD 2018–0233R1, and issued EASA AD 2022–0115, dated June 20, 2022 (EASA AD 2022–0115) (also referred to as the MCAI), to correct an unsafe condition for certain A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes; Model A320–211, –212, –214, –215, –216, –231, –232, and –233 airplanes; and Model A321–111, –112, –131, –211, –212, –213, –231, and –232 airplanes. Model A320–215 airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this AD therefore does not include those airplanes in the applicability. The MCAI states that new technical considerations identified the need to introduce additional work for certain airplanes previously modified as specified in AD 2019–18–07. The MCAI also states that cracking in the open tack holes and rivet holes at the cargo floor support fittings of the fuselage, if not addressed, could affect the structural integrity of the airplane.

You may examine the MCAI in the AD docket at *regulations.gov* under Docket No. FAA–2022–1581.

Explanation of Retained Requirements

Although this proposed AD does not explicitly restate the requirements of AD 2019–18–07, this proposed AD would retain all of the requirements of AD 2019–18–07. Those requirements are referenced in EASA AD 2022–0115, which, in turn, is referenced in paragraph (g) of this proposed AD.

Related Service Information Under 1 CFR Part 51

EASA AD 2022–0115 specifies repetitive inspections of the open tack

holes and rivet holes of the fuselage frames below the cargo floor support fittings for cracking, including doing all applicable related investigative actions (inspections of the related frame layer (vertical web/horizontal flange) for cracking) and repair. EASA AD 2022–0115 also specifies procedures for modification of the fuselage (including replacing the shear webs and certain frame clips, adding additional support angles, and cold expanding one tack hole and one tooling home in each frame). EASA AD 2022–0115 also specifies procedures for additional work for certain Model A321 airplanes previously modified as specified AD 2019–18–07. The additional work includes replacing affected fasteners on frames 62 and 63 after doing a rototest for cracking, cold working the fastener holes, and repair.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA’s Determination

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA’s bilateral agreement with the State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2022–0115 described previously, except for any differences

identified as exceptions in the regulatory text of this proposed AD.

Explanation of Required Compliance Information

In the FAA’s ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2022–0115 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2022–0115 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2022–0115 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2022–0115. Service information required by EASA AD 2022–0115 for compliance will be available at *regulations.gov* under Docket No. FAA–2022–1581 after the FAA final rule is published.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 1,267 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Retained actions from AD 2019–18–07 ..	Up to 474 work-hours × \$85 per hour = Up to \$40,290.	\$13,000	Up to \$53,290	Up to \$67,518,430.
New proposed actions	28 work-hours × \$85 per hour = \$2,380	50	\$2,430	\$2,430 per product.

The FAA has received no definitive data that would enable the agency to provide cost estimates for the on-condition actions specified in this proposed AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue

rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section

44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an

unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by:
- a. Removing Airworthiness Directive (AD) 2019–18–07, Amendment 39–19734 (84 FR 50721, September 26, 2019); and
 - b. Adding the following new AD:

Airbus SAS: Docket No. FAA–2022–1581; Project Identifier MCAI–2022–00803–T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by January 27, 2023.

(b) Affected ADs

This AD replaces AD 2019–18–07, Amendment 39–19734 (84 FR 50721, September 26, 2019) (AD 2019–18–07).

(c) Applicability

This AD applies to Airbus SAS Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes; Model A320–211, –212, –214, –216, –231, –232, and –233 airplanes; and Model A321–111, –112, –131,

–211, –212, –213, –231, and –232 airplanes; certificated in any category, as identified in European Aviation Safety Agency (EASA) AD 2022–0115, dated June 20, 2022 (EASA AD 2022–0115).

(d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

(e) Unsafe Condition

This AD was prompted by widespread fatigue damage (WFD) evaluations and full-scale fatigue testing that revealed several broken frames in certain areas of the cargo compartment, and by the determination that additional work is needed for certain airplanes. The FAA is issuing this AD to address cracking in the open tack holes and rivet holes at the cargo floor support fittings of the fuselage. The unsafe condition, if not addressed, could affect the structural integrity of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2022–0115.

(h) Exceptions to EASA AD 2022–0115

(1) Where EASA AD 2022–0115 refers to January 3, 2014 (the effective date of EASA AD 2013–0310), this AD requires using October 2, 2015 (the effective date of AD 2015–17–14, Amendment 39–18247 (80 FR 52182, August 28, 2015)).

(2) Where EASA AD 2022–0115 refers to November 9, 2018 (the effective date of EASA AD 2018–0233 at original issue), this AD requires using October 31, 2019 (the effective date of AD 2019–18–07).

(3) Where EASA AD 2022–0115 refers to its effective date, this AD requires using the effective date of this AD.

(4) Where paragraph (2) of EASA AD 2022–0115 specifies “contact Airbus for approved repair instructions and, within the compliance time identified therein, accomplish those instructions accordingly” if a crack is detected, for this AD if any cracking is detected, the cracking must be repaired before further flight using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(5) The “Remarks” section of EASA AD 2022–0115 does not apply to this AD.

(i) Additional FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as

appropriate. If sending information directly to the International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* Except as required by paragraph (i)(2) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(j) Additional Information

For more information about this AD, contact Hye Yoon Jang, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 817–222–5584; email hye.yoon.jang@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2022–0115, dated June 20, 2022.

(ii) [Reserved]

(3) For EASA AD 2022–0115, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; website easa.europa.eu. You may find this EASA AD on the EASA website at ad.easa.europa.eu.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to: www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on December 7, 2022.

Christina Underwood,

*Acting Director, Compliance & Airworthiness
Division, Aircraft Certification Service.*

[FR Doc. 2022-26976 Filed 12-12-22; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-1417; Project
Identifier AD-2022-00731-T]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation
Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking
(NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all The Boeing Company Model 787-8, 787-9, and 787-10 airplanes. This proposed AD was prompted by reports of a loss of water pressure during flight and water leaks that affected multiple pieces of electronic equipment. This proposed AD would require a detailed visual inspection of all door 1 and door 3 lavatory and galley potable water systems for any missing or incorrectly installed clamshell couplings and applicable on-condition actions. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by January 27, 2023.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to *regulations.gov*. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at *regulations.gov* under Docket No. FAA-2022-1417; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments

received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; website *myboeingfleet.com*. It is also available at *regulations.gov* by searching for and locating Docket No. FAA-2022-1417.

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

FOR FURTHER INFORMATION CONTACT:

Courtney Tuck, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3986; email: *Courtney.K.Tuck@faa.gov*.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2022-1417; Project Identifier AD-2022-00731-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to *regulations.gov*, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial

information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Courtney Tuck, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206-231-3986; email: *Courtney.K.Tuck@faa.gov*. Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA has received reports of a loss of water pressure during flight and water leaks that affected multiple pieces of electronic equipment. One operator reported a significant water leak due to a loose potable water system hose caused by an incorrectly installed clamshell coupling within the lavatory. Another operator reported a water leak due to a detached clamshell coupling below the Door 1 forward center galley countertop adjacent to the gray water interface valve (GWIV) maintenance access compartment. The findings include a loss of water pressure during flight and a potable water system leak, discovered after landing, that caused water to migrate into the forward electronic equipment (EE) bay and affect multiple pieces of electronic equipment. In addition, water pressure was lost during flight. Incorrectly installed or missing lavatory and galley clamshell couplings, if not addressed, could result in water leaks and water migration to critical flight equipment, which may affect the continued safe flight and landing of the airplane.

FAA's Determination

The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Related Service Information Under 1 CFR Part 51

The FAA reviewed Boeing Alert Requirements Bulletin B787-81205-SB380021-00 RB, Issue 001, dated August 12, 2022. This service information specifies procedures for a detailed visual inspection of all door 1