

approval letter must specifically reference this AD.

(2) On or after the effective date of this AD, if any corrosion or cracking is found during any inspection required by this AD: Before further flight, repair the corrosion or cracking using a method approved in accordance with the procedures specified in paragraph (p) of this AD.

(n) New Repetitive Drain Path Inspections

For airplanes having L/N 1 through 3132 inclusive: Within 2 years since the last inspection in accordance with paragraph (k) of this AD or within 2 years after the effective date of this AD, whichever occurs later: Do a general visual inspection of the drain path in the chord frame for debris, in accordance with Figure 2, Steps 1 through 6, of the Accomplishment Instructions of Boeing Alert Service Bulletin 737-53A1075, Revision 3, dated June 8, 2000. Remove any obstruction to the drain hole in the frame chord and replace any deteriorated leveling compound. Treat the area of inspection with corrosion inhibitor BMS 3-23, or equivalent, as specified in the Accomplishment Instructions of Boeing Alert Service Bulletin 737-53A1075, Revision 3, dated June 8, 2000. Repeat the actions required by this paragraph at intervals not to exceed 2 years. Do all actions required by this paragraph in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737-53A1075, Revision 3, dated June 8, 2000. For the purposes of this AD, a general visual inspection is a visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made from within touching distance unless otherwise specified. A mirror may be necessary to ensure visual access to all surfaces in the inspection area. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or droplight and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked.

(o) New Optional Repetitive Aft Pressure Bulkhead Inspections and Corrective Action

For airplanes having L/Ns 1043 through 3132 inclusive: In lieu of performing the first inspection after the effective date of this AD required by paragraph (l)(2) of this AD, operators may do the actions specified in this paragraph. Within 2 years from the most recent aft pressure bulkhead inspection done as specified in the service information identified in paragraph (o)(1), (o)(2), or (o)(3) of this AD, or within 120 days after the effective date of this AD, whichever occurs later: Do a detailed inspection for cracking or corrosion of the aft side of the aft pressure bulkhead at BS 1016 (including the aft sides of the pressure web, aft sides of the pressure chord, pressure chord radius, aft chord, stringer end fitting, system penetration doublers, and fasteners common to the pressure chord and pressure web), in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737-53A1075, Revision 3, dated June 8,

2000. If any corrosion or cracking is found: Before further flight, repair the corrosion or cracking using a method approved in accordance with the procedures specified in paragraph (p) of this AD. Repeat the inspection thereafter at intervals not to exceed 90 days for a period not to exceed 2 years, until the actions required by paragraph (l)(2) of this AD are accomplished.

(1) Boeing Alert Service Bulletin 737-53A1075, Revision 1, dated September 2, 1983.

(2) Boeing Alert Service Bulletin 737-53A1075, Revision 2, dated July 13, 1984.

(3) Boeing Alert Service Bulletin 737-53A1075, Revision 3, dated June 8, 2000.

(p) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (q) of this AD. Information may be emailed to 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair required by this AD if it is approved by the Boeing Commercial Airplanes ODA that has been authorized by the Manager, Seattle ACO, to make those findings. For a repair method to be approved, the repair must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) AMOCs approved previously in accordance with AD 2002-10-11, Amendment 39-12757 (67 FR 36085, May 23, 2002), are approved as AMOCs for the corresponding provisions of this AD.

(q) Related Information

For more information about this AD, contact Alan Pohl, Aerospace Engineer, Aircraft Branch, ANM-120S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: (425) 917-6450; fax: (425) 917-6590; email: alan.pohl@faa.gov.

(r) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(3) The following service information was approved for IBR on June 27, 2002 (67 FR 36085, May 23, 2002).

(i) Boeing Alert Service Bulletin 737-53A1075, Revision 1, dated September 2, 1983.

(ii) Boeing Alert Service Bulletin 737-53A1075, Revision 2, dated July 13, 1984.

(iii) Boeing Alert Service Bulletin 737-53A1075, Revision 3, dated June 8, 2000.

(4) For Boeing service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>.

(5) You may view this service information at FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(6) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on February 18, 2014.

Ross Landes,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2014-04546 Filed 3-3-14; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Docket No. FAA-2013-0917; Airspace Docket No. 13-ACE-16]

Amendment of Class D Airspace; St. Joseph, MO

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: This action amends Class D airspace at St. Joseph, MO. Additional controlled airspace is necessary to accommodate new Area Navigation (RNAV) Standard Instrument Approach Procedures at Rosecrans Municipal Airport. The FAA is taking this action to enhance the safety and management of Instrument Flight Rule (IFR) operations at the airport.

DATES: *Effective date:* 0901 UTC, May 29, 2014. The Director of the Federal Register approves this incorporation by reference action under 1 CFR Part 51, subject to the annual revision of FAA Order 7400.9 and publication of conforming amendments.

FOR FURTHER INFORMATION CONTACT: Scott Enander, Central Service Center, Operations Support Group, Federal Aviation Administration, Southwest Region, 2601 Meacham Blvd., Fort Worth, TX 76137; telephone 817-321-7716.

SUPPLEMENTARY INFORMATION:**History**

On December 9, 2013, the FAA published in the **Federal Register** a notice of proposed rulemaking (NPRM) to amend Class D airspace for the St. Joseph, MO, area, creating additional controlled airspace at Rosecrans Municipal Airport (78 FR 73749) Docket No. FAA–2013–0917. Interested parties were invited to participate in this rulemaking effort by submitting written comments on the proposal to the FAA. No comments were received. Class D airspace designations are published in paragraph 5000 of FAA Order 7400.9X dated August 7, 2013, and effective September 15, 2013, which is incorporated by reference in 14 CFR 71.1. The Class D airspace designations listed in this document will be published subsequently in the Order.

The Rule

This action amends Title 14 Code of Federal Regulations (14 CFR) Part 71 by amending Class D airspace at Rosecrans Municipal Airport, St. Joseph, MO, to contain aircraft executing new standard instrument approach procedures at the airport. Accordingly, additional segments will extend from the 4.3-mile radius of the airport to 4.9 miles northwest and 4.5 miles southeast of the airport, to retain the safety and management of IFR aircraft in Class D airspace to/from the en route environment.

The FAA has determined that this regulation only involves an established body of technical regulations for which frequent and routine amendments are necessary to keep them operationally current. Therefore, this regulation: (1) Is not a “significant regulatory action” under Executive Order 12866; (2) is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034; February 26, 1979); and (3) does not warrant preparation of a regulatory evaluation as the anticipated impact is so minimal. Since this is a routine matter that only affects air traffic procedures and air navigation, it is certified that this rule, when promulgated, does not have a significant economic impact on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

The FAA’s authority to issue rules regarding aviation safety is found in Title 49 of the U.S. Code. Subtitle 1, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency’s authority. This rulemaking is promulgated under the authority

described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it amends controlled airspace at Rosecrans Municipal Airport, St. Joseph, MO.

Environmental Review

The FAA has determined that this action qualifies for categorical exclusion under the National Environmental Policy Act in accordance with FAA Order 1050.1E, “Environmental Impacts: Policies and Procedures,” paragraph 311a. This airspace action is not expected to cause any potentially significant environmental impacts, and no extraordinary circumstances exist that warrant preparation of an environmental assessment.

List of Subjects in 14 CFR Part 71

Airspace, Incorporation by reference, Navigation (Air).

Adoption of the Amendment

In consideration of the foregoing, the Federal Aviation Administration amends 14 CFR Part 71 as follows:

PART 71—DESIGNATION OF CLASS A, B, C, D, AND E AIRSPACE AREAS; AIR TRAFFIC SERVICE ROUTES; AND REPORTING POINTS

- 1. The authority citation for 14 CFR Part 71 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40103, 40113, 40120; E.O. 10854, 24 FR 9565, 3 CFR, 1959–1963 Comp., p. 389.

§ 71.1 [Amended]

- 2. The incorporation by reference in 14 CFR 71.1 of the Federal Aviation Administration Order 7400.9X, Airspace Designations and Reporting Points, dated August 7, 2013, and effective September 15, 2013, is amended as follows:

Paragraph 5000 Class D Airspace.
* * * * *

ACE MO D St. Joseph, MO [Amended]

St. Joseph, Rosecrans Memorial Airport, MO
(Lat. 39°46’19” N., long. 94°54’35” W.)

That airspace extending upward from the surface to and including 3,300 feet MSL within a 4.3-mile radius of Rosecrans Memorial Airport, and within 1.2 miles each side of the 136° bearing from the airport extending from the 4.3-mile radius to 4.5 miles southeast of the airport, and within 1.2 miles each side of the 316° bearing from the airport extending from the 4.3-mile radius to 4.9 miles northwest of the airport. This Class D airspace area is effective during the

specific dates and times established in advance by a Notice to Airmen. The effective date and time will thereafter be continuously published in the Airport/Facility Directory.

Issued in Fort Worth, Texas, on February 10, 2014.

Kent M. Wheeler,

Manager, Operations Support Group, ATO Central Service Center.

[FR Doc. 2014–04456 Filed 3–3–14; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA–2013–0954; Airspace Docket No. 13–AGL–35]

Amendment of Class D Airspace; St. Paul, MN

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule, technical amendment.

SUMMARY: This action amends Class D airspace within the St. Paul, MN, area by updating the geographic coordinates for St. Paul Downtown Airport/Holman Field, and South St. Paul Municipal Airport-Richard E. Fleming Field. This action does not change the boundaries or operating requirements of the airspace.

DATES: *Effective date:* 0901 UTC, May 29, 2014. The Director of the Federal Register approves this incorporation by reference action under 1 CFR Part 51, subject to the annual revision of FAA Order 7400.9 and publication of conforming amendments.

FOR FURTHER INFORMATION CONTACT: Scott Enander, Central Service Center, Operations Support Group, Federal Aviation Administration, Southwest Region, 2601 Meacham Blvd., Fort Worth, TX 76137; telephone 817–321–7716.

SUPPLEMENTARY INFORMATION:**The Rule**

This action amends Title 14 Code of Federal Regulations (14 CFR) Part 71 by adjusting the geographic coordinates, within Class D airspace, of St. Paul Downtown Airport/Holman Field, and South St. Paul Municipal Airport-Richard E. Fleming Field, St. Paul, MN, to coincide with the FAA’s aeronautical database. This is an administrative change and does not affect the boundaries, altitudes, or operating requirements of the airspace, therefore, notice and public procedures under 5 U.S.C. 553(b) are unnecessary.