

encouraged to submit written remarks to the docket, which will be made part of the record.

(4) For information on services for individuals with disabilities or to request technical assistance at the meeting, please email [DHSMeetingSupport@icf.com](mailto:DHSMeetingSupport@icf.com) by June 25, 2021.

(5) Representatives of DHS will preside over the meeting.

(6) The meeting will be recorded by a court reporter. The transcript will be made available at [www.regulations.gov](http://www.regulations.gov). Any person who is interested in purchasing a copy of the transcript should contact the court reporter directly.

(7) Statements made by DHS representatives are intended to facilitate discussion of the issues or to clarify issues. Any statement made during the meeting by a DHS representative is not intended to be, and should not be construed as, DHS's official position.

(8) The meeting is designed to invite public views and gather additional information. No individual will be subject to cross-examination by any other participant; however, DHS representatives may ask questions to clarify a statement.

**Kelli Ann Burriesci,**

*Acting Under Secretary, Office of Strategy, Policy, and Plans, United States Department of Homeland Security.*

[FR Doc. 2021-12616 Filed 6-15-21; 8:45 am]

BILLING CODE 9110-9M-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2021-0501; Project Identifier MCAI-2021-00168-T]

RIN 2120-AA64

#### Airworthiness Directives; Airbus SAS Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede Airworthiness Directive (AD) 2019-20-10, which applies to certain Airbus SAS Model A318 series airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; Model A320-211, -212, -214, -216, -231, -232, and -233 airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes. AD 2019-20-10 requires repetitive

rototest inspections of the holes at the door stop fittings for any cracking, and corrective actions if necessary. Since the FAA issued AD 2019-20-10, a clarification of a certain compliance time for the rototest inspection was added. This proposed AD would clarify a certain compliance time and continue to require repetitive rototest inspections of the holes at the door stop fittings for any cracking, and repair if necessary, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by August 2, 2021.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that will be incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0501.

#### Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0501; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

#### FOR FURTHER INFORMATION CONTACT:

Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email [Sanjay.Ralhan@faa.gov](mailto:Sanjay.Ralhan@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2021-0501; Project Identifier MCAI-2021-00168-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this proposed AD.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3223; email [Sanjay.Ralhan@faa.gov](mailto:Sanjay.Ralhan@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

## Background

The FAA issued AD 2019–20–10, Amendment 39–19763 (84 FR 61526, November 13, 2019) (AD 2019–20–10), which applies to certain Airbus SAS Model A318 series airplanes; Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes; Model A320–211, –212, –214, –216, –231, –232, and –233 airplanes; and Model A321–111, –112, –131, –211, –212, –213, –231, and –232 airplanes. AD 2019–20–10 requires repetitive rototest inspections of the holes at the door stop fittings for any cracking, and corrective actions if necessary. The FAA issued AD 2019–20–10 to address cracking of the web holes at the door stop fittings, which could affect the structural integrity of the airplane.

## Actions Since AD 2019–20–10 Was Issued

Since the FAA issued AD 2019–20–10, a clarification of the initial compliance time for the rototest inspection, related to the incorporation of certain airworthiness limitations (ALI) tasks has been added. Certain airworthiness limitations (ALI) tasks referenced in EASA AD 2018–0289, dated December 21, 2018 (which corresponds to FAA AD 2019–20–10) were initially applicable only to the left- and right-hand door stop fitting holes at position 1 or 7 at fuselage frame (FR)20, and, at a later stage, were made applicable to the left- and right-hand door stop fitting holes at position 1 or 7 at fuselage FR16. An operator reported a possible misunderstanding of the compliance time in EASA AD 2018–0289. Therefore, EASA determined that the compliance time language related to accomplishment of those ALI tasks needed to be clarified.

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2018–0289R1, dated February 10, 2021 (EASA AD 2018–0289R1) (also referred to as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for certain Airbus SAS Model A318 series airplanes; Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes; Model A320–211, –212, –214, –215, –216, –231, –232, and –233

airplanes; and Model A321–111, –112, –131, –211, –212, –213, –231, and –232 airplanes. EASA AD 2018–0289R1 supersedes EASA AD 2018–0289 (which corresponds to FAA AD 2019–20–10). Model A320–215 airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this AD therefore does not include those airplanes in the applicability.

This proposed AD was prompted by a report that cracks were detected on FR16 and FR20 web holes and passenger door intercostal fitting holes at the door stop fitting locations. The FAA is proposing this AD to address cracking of the web holes at the door stop fittings, which could affect the structural integrity of the airplane. See the MCAI for additional background information.

## Explanation of Retained Requirements

Although this proposed AD does not explicitly restate the requirements of AD 2019–20–10, this proposed AD would retain all of the requirements of AD 2019–20–10. Those requirements are referenced in EASA AD 2018–0289R1, which, in turn, is referenced in paragraph (g) of this proposed AD.

## Related Service Information Under 1 CFR Part 51

EASA AD 2018–0289R1 describes procedures for repetitive rototest inspections of the holes at the door stop fittings for any cracking and repair if necessary. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

## FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI referenced above. The FAA is proposing this AD because the FAA evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or

develop on other products of the same type design.

## Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in EASA AD 2018–0289R1 described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this AD.

## Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA initially worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has since coordinated with other manufacturers and civil aviation authorities (CAAs) to use this process. As a result, EASA AD 2018–0289R1 will be incorporated by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2018–0289R1 in its entirety, through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in the EASA AD does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in the EASA AD. Service information specified in EASA AD 2018–0289R1 that is required for compliance with EASA AD 2018–0289R1 will be available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0501 after the FAA final rule is published.

## Costs of Compliance

The FAA estimates that this proposed AD affects 1,528 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

## ESTIMATED COSTS FOR REQUIRED ACTIONS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Retained actions from AD 2019–20–10 (1,229 airplanes).	33 work-hours × \$85 per hour = \$2,805 .....	\$0	\$2,805	\$3,447,345
Inspections .....	33 work-hours × 85 per hour = 2,805 .....	0	2,805	4,286,040

The FAA estimates the following costs to do any necessary on-condition action that would be required based on

the results of any required actions. The FAA has no way of determining the

number of aircraft that might need this on-condition action:

#### ESTIMATED COSTS OF ON-CONDITION ACTIONS

Labor cost	Parts cost	Cost per product
51 work-hours × \$85 per hour = \$4,335 .....	\$350	\$4,685

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a "significant regulatory action" under Executive Order 12866,

(2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator,

the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by:

■ a. Removing Airworthiness Directive (AD) 2019–20–10, Amendment 39–19763 (84 FR 61526, November 13, 2019), and

■ b. Adding the following new AD:

**Airbus SAS:** Docket No. FAA–2021–0501; Project Identifier MCAI–2021–00168–T.

##### (a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by August 2, 2021.

##### (b) Affected ADs

This AD replaces AD 2019–20–10, Amendment 39–19763 (84 FR 61526, November 13, 2019) (AD 2019–20–10).

##### (c) Applicability

This AD applies to Airbus SAS airplanes specified in paragraphs (c)(1) through (4) of this AD, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2018–0289R1, dated February 10, 2021 (EASA AD 2018–0289R1).

(1) Model A318–111, –112, –121, and –122 airplanes.

(2) Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes.

(3) Model A320–211, –212, –214, –216, –231, –232, and –233 airplanes.

(4) Model A321–111, –112, –131, –211, –212, –213, –231, and –232 airplanes.

##### (d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

##### (e) Reason

This AD was prompted by a report that cracks were detected on frame (FR)16 and FR20 web holes and passenger door intercostal fitting holes at the door stop fitting locations, and a determination that a certain compliance time needs to be clarified. The FAA is issuing this AD to address cracking of the web holes at the door stop fittings, which could affect the structural integrity of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2018–0289R1.

#### (h) Exceptions to EASA AD 2018–0289R1

(1) Where EASA AD 2018–0289R1 refers to its effective date, this AD requires using the effective date of this AD.

(2) The "Remarks" section of EASA AD 2018–0289R1 does not apply to this AD.

(3) Where Table 1 of EASA AD 2018–0289R1 refers to a compliance time "after 31 May 2017," this AD requires using a compliance time after May 31, 2018 (the effective date of task 531103–01–1 in "ALS Part 2 rev. 6").

(4) Where paragraphs (3) and (6) of EASA AD 2018–0289R1 refers to actions that have been done "in accordance with Airbus Repair Design Approval Sheet (RDAS)," this AD includes repair done "in accordance with a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature."

#### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov.

(i) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(ii) AMOCs approved previously for AD 2019–20–10 are approved as AMOCs for the corresponding provisions of EASA AD 2018–0289R1 that are required by paragraph (g) of this AD, except for those airplanes having a compliance time specified in "Table 1:

Inspection Thresholds,” Row B, of EASA AD 2018–0289R1.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* For any service information referenced in EASA AD 2018–0289R1 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (j) Related Information

(1) For information about EASA AD 2018–0289R1, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0501.

(2) For more information about this AD, contact Sanjay Ralhan, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3223; email [Sanjay.Ralhan@faa.gov](mailto:Sanjay.Ralhan@faa.gov).

Issued on June 10, 2021.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2021–12603 Filed 6–15–21; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2021–0463; Project Identifier 2018–SW–050–AD]

RIN 2120–AA64

#### Airworthiness Directives; Leonardo S.p.a. Helicopters

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for Leonardo S.p.a. (Leonardo) Model AB139 and AW139 helicopters with certain main rotor blades MRB installed. This proposed AD was prompted by a report of an in-flight loss of a main rotor blade (MRB) tip cap. This proposed AD would require inspecting the MRB tip cap for disbonding. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by August 2, 2021.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* (202) 493–2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Leonardo S.p.A. Helicopters, Emanuele Bufano, Head of Airworthiness, Viale G. Agusta 520, 21017 C. Costa di Samarate (Va) Italy; telephone +39–0331–225074; fax +39–0331–229046; or at <https://customerportal.leonardocompany.com/en-US/>. You may view this service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110.

#### Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No.

FAA–2021–0463 or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the European Aviation Safety Agency (now European Union Aviation Safety Agency (EASA) AD, any comments received, and other information. The street address for Docket Operations is listed above.

#### FOR FURTHER INFORMATION CONTACT:

Bang Nguyen, Aerospace Engineer, Certification Section, Fort Worth ACO Branch, Compliance & Airworthiness Division, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone (817) 222–4973; email [bang.nguyen@faa.gov](mailto:bang.nguyen@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA–2021–0463; Project Identifier 2018–SW–050–AD” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI