

aguacatae, *C. perseae*, *Copturus aguacatae*, or *Stenoma catenifer*" and adding the words "listed in the operational workplan" in their place.

■ 1. In paragraph (f), by removing the word "will" and adding the word "may" in its place.

The revisions and additions read as follows:

\$ 319.56–30 Hass avocados from Mexico.

* * * * *

(c) *Safeguards in Mexico.* The avocados must have been grown in an orchard located in a municipality that meets the requirements of paragraph (c)(1) of this section. The orchard in which the avocados are grown must meet the requirements of paragraph (c)(2) of this section. The avocados must be packed for export to the United States in a packinghouse that meets the requirements of paragraph (c)(3) of this section. The Mexican national plant protection organization (NPPO) must provide an annual operational workplan to APHIS that details the activities that the Mexican NPPO will, subject to APHIS' approval of the workplan, carry out to meet the requirements of this section; APHIS will be directly involved with the Mexican NPPO in the monitoring and supervision of those activities. The personnel conducting the trapping and pest surveys must be hired, trained, and supervised by the Mexican NPPO or by the State delegate of the Mexican NPPO.

* * * * *

(3) * * *

(vii) The avocados must be packed in clean, new boxes or bulk shipping bins, or in clean plastic reusable crates. The boxes, bins, or crates must be clearly marked with the identity of the grower, packinghouse, and exporter.

(viii) * * * If, at the port of export for consignments shipped by air or sea, the packed avocados are transferred into a non-refrigerated container, the boxes, bins, or crates must be covered with a lid, insect-proof mesh, or other material to protect the avocados from fruit-fly infestation prior to leaving the packinghouse. Those safeguards must be intact at the time the consignment arrives in the United States.

* * * * *

Done in Washington, DC, this 11th day of February 2015.

Kevin Shea,

Administrator, Animal and Plant Health Inspection Service.

[FR Doc. 2015–03289 Filed 2–17–15; 8:45 am]

BILLING CODE 3410–34–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2015–0088; Directorate Identifier 2014–NM–179–AD]

RIN 2120–AA64

Airworthiness Directives; Bombardier, Inc. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc. Model BD–100–1A10 (Challenger 300) airplanes. This proposed AD was prompted by testing of the spoiler electronic control unit (SECU) software for an upgrade, which revealed a timing error between the command and monitor channels. This proposed AD would require revising the maintenance or inspection program to incorporate repetitive operational tests of the aileron disconnect system, and corrective action if necessary. This proposed AD would also require modification and reidentification of the SECU, which would terminate the repetitive operational tests. We are proposing this AD to prevent a timing error in the SECU software, which, in combination with failure of the roll disconnect switch, could result in complete loss of spoiler functionality and consequent reduced controllability of the airplane.

DATES: We must receive comments on this proposed AD by April 6, 2015.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202–493–2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone

514–855–5000; fax 514–855–7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–0088; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Assata Dessaline, Aerospace Engineer, Avionics and Service Branch, ANE–172, FAA, New York Aircraft Certification Office, 1600 Stewart Avenue, Suite 410, Westbury, New York 11590; telephone 516–228–7301; fax 516–794–5531.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA–2015–0088; Directorate Identifier 2014–NM–179–AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF–2014–24, dated August 5, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Bombardier, Inc. Model BD–

100–1A10 (Challenger 300) airplanes. The MCAI states:

During testing of the software for an upgrade of the spoiler electronic control unit (SECU), a timing error between the Command and Monitor channels was found in the SECU software. This timing error, if not corrected, in combination with the failure of the roll disconnect switch, may lead to a complete loss of spoiler functionality and result in a reduction or complete loss of aeroplane roll control.

This [TCCA] AD mandates the SECU software modification to correct the timing error and to change the inspection interval for a maintenance task based on System Functional Hazard Analysis [by revising the inspection or maintenance program.]

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–0088.

Related Service Information Under 14 CFR Part 51

Bombardier, Inc. has issued Service Bulletin 100–27–16, dated October 31, 2013. The service information describes procedures for modification and reidentification of the SECU. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI. This service information is reasonably available; see **ADDRESSES** for ways to access this service information.

FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

This AD requires revisions to certain operator maintenance documents to include new actions (e.g., inspections). Compliance with these actions is required by 14 CFR 91.403(c). For airplanes that have been previously modified, altered, or repaired in the areas addressed by this AD, the operator may not be able to accomplish the actions described in the revisions. In this situation, to comply with 14 CFR 91.403(c), the operator must request approval for an alternative method of compliance according to paragraph (j)(1) of this AD. The request should include a description of changes to the required

inspections that will ensure the continued operational safety of the airplane.

Costs of Compliance

We estimate that this proposed AD affects 107 airplanes of U.S. registry.

We also estimate that it would take up to 6 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be up to \$54,570, or up to \$510 per product.

We have received no definitive data on the parts cost for doing the modification in this proposed AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

Bombardier, Inc.: Docket No. FAA–2015–0088; Directorate Identifier 2014–NM–179–AD.

(a) Comments Due Date

We must receive comments by April 6, 2015.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Bombardier, Inc. Model BD–100–1A10 (Challenger 300) airplanes, equipped with a spoiler electronic control unit (SECU) having part number (P/N) C47330–006, C47330–007, or C47330–008; certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 27, Flight Controls.

(e) Reason

This AD was prompted by testing of the spoiler electronic control unit (SECU) software, which revealed a timing error between the command and monitor channels in the software. We are issuing this AD to prevent a timing error in the SECU software, which, in combination with failure of the roll disconnect switch, could result in complete loss of spoiler functionality and consequent reduced controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Revise the Maintenance or Inspection Program

Within 600 flight hours since the most recent operational test of the aileron disconnect system for spoiler functionality as of the effective date of this AD, or within 400 flight hours after the effective date of this AD, whichever occurs first: Revise the maintenance or inspection program, as applicable, to incorporate repetitive operational tests of the aileron disconnect system for spoiler functionality, and all

applicable corrective actions, using a method approved by the Manager, New York ACO, ANE-170, FAA.

Note 1 to paragraph (g) of this AD: Guidance on operational tests of the aileron disconnect system can be found in the BD-100-1A10 Time Limits/Maintenance Checks (TLMC) Manual.

(h) Modification of the SECU

Within 1,600 flight hours or 48 months after the effective date of this AD, whichever occurs first: Modify and re-identify the SECU, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 100-27-16, dated October 31, 2013. Doing the actions required by this paragraph terminates the actions required by paragraph (g) of this AD.

(i) Parts Installation Prohibition

As of the effective date of this AD, no person may install an SECU, P/N C47330-006, C47330-007, or C47330-008, on any airplane.

(j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or TCCA; or Bombardier, Inc.'s TCCA DAO. If approved by the DAO, the approval must include the DAO-authorized signature.

(k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2014-24, dated August 5, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-FAA-2015-0088.

(2) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW.,

Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on February 2, 2015.

Dionne Palermo,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2015-02695 Filed 2-17-15; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2015-0242; Directorate Identifier 2014-NM-100-AD]

RIN 2120-AA64

Airworthiness Directives; Airbus Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for all Airbus Model A300 B4-603, B4-605R, B4-620, B4-622, B4-622R airplanes; all Airbus Model A300 C4-605R Variant F airplanes; and certain Airbus Model A300 F4-605R airplanes. This proposed AD was prompted by the manufacturer's review of all repairs accomplished using the structural repair manual. This review was done using revised fatigue and damage tolerance calculations. This proposed AD would require an inspection of the surrounding panels of the left and right forward passenger doors, and corrective actions if necessary. We are proposing this AD to detect and correct previous incomplete or inadequate repairs to the surrounding panels of the left and right forward passenger doors and the fail-safe ring, which could negatively affect the structural integrity of the airplane.

DATES: We must receive comments on this proposed AD by April 6, 2015.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-

30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email account.airworth-eas@airbus.com; Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus SAS, Airworthiness Office—EAW, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email account.airworth-eas@airbus.com; Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-0242; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-2125; fax 425-227-1149.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2015-0242; Directorate Identifier 2014-NM-100-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.