

Rules and Regulations

Federal Register

Vol. 87, No. 128

Wednesday, July 6, 2022

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents.

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-0394; Project Identifier MCAI-2021-00904-T; Amendment 39-22094; AD 2022-13-08]

RIN 2120-AA64

Airworthiness Directives; De Havilland Aircraft of Canada Limited (Type Certificate Previously Held by Bombardier, Inc.) Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain De Havilland Aircraft of Canada Limited Model DHC-8-401 and -402 airplanes. This AD was prompted by reports of nose wheel steering (NWS) hydraulic motors jamming during pushback or towing. This AD requires doing an inspection to determine the part number and serial number of the NWS hydraulic motor, and re-identifying or replacing the NWS hydraulic motor if necessary. This AD also prohibits the installation of certain NWS hydraulic motors. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective August 10, 2022.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of August 10, 2022.

ADDRESSES: For service information identified in this final rule, contact De Havilland Aircraft of Canada Limited, Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email thd@dehavilland.com; internet <https://dehavilland.com>. You may view this service information at the FAA,

Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0394.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0394; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The address for Docket Operations is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Elizabeth Dowling, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued TCCA AD CF-2021-28, dated August 5, 2021 (also referred to after this as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for certain De Havilland Aircraft of Canada Limited Model DHC-8-401 and -402 airplanes. You may examine the MCAI in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0394.

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain De Havilland Aircraft of Canada Limited Model DHC-8-401 and -402 airplanes. The NPRM published in the **Federal Register** on April 6, 2022 (87 FR 19813). The NPRM was prompted by reports of NWS hydraulic motors jamming during pushback or towing. The NPRM proposed to require

doing an inspection to determine the part number and serial number of the NWS hydraulic motor, and re-identifying or replacing the NWS hydraulic motor if necessary. The NPRM also proposed to prohibit the installation of certain NWS hydraulic motors. The FAA is issuing this AD to address a possible NWS hydraulic motor jam, which could lead to a runway excursion and loss of controllability of the airplane. See the MCAI for additional background information.

Discussion of Final Airworthiness Directive

Comments

The FAA received a comment from The Air Line Pilots Association, International (ALPA), who supported the NPRM without change.

Conclusion

The FAA reviewed the relevant data, considered the comment received, and determined that air safety requires adopting this AD as proposed. Except for minor editorial changes, this AD is adopted as proposed in the NPRM. None of the changes will increase the economic burden on any operator. Accordingly, the FAA is issuing this AD to address the unsafe condition on these products.

Related Service Information Under 14 CFR Part 51

De Havilland Aircraft of Canada Limited has issued Service Bulletin 84-32-164, Revision A, dated May 13, 2021. This service information describes procedures for doing an inspection to determine the part number and serial number of the NWS hydraulic motor, and re-identifying the redesigned NWS hydraulic motor, or replacing the original NWS hydraulic motor, as necessary.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

The FAA estimates that this AD affects 52 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

| Labor cost | Parts cost | Cost per product | Cost on U.S. operators |
|---|------------|---------------------|------------------------|
| Up to 11 work-hours × \$85 per hour = \$935 | \$80 | Up to \$1,015 | Up to \$52,780. |

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

2022–13–08 De Havilland Aircraft of Canada Limited (Type Certificate Previously Held by Bombardier, Inc.): Amendment 39–22094; Docket No. FAA–2022–0394; Project Identifier MCAI–2021–00904–T.

(a) Effective Date

This airworthiness directive (AD) is effective August 10, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to De Havilland Aircraft of Canada Limited Model DHC–8–401 and –402 airplanes, certificated in any category, serial numbers 4001 and 4003 through 4622 inclusive.

(d) Subject

Air Transport Association (ATA) of America Code 32, Landing gear.

(e) Unsafe Condition

This AD was prompted by reports of nose wheel steering (NWS) hydraulic motors jamming during pushback or towing caused by worn out piston rod shoes. The FAA is issuing this AD to address a possible NWS hydraulic motor jam, which could lead to a runway excursion and loss of controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Within 12,000 flight hours or 72 months, whichever occurs first after the effective date of this AD: Inspect to determine the part number and serial number of the NWS hydraulic motor, and re-identify or replace the NWS hydraulic motor, as applicable, in accordance with paragraph 3.B. of the Accomplishment Instructions of De Havilland Aircraft of Canada Service Bulletin 84–32–164, Revision A, dated May 13, 2021.

(h) Parts Installation Prohibition

As of the effective date of this AD, no person may install a NWS hydraulic motor, part number (P/N) RS1267–1, P/N RS1267–

1 MOD SB 32–13, P/N RS1267–2, P/N RS1267–2 MOD SB 32–13, and P/N RS1267–3, on any airplane.

(i) No Return of Parts

Although De Havilland Aircraft of Canada Service Bulletin 84–32–164, Revision A, dated May 13, 2021, specifies to return certain parts to the manufacturer, this AD does not include that requirement.

(j) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using De Havilland Aircraft of Canada Limited Service Bulletin 84–32–164, dated April 20, 2020.

(k) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or De Havilland Aircraft of Canada Limited's TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(l) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) TCCA AD CF–2021–28, dated August 5, 2021, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0394.

(2) For more information about this AD, contact Elizabeth Dowling, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone

516–228–7300; email 9-avs-nyaco-cos@faa.gov.

(3) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (m)(3) and (4) of this AD.

(m) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) De Havilland Aircraft of Canada Limited Service Bulletin 84–32–164, Revision A, dated May 13, 2021.

(ii) [Reserved]

(3) For service information identified in this AD, contact De Havilland Aircraft of Canada Limited, Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416–375–4000; fax 416–375–4539; email thd@dehavilland.com; internet <https://dehavilland.com>.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on June 13, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022–14280 Filed 7–5–22; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 97

[Docket No. 31437; Amdt. No. 4016]

Standard Instrument Approach Procedures, and Takeoff Minimums and Obstacle Departure Procedures; Miscellaneous Amendments

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: This rule amends, suspends, or removes Standard Instrument Approach Procedures (SIAPs) and associated Takeoff Minimums and Obstacle Departure Procedures for operations at certain airports. These regulatory actions are needed because of

the adoption of new or revised criteria, or because of changes occurring in the National Airspace System, such as the commissioning of new navigational facilities, adding new obstacles, or changing air traffic requirements. These changes are designed to provide for the safe and efficient use of the navigable airspace and to promote safe flight operations under instrument flight rules at the affected airports.

DATES: This rule is effective July 6, 2022. The compliance date for each SIAP, associated Takeoff Minimums, and ODP is specified in the amendatory provisions.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of July 6, 2022.

ADDRESSES: Availability of matter incorporated by reference in the amendment is as follows:

For Examination

1. U.S. Department of Transportation, Docket Ops-M30, 1200 New Jersey Avenue SE, West Bldg., Ground Floor, Washington, DC 20590–0001;

2. The FAA Air Traffic Organization Service Area in which the affected airport is located;

3. The office of Aeronautical Information Services, 6500 South MacArthur Blvd., Oklahoma City, OK 73169 or,

4. The National Archives and Records Administration (NARA).

For information on the availability of this material at NARA, email fr.inspection@nara.gov or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Availability

All SIAPs and Takeoff Minimums and ODPs are available online free of charge. Visit the National Flight Data Center online at nfdc.faa.gov to register. Additionally, individual SIAP and Takeoff Minimums and ODP copies may be obtained from the FAA Air Traffic Organization Service Area in which the affected airport is located.

FOR FURTHER INFORMATION CONTACT:

Thomas J. Nichols, Flight Procedures and Airspace Group, Flight Technologies and Procedures Division, Flight Standards Service, Federal Aviation Administration. Mailing Address: FAA Mike Monroney Aeronautical Center, Flight Procedures and Airspace Group, 6500 South MacArthur Blvd., Registry Bldg 29 Room 104, Oklahoma City, OK 73169. Telephone: (405) 954–4164.

SUPPLEMENTARY INFORMATION: This rule amends 14 CFR part 97 by amending the

referenced SIAPs. The complete regulatory description of each SIAP is listed on the appropriate FAA Form 8260, as modified by the National Flight Data Center (NFDCA)/Permanent Notice to Airmen (P–NOTAM), and is incorporated by reference under 5 U.S.C. 552(a), 1 CFR part 51, and 14 CFR 97.20. The large number of SIAPs, their complex nature, and the need for a special format make their verbatim publication in the **Federal Register** expensive and impractical. Further, airmen do not use the regulatory text of the SIAPs, but refer to their graphic depiction on charts printed by publishers of aeronautical materials. Thus, the advantages of incorporation by reference are realized and publication of the complete description of each SIAP contained on FAA form documents is unnecessary. This amendment provides the affected CFR sections, and specifies the SIAPs and Takeoff Minimums and ODPs with their applicable effective dates. This amendment also identifies the airport and its location, the procedure and the amendment number.

Availability and Summary of Material Incorporated by Reference

The material incorporated by reference is publicly available as listed in the **ADDRESSES** section.

The material incorporated by reference describes SIAPs, Takeoff Minimums and ODPs as identified in the amendatory language for Part 97 of this final rule.

The Rule

This amendment to 14 CFR part 97 is effective upon publication of each separate SIAP and Takeoff Minimums and ODP as amended in the transmittal. For safety and timeliness of change considerations, this amendment incorporates only specific changes contained for each SIAP and Takeoff Minimums and ODP as modified by FDC permanent NOTAMs.

The SIAPs and Takeoff Minimums and ODPs, as modified by FDC permanent NOTAM, and contained in this amendment are based on criteria contained in the U.S. Standard for Terminal Instrument Procedures (TERPS). In developing these changes to SIAPs and Takeoff Minimums and ODPs, the TERPS criteria were applied only to specific conditions existing at the affected airports. All SIAP amendments in this rule have been previously issued by the FAA in a FDC NOTAM as an emergency action of immediate flight safety relating directly to published aeronautical charts.