

International Validation Branch, FAA; or the Civil Aviation Authority of Israel (CAAI); or the CAAI's authorized Designee. If approved by the CAAI Designee, the approval must include the Designee's authorized signature.

#### (k) Related Information

(1) For CAAI AD ISR I-57-2021-12-3, dated January 01, 2022, contact Civil Aviation Authority of Israel (CAAI), P.O. Box 1101, Golan Street, Airport City, 70100, Israel; telephone 972-3-9774665; fax 972-3-9774592; email [aip@mot.gov.il](mailto:aip@mot.gov.il). You may find this CAAI AD on the CAAI website at <https://www.caa.gov.il>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. This material may be found in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0887.

(2) For more information about this AD, contact Dan Rodina, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th Street, Des Moines, WA 98198; telephone and fax 206-231-3225; email [dan.rodina@faa.gov](mailto:dan.rodina@faa.gov).

Issued on July 15, 2022.

**Gaetano A. Sciortino,**

*Deputy Director for Strategic Initiatives,  
Compliance & Airworthiness Division,  
Airframe Certification Service.*

[FR Doc. 2022-15554 Filed 7-20-22; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2022-0886; Project Identifier MCAI-2022-00261-T]

**RIN 2120-AA64**

#### Airworthiness Directives; Bombardier, Inc., Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain Bombardier, Inc., Model BD-700-2A12 airplanes. This proposed AD was prompted by reports of insufficient clearance between the surrounding structure/skin of the aircraft and select bleed air ducts that supply the wing ice protection system (WIPS) in the rear fuselage. This proposed AD would require inspecting the bleed air duct and surrounding structure for minimum clearance and damage, and applicable corrective actions. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by September 6, 2022.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202-493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Bombardier Business Aircraft Customer Response Center, 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-2999; email [ac.yul@aero.bombardier.com](mailto:ac.yul@aero.bombardier.com); internet <https://www.bombardier.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

#### Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0886; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

**FOR FURTHER INFORMATION CONTACT:** Elizabeth Dowling, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2022-0886; Project Identifier MCAI-2022-00261-T" at the beginning of your comments. The most helpful comments reference a specific portion of

the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Elizabeth Dowling, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

#### Background

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued TCCA AD CF-2022-05, dated February 24, 2022 (TCCA AD CF-2022-05) (also referred to after this as the MCAI), to correct an unsafe condition for certain Bombardier, Inc., Model BD-700-2A12 airplanes. You may examine the MCAI in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0886.

This proposed AD was prompted by reports of insufficient clearance between the surrounding structure/skin of the aircraft and select bleed air ducts that supply the WIPS in the rear fuselage.

The FAA is proposing this AD to address possible interference between the high pressure (HP) shroud and the surrounding structures, which could compromise the HP ducting shroud's capability to provide bleed air leak routing and result in a bleed air leak being undetected. A significant undetected bleed air leak could expose the surrounding structure to heat stress, resulting in reduced structural integrity of the airplane. See the MCAI for additional background information.

#### Related Service Information Under 1 CFR Part 51

Bombardier has issued Service Bulletin 700-36-7502, dated October 28, 2020. This service information describes procedures for inspecting the bleed air duct and surrounding structure

for minimum clearance and damage, and corrective actions. Corrective actions include adjusting the ductwork if clearance is below the minimum required, and repairing any damage.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### FAA's Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI and service information referenced above. The FAA

is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop on other products of the same type design.

#### Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in the service information already described.

#### Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 8 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

#### ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
1 work-hours × \$85 per hour = \$85 .....	\$1	\$86	\$688

#### ESTIMATED COSTS OF ON-CONDITION ACTIONS

Labor cost	Parts cost	Cost per product
Up to 22 work-hours × \$85 per hour = \$1,870 .....	\$0	\$1,870

The FAA has included all known costs in its cost estimate. According to the manufacturer, however, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator,

the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**Bombardier, Inc.:** Docket No. FAA-2022-0886; Project Identifier MCAI-2022-00261-T.

#### (a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by September 6, 2022.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Bombardier, Inc., Model BD-700-2A12 airplanes, certificated in any category, serial numbers 70006, 70007, 70009 through 70019 inclusive, 70021 through 70029 inclusive, and 70031.

**(d) Subject**

Air Transport Association (ATA) of America Code 36, Pneumatic.

**(e) Unsafe Condition**

This AD was prompted by reports of insufficient clearance between the surrounding structure/skin of the aircraft and select bleed air ducts that supply the wing ice protection system (WIPS) in the rear fuselage. The FAA is issuing this AD to address possible interference between the high pressure (HP) shroud and the surrounding structures, which could compromise the HP ducting shroud's capability to provide bleed air leak routing and result in a bleed air leak being undetected. A significant undetected bleed air leak could expose the surrounding structure to heat stress, resulting in reduced structural integrity of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Within 21 months after the effective date of this AD: Inspect the affected bleed air ducts and surrounding structure for minimum clearance and damage (wear or chafing), and do all applicable corrective actions in accordance with the Accomplishment Instructions of Bombardier Service Bulletin (SB) 700–36–7502, October 28, 2020. Do all applicable corrective actions before further flight.

**(h) No Reporting Requirement**

Although Bombardier Service Bulletin (SB) 700–36–7502, October 28, 2020, specifies to submit certain information to the manufacturer, this AD does not include that requirement.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by

the DAO, the approval must include the DAO-authorized signature.

**(j) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) TCCA AD CF–2022–05, dated February 24, 2022, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0886.

(2) For more information about this AD, contact Elizabeth Dowling, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

(3) For service information identified in this AD, contact Bombardier Business Aircraft Customer Response Center, 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514–855–2999; email [ac.yul@aero.bombardier.com](mailto:ac.yul@aero.bombardier.com); internet <https://www.bombardier.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued on July 15, 2022.

**Gaetano A. Sciortino,**

*Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2022–15559 Filed 7–20–22; 8:45 am]

**BILLING CODE 4910–13–P**

## ENVIRONMENTAL PROTECTION AGENCY

### 40 CFR Part 61

[EPA–R10–OAR–2022–0374; FRL–9881–01–R10]

### National Emissions Standards for Hazardous Air Pollutants; Delegation of Authority to Washington

**AGENCY:** Environmental Protection Agency (EPA).

**ACTION:** Proposed rule.

**SUMMARY:** The Environmental Protection Agency (EPA) is proposing to fully approve a delegation request submitted by the Washington State Department of Health (WDOH) for full delegation of authority to implement and enforce the National Emission Standards for Hazardous Air Pollutants for radionuclide air emissions. The EPA granted WDOH partial delegation of authority to implement and enforce these standards effective July 5, 2006. The WDOH has addressed the partial approval issues, has updated its adoption of the applicable Federal standards to address all current Federal

requirements, and has submitted to the EPA a request for full delegation of these standards.

**DATES:** Comments must be received on or before August 22, 2022.

**ADDRESSES:** Submit your comments, identified by Docket ID No. EPA–R10–OAR–2022–0374, at <https://www.regulations.gov>. Follow the online instructions for submitting comments. Once submitted, comments cannot be edited or removed from <https://www.regulations.gov>. The EPA may publish any comment received to its public docket. Do not electronically submit any information you consider to be Confidential Business Information (CBI) or other information the disclosure of which is restricted by statute. Multimedia submissions (audio, video, etc.) must be accompanied by a written comment. The written comment is considered the official comment and should include discussion of all points you wish to make. The EPA will generally not consider comments or comment contents located outside of the primary submission (*i.e.*, on the web, cloud, or other file sharing system). For additional submission methods, the full EPA public comment policy, information about CBI or multimedia submissions, and general guidance on making effective comments, please visit <https://www.epa.gov/dockets/commenting-epa-dockets>.

**FOR FURTHER INFORMATION CONTACT:** Jim McAuley, EPA Region 10, 1200 Sixth Avenue, Suite 155, Seattle, WA 98101, at (206) 553–1987 or [mcauley.jim@epa.gov](mailto:mcauley.jim@epa.gov).

### SUPPLEMENTARY INFORMATION:

#### Table of Contents

- I. Background
- II. WDOH's Delegation Request
- III. EPA Action
  - A. What authorities are included?
  - B. What authorities are excluded?
- IV. Implications
- V. Summary of Proposed Action
- VI. Statutory and Executive Order Reviews

#### I. Background

Section 112(l) of the Clean Air Act (CAA) and the Code of Federal Regulations (CFR) at 40 CFR part 63, subpart E, authorize the EPA to delegate to State and local agencies authority to implement and enforce the National Emission Standards for Hazardous Air Pollutants (NESHAPs) if specified requirements are met. The NESHAPs are codified in 40 CFR parts 61 and 63. One option for such delegation is “straight delegation,” under which a State or local agency requests delegation based on Federal rules adopted unchanged into State or local rules. Criteria for