

**Table 1 to paragraph (h)(3) of this AD – Affected Thrust Reversers**

Serial Number	Part Number
296001	999-3002-577
297001	999-3002-575
298001	999-3002-577
299001	999-3002-575
300001	999-3002-577
301001	999-3002-575
302001	999-3002-577
303001	999-3002-575
304001	999-3002-577
305001	999-3002-575
306001	999-3002-577
307001	999-3002-575
308001	999-3002-577
309001	999-3002-575
310001	999-3002-577
311001	999-3002-575

**(i) Additional AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or TCCA; or Airbus Canada Limited Partnership's TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

**(j) Related Information**

(1) For TCCA AD CF–2021–46, contact TCCA, Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888–663–3639; email [AD-CN@tc.gc.ca](mailto:AD-CN@tc.gc.ca); internet [tc.canada.ca/en/aviation](http://tc.canada.ca/en/aviation). You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this

material at the FAA, call 206–231–3195. This material may be found in the AD docket at [regulations.gov](http://regulations.gov) by searching for and locating Docket No. FAA–2022–1236.

(2) For more information about this AD, contact Joseph Catanzaro, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7366; email [9-avs-nyacos@faa.gov](mailto:9-avs-nyacos@faa.gov).

Issued on September 26, 2022.

**Christina Underwood,**

*Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2022–21450 Filed 10–4–22; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA–2022–1251; Project Identifier MCAI–2022–00588–T]**

**RIN 2120–AA64**

**Airworthiness Directives; Bombardier, Inc., Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for all Bombardier, Inc., Model BD–100–1A10 airplanes. This proposed AD was

prompted by an investigation that indicated that one of the springs in the pitch trim switch of the horizontal stabilizer had failed. The failure of the spring could result in the airplane pitching nose down when actually commanded nose up. This proposed AD would require a verification of the serial numbers of certain pitch trim switches, and replacement of the affected pitch trim switches with new ones in the pilot and co-pilot control wheels. This proposed AD would also prohibit the installation of affected parts. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by November 21, 2022.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal*: Go to [regulations.gov](http://regulations.gov). Follow the instructions for submitting comments.

- *Fax*: 202–493–2251.

- *Mail*: U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery*: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Bombardier Business Aircraft Customer Response

Center, 400 Côte Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 1-514-855-2999; email [ac.yul@aero.bombardier.com](mailto:ac.yul@aero.bombardier.com); internet [bombardier.com](mailto:bombardier.com). You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

#### Examining the AD Docket

You may examine the AD docket at [regulations.gov](https://www.regulations.gov) by searching for and locating Docket No. FAA-2022-1251; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

#### FOR FURTHER INFORMATION CONTACT:

Thomas Niczky, Aerospace Engineer, Avionics and Electrical Systems Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7347; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2022-1251; Project Identifier MCAI-2022-00588-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to [regulations.gov](https://www.regulations.gov), including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

##### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act

(FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Thomas Niczky, Aerospace Engineer, Avionics and Electrical Systems Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7347; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

##### Background

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued TCCA AD CF-2022-24, dated May 2, 2022 (TCCA AD CF-2022-24) (also referred to after this as the MCAI), to correct an unsafe condition on all Bombardier, Inc., Model BD-100-1A10 airplanes. The MCAI states that during several in-service events, following a stab trim fault advisory message and an auto-pilot disconnect, both pilot and co-pilot commands to trim the horizontal stabilizer nose-up resulted in a nose-down movement of the horizontal stabilizer. In two events, the horizontal stabilizer reached the full travel nose-down position before the crew recognized the nature of the problem, and quickly recovered control of the airplane for safe landing. As a result, this led to increased crew workload and reduced safety margins.

Subsequent investigation by Bombardier and the supplier of the horizontal stabilizer pitch trim switch determined that one of the springs within the pitch trim switch had failed. The supplier of the springs was changed in 2019. The majority of observed pitch trim switch failures occurred in pitch trim switches that were manufactured after 2019.

TCCA AD CF-2022-24 requires the replacement of the affected pitch trim switches with re-designed pitch trim switches that have reliable springs. The FAA is issuing this AD to address the failure of the springs in the pitch trim switch, which, if not corrected, could

result in the airplane pitching nose down when actually commanded nose up, resulting in reduced controllability of the airplane and high control forces.

You may examine the MCAI in the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2022-1251.

#### Related Service Information Under 1 CFR Part 51

The FAA has reviewed Bombardier Service Bulletin 100-27-21, dated March 21, 2022, for Model BD-100-1A10 (CH-300) airplanes, S/Ns 20003 to 20500. This service information describes procedures for verifying serial numbers (S/Ns) of certain pitch trim switch part numbers in the pilot and co-pilot control wheels, and replacing affected pitch trim switches.

The FAA has also reviewed Bombardier Service Bulletin 350-27-011, dated March 21, 2022, for Model BD-100-1A10 (CH-350) airplanes, S/Ns 20501 to 20936. This service information describes procedures for verifying S/Ns of certain pitch trim switch part numbers in leather and non-leather covered pilot and co-pilot control wheels, and replacing affected pitch trim switches.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### FAA's Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI and service information referenced above. The FAA is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop on other products of the same type design.

#### Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in the service information already described. This proposed AD would also prohibit the installation of affected pitch trim switches.

#### Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 697 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

## ESTIMATED COSTS FOR REQUIRED ACTIONS

Action	Labor cost	Parts	Cost per product
Switch inspection .....	1 work-hour × \$85 per hour = \$85 .....	N/A	\$59,245

## ESTIMATED COSTS OF ON-CONDITION ACTIONS

Action	Labor cost	Parts	Cost per product
Switch replacement (Airplane S/Ns 20003–20500) .....	4 work-hours × \$85 per hour = \$340 .....	\$2,352	\$2,692
Switch replacement (Airplane S/Ns 20501–20936) .....	4 work-hours × \$85 per hour = \$340 .....	2,442	2,782

The FAA has included all known costs in its cost estimate. According to the manufacturer, however, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities

under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**Bombardier, Inc.:** Docket No. FAA–2022–1251; Project Identifier MCAI–2022–00588–T.

**(a) Comments Due Date**

The FAA must receive comments on this airworthiness directive (AD) by November 21, 2022.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all Bombardier, Inc., Model BD–100–1A10 airplanes, all serial numbers, certificated in any category.

**(d) Subject**

Air Transport Association (ATA) of America Code 27, Flight Controls.

**(e) Unsafe Condition**

This AD was prompted by the investigation that one of the springs in the pitch trim switch for the horizontal stabilizer had failed. The FAA is issuing this AD to address the failure of the springs in the pitch trim switch. The unsafe condition, if not corrected, could result in the airplane pitching nose down when actually commanded nose up, and the flightcrew may not be able to regain control of the horizontal stabilizer, resulting in

reduced controllability of the airplane and high control forces.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Review of the Airplane Records**

Within 200 flight hours or 6 months, whichever occurs first, from the effective date of this AD, review the airplane (technical) records for the horizontal stabilizer pitch trim switches and control wheels to determine the date of replacement, if any, of the pilot or co-pilot trim switch and control wheels.

(1) If the pilot or co-pilot pitch trim switch or control wheels were removed after January 1, 2019, and the replacement pitch trim switches have serial numbers 02000 and subsequent, then no further action is required other than compliance with paragraph (j) of this AD.

(2) For airplanes with serial numbers (S/Ns) 20003 through 20780 inclusive: If no pilot or co-pilot pitch trim switch or control wheel was replaced after January 1, 2019, then no further action is required other than compliance with paragraph (j) of this AD.

(3) For airplanes with S/Ns 20901 through 20936 inclusive: If no pilot or co-pilot pitch trim switch or control wheel has been replaced on an airplane, then no further action is required other than compliance with paragraph (j) of this AD.

**(h) Verification and Replacement of Pitch Trim Switches**

For airplanes not identified in paragraphs (g)(1) through (3) of this AD: Within 200 flight hours or 6 months, whichever occurs first, from the effective date of this AD, identify the serial numbers of both the pilot and co-pilot pitch trim switches, and do the applicable actions specified in paragraph (h)(1) or (2) of this AD.

(1) If the pilot or co-pilot pitch trim switch has a serial number that is not listed in figure 2 to paragraph (h) of this AD, before further flight re-install the pitch trim switch in accordance with Section 2.B. of the Accomplishment Instructions of the applicable service information identified in figure 1 to paragraph (h) of this AD.

(2) If the pilot or co-pilot pitch trim switch has a serial number listed in figure 2 to paragraph (h) of this AD, before further flight, replace the pitch trim switch in accordance

with Section 2.B. of the Accomplishment Instructions of the applicable service information identified in figure 1 to paragraph (h) of this AD.

(3) Before further flight perform the operational test in accordance with Section 2.C. of the Accomplishment Instructions of the applicable service information identified

Bombardier SB listed in figure 1 to paragraph (h) of this AD.

**BILLING CODE 4910-13-P**

**Figure 1 to paragraph (h) - Applicable Bombardier Service Bulletins**

<b>Bombardier SB</b>	<b>Airplane Serial number</b>
100-27-21 - Special Check/Modification - Pitch Trim System - Replacement of Pitch Trim Switches on Pilot and Co-Pilot Control Wheels, Basic Issue, dated March 21, 2022	20003 through 20500
350-27-011 - Special Check/Modification - Pitch Trim System - Replacement of Pitch Trim Switches on Pilot and Co-Pilot Control Wheels, Basic Issue, dated March 21, 2002	20501 through 20936

**Figure 2 to paragraph (h) - Serial Numbers of Affected Pitch Trim Switches to be Removed and Replaced**

<b>Pitch Trim Switch Part Number (P/N)</b>	<b>Serial Number (S/N)</b>
83452541	01583 through 01604 inclusive 01610 through 01622 inclusive 01628 through 01635 inclusive
83452548	00001 through 01999 inclusive

**BILLING CODE 4910-13-C**

**(i) Verification/Replacement of Pitch Trim Switches for Airplanes With S/Ns 20501 and Subsequent With Certain Control Wheel P/Ns 83912156 and 83912157**

For airplanes with S/Ns 20501 and subsequent with leather-covered control wheels, pilot control wheel P/N 83912156, or co-pilot control wheel P/N 83912157: Within 200 flight hours or 6 months, whichever occurs first, from the effective date of this AD, remove and inspect both the pilot and co-pilot pitch trim switches to determine the part number of the pitch trim switch in accordance with Section 2.B. of the Accomplishment Instructions of Bombardier Service Bulletin 350-27-011, dated March 21, 2002.

(1) If pitch trim switch P/N 83452541 or P/N 83452548 is found installed in either the pilot or the co-pilot control wheel, before further flight, replace the pitch trim switch with pitch trim switch P/N 83452548, serial number 02000 and subsequent, in accordance with Section 2.B. of the Accomplishment Instructions of the applicable service

information identified in figure 1 to paragraph (h) of this AD.

(2) Before further flight thereafter perform the operational test in accordance with Section 2.C. of the Accomplishment Instructions of Bombardier Service Bulletin 350-27-011, dated March 21, 2002.

**(j) Parts Installation Prohibition**

As of the effective date of this AD, no person may install, on any airplane, a trim switch P/N 83452548 or P/N 83452541 with any serial number listed in figure 2 to paragraph (h) of this AD.

**(k) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office,

send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

**(l) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) TCCA AD CF-2022-24, dated May 2, 2022, for related information. This MCAI may be found in the AD docket at *regulations.gov* under Docket No. FAA-2022-1251.

(2) For more information about this AD, contact Thomas Niczky, Aerospace Engineer, Avionics and Electrical Systems Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7347; email [9-avs-nyacos@faa.gov](mailto:9-avs-nyacos@faa.gov).

(3) For service information identified in this AD, contact Bombardier Business Aircraft Customer Response Center, 400 Côte Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 1-514-855-2999; email [ac.yul@aero.bombardier.com](mailto:ac.yul@aero.bombardier.com); internet [bombardier.com](http://bombardier.com). You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on September 29, 2022.

**Christina Underwood,**

*Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2022-21573 Filed 10-4-22; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Docket No. FAA-2022-1207; Airspace Docket No. 22-ANE-9]

**RIN 2120-AA66**

#### **Proposed Amendment of Class D and Class E Airspace; Manchester and Nashua, NH**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to amend Class E surface airspace, Class E airspace designated as an extension to a Class C surface area, and Class E airspace extending upward from 700 feet above the surface at Manchester Boston Regional Airport (formerly Manchester Airport), Manchester, NH, and update the airport's geographic coordinates. Also, this action proposes to amend Class D airspace, Class E airspace designated as an extension to Class D surface area, and Class E airspace extending upward from 700 feet above the surface at Boire Field Airport (formerly Boire Field), by updating each airport's name and, and removing unnecessary verbiage from the airport description. Controlled airspace is necessary for the safety and management of instrument flight rules (IFR) operations in the area.

**DATES:** Comments must be received on or before November 21, 2022.

**ADDRESSES:** Send comments on this proposal to: the U.S. Department of Transportation, Docket Operations, 1200 New Jersey Avenue SE, West Building Ground Floor, Room W12-140, Washington, DC 20590-0001; Telephone: (800) 647-5527, or (202) 366-9826. You must identify the Docket No. FAA-2022-1207; Airspace Docket No. 22-ANE-9 at the beginning of your comments. You may also submit comments through the internet at [www.regulations.gov](http://www.regulations.gov).

FAA Order JO 7400.11G Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at [www.faa.gov/air\\_traffic/publications/](http://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW, Washington, DC 20591; Telephone: (202) 267-8783.

**FOR FURTHER INFORMATION CONTACT:** John Fornito, Operations Support Group, Eastern Service Center, Federal Aviation Administration, 1701 Columbia Avenue, College Park, GA 30337; Telephone: (404) 305-6364.

#### **SUPPLEMENTARY INFORMATION:**

##### **Authority for This Rulemaking**

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority, as it would amend airspace in Manchester and Nashua, NH, to support IFR operations in the area.

##### **Comments Invited**

Interested persons are invited to comment on this proposed rulemaking by submitting such written data, views, or arguments, as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal.

Communications should identify both docket numbers (Docket No. FAA-

2022-1207 and Airspace Docket No. 22-ANE-9) and be submitted in triplicate to DOT Docket Operations (see **ADDRESSES** section for the address and phone number). You may also submit comments through the internet at [www.regulations.gov](http://www.regulations.gov).

Persons wishing the FAA to acknowledge receipt of their comments on this action must submit with those comments a self-addressed stamped postcard on which the following statement is made: "Comments to FAA Docket No. FAA-2022-1207; Airspace Docket No. 22-ANE-9." The postcard will be date/time stamped and returned to the commenter.

All communications received before the specified closing date for comments will be considered before taking action on the proposed rule. The proposal contained in this document may be changed in light of the comments received. All comments submitted will be available for examination in the public docket both before and after the comment closing date. A report summarizing each substantive public contact with FAA personnel concerned with this rulemaking will be filed in the docket.

##### **Availability of NPRMs**

An electronic copy of this document may be downloaded through the internet at [www.regulations.gov](http://www.regulations.gov). Recently published rulemaking documents can also be accessed through the FAA's web page at [www.faa.gov/air\\_traffic/publications/airspace\\_amendments/](http://www.faa.gov/air_traffic/publications/airspace_amendments/).

You may review the public docket containing the proposal, any comments received and any final disposition in person in the Dockets Office (see the **ADDRESSES** section for address and phone number) between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays. An informal docket may also be examined between 8:00 a.m. and 4:30 p.m., Monday through Friday, except federal holidays at the office of the Eastern Service Center, Federal Aviation Administration, Room 350, 1701 Columbia Avenue, College Park, GA 30337.

##### **Availability and Summary of Documents for Incorporation by Reference**

This document proposes to amend FAA Order JO 7400.11G, Airspace Designations and Reporting Points, dated August 19, 2022, and effective September 15, 2022. FAA Order JO 7400.11G is publicly available as listed in the **ADDRESSES** section of this document. FAA Order JO 7400.11G lists