

Action	Compliance time	Procedures
(1) Visually inspect the installed fuel regulator and shutoff valve used with JanAero Devices Combustion Heaters, Models B1500–B4500, for fuel leaks.	Within the next 25 hours time-in-service (TIS) after May 10, 2001 (the effective date of this AD).	Do this following INSTALLATION INSPECTION and ALTERNATIVE VISUAL INSPECTION procedures in JanAero Devices Service Bulletin No. A-107, dated January 8, 2001.
(2) Pressure test the fuel regulator and shutoff valve for leakage.	Within the next 25 hours time-in-service (TIS) after May 10, 2001 (the effective date of this AD) and after the inspection in paragraph (d)(1) of this AD.	Do the following PRESSURE TEST FOR LEAKAGE procedures in JanAero Devices Service Bulletin No. A-107, dated January 8, 2001.
(3) If fuel leaks are found, replace with a new valve with a manufacture date code of 11/00 or later.	Before further flight after the inspection in paragraph (d)(1) and the pressure test in paragraph (d)(2) of this AD.	Do the following ALTERNATIVE VISUAL INSPECTION procedures in JanAero Devices Service Bulletin No. A-107, dated January 8, 2001.
(4) Do not install any fuel regulator and shutoff valve with a manufacture date code before 11/00.	Not Applicable .....	Not Applicable.

(e) *Can I comply with this AD in any other way?* You may use an alternative method of compliance or adjust the compliance time if:

- (1) Your alternative method of compliance provides an equivalent level of safety; and
- (2) The Manager, Atlanta Aircraft Certification Office approves your alternative. Send your request through an FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Atlanta Aircraft Certification Office.

**Note:** This AD applies to each airplane identified in paragraph (a) of this AD, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (e) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if you have not eliminated the unsafe condition, specify actions you propose to address it.

(f) *Where can I get information about any already approved alternative methods of compliance?* Contact Linda M. Haynes, Aerospace Engineer, FAA, Atlanta Aircraft Certification Office, One Crown Center, 1895 Phoenix Boulevard, suite 450, Atlanta, Georgia 30349; telephone: (770) 703-6091; facsimile: (770) 703-6097.

(g) *What if I need to fly the airplane to another location to comply with this AD?* The FAA can issue a special flight permit under sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate your airplane to a location where you can accomplish the requirements of this AD.

(h) *Are any service bulletins incorporated into this AD by reference?* Actions required by this AD must be done following JanAero Devices Service Bulletin No. A-107, dated January 8, 2001. The Director of the Federal Register approved this incorporation by reference under 5 U.S.C. 552(a) and 1 CFR part 51. You can get copies from JanAero Devices, P.O. Box 273, Fort Deposit, Alabama 36032. You can look at copies at FAA, Central Region, Office of the Regional

Counsel, 901 Locust, Room 506, Kansas City, Missouri, or at the Office of the Federal Register, 800 North Capitol Street, NW, suite 700, Washington, DC.

(i) *When does this amendment become effective?* This amendment becomes effective on May 10, 2001.

Issued in Kansas City, Missouri, on April 5, 2001.

**Michael Gallagher,**

*Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 01-9073 Filed 4-16-01; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF THE TREASURY

### Customs Service

#### 19 CFR Part 4

#### Vessel Repair and Penalties Public Meeting

**AGENCY:** U.S. Customs Service, Department of the Treasury.

**ACTION:** Notice of meeting.

**SUMMARY:** This document announces that Customs will hold a public meeting to discuss the final rule amending the Customs Regulations concerning vessel repair. Certain vessel-related penalty matters will also be discussed at the meeting. This document invites interested members of the public to attend.

**DATES:** The meeting will be held on Thursday May 10, 2001, from 9:00 a.m. until 12:00 p.m. Seating requests should be made no later than close of business, Monday April 30, 2001.

**ADDRESSES:** The meeting will be held in New Orleans, Louisiana, at the historic Customhouse located at 423 Canal Street, room number 246.

**FOR FURTHER INFORMATION CONTACT:** Glenn Seale, Chief of the Vessel Repair Unit, Port of New Orleans, at (504) 670-

2137 or, to reserve seating, via e-mail at [Glenn.Seale@Customs.Treas.gov](mailto:Glenn.Seale@Customs.Treas.gov).

**SUPPLEMENTARY INFORMATION:** The final rule amending the Customs Regulations by which Customs administers the vessel repair statute (19 U.S.C. 1466) was published in the **Federal Register** on March 26, 2001 (66 FR 16392). The amendments, which appear at § 4.14 of the Customs Regulations (19 CFR 4.14), go into effect on April 25, 2001, with respect to American vessels arriving in the United States directly from foreign ports.

Customs has determined that it is appropriate to hold a public meeting in order to discuss the changes resulting from the amendments to the vessel repair regulations. Additionally, the meeting will provide a forum for the discussion of vessel-related penalties. Representatives from Customs Headquarters Office of Regulations and Rulings, as well as knowledgeable personnel from the Port of New Orleans, will preside over the meeting.

To ensure adequate seating, it is requested that interested persons submit notice of intent to attend the meeting via e-mail to [Glenn.Seale@Customs.Treas.gov](mailto:Glenn.Seale@Customs.Treas.gov) by close of business, Monday April 30, 2001. The notice should provide the company name, the name and title of the attendee(s), and a named point of contact, including telephone number and e-mail address, in the event Customs needs to notify an attendee of any changes to the program.

Dated: April 10, 2001.

**Larry L. Burton,**

*Chief, Entry Procedures and Carriers Branch.*

[FR Doc. 01-9341 Filed 4-16-01; 8:45 am]

**BILLING CODE 4820-02-P**