

including the authority to buy and sell participation interests in such loans;"

c. Amend paragraph (d) by deleting the semicolon at the end of the sentence and replacing it with the phrase: ", including the authority to buy and sell participation interests in such loans;"

d. Redesignate paragraphs (e) through (r) as paragraphs (g) through (t), respectively, and add new paragraphs (e) and (f).

e. Under the newly redesignated paragraphs (h), (j) and (l) add new paragraphs (h)(7), (j)(4), and (l)(4) through (l)(6);

f. Amend the newly redesignated paragraph (p) by deleting the semicolon at the end of the sentence and replacing it with the phrase: ", including the authority to buy and sell participation interests in such loans;"

The revisions read as follows:

§ 712.5 What activities and services are preapproved for CUSOs?

* * * * *

(b) * * *

(11) Employee leasing services

* * * * *

(e) Credit card loan origination;

(f) Payroll processing services;

* * * * *

(h) * * *

(7) Business counseling and consultant services;

* * * * *

(j) * * *

(4) Real estate settlement services;

* * * * *

(l) * * *

(4) Real estate settlement services;

(5) Purchase and servicing of non-performing loans; and

(6) Referral and processing of loan applications for members whose loan applications have been turned down by the credit union;

§ 712.7 [Removed and Reserved]

6. Remove and reserve § 712.7.

PART 741—REQUIREMENTS FOR INSURANCE

1. The authority citation for part 741 continues to read as follows:

Authority: 12 U.S.C. 1757, 1766, 1781–1790, and 1790d.

2. Add a new § 741.222 to read as follows:

§ 741.222 Credit Union Service Organizations.

(a) Any credit union that is insured pursuant to Title II of the Act must adhere to the requirements in § 712.3(d)(3) and § 712.4 of this chapter concerning agreements between credit unions and their credit union service

organizations (CUSOs) and the requirement to maintain separate corporate identities. For purposes of this section, a CUSO is any entity in which a credit union has an ownership interest or to which a credit union has extended a loan and that is engaged primarily in providing products or services to credit unions or credit union members, or, in the case of checking and currency services, including check cashing services, sale of negotiable checks, money orders, and electronic transaction services, including international and domestic electronic fund transfers, to persons eligible for membership in any credit union having a loan, investment or contract with the entity.

(b) This section shall have no preemptive effect with respect to the laws or rules of any state providing for access to CUSO books and records or CUSO examination by credit union regulatory authorities.

(c) The effective date for compliance with this section is [INSERT DATE THAT IS 180 DAYS FOLLOWING PUBLICATION OF THE FINAL RULE IN THE **FEDERAL REGISTER**].

[FR Doc. E8–9457 Filed 4–30–08; 8:45 am]

BILLING CODE 7535–01–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2008–0492; Directorate Identifier 2008–CE–023–AD]

RIN 2120–AA64

Airworthiness Directives; Hawker Beechcraft Corporation Model 390 Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain Hawker Beechcraft Corporation (HBC) Model 390 airplanes. This proposed AD would require you to remove the current preformed packing, elbow fitting, and jam nut from the left and right hydraulic pump pressure output port and replace with new parts. This proposed AD would also require you to install a hydraulic pump case drain check valve. This proposed AD results from nine occurrences of hydraulic fluid leaking from the engine hydraulic pump output fitting as a result of an improperly

installed elbow connecting the output port to the pulse dampener hose. We are proposing this AD to prevent hydraulic fluid leaks from the left and right hydraulic fluid pump and to prevent the flow of hydraulic fluid into the engine compartment. The loss of hydraulic fluid can result in loss of airplane hydraulic system pressure and the consequent loss of hydraulic system functions including gear extension/retraction, spoiler functions, and anti-skid braking system actuation. The inability of the hydraulic installation to isolate flow of hydraulic fluid could result in a hazardous amount of flammable fluid in the corresponding engine compartment. These conditions, if not corrected, could result in loss of system functions and/or fire in the engine compartment.

DATES: We must receive comments on this proposed AD by June 30, 2008.

ADDRESSES: Use one of the following addresses to comment on this proposed AD:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue, SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Hawker Beechcraft Corporation, 9709 East Central, Wichita, Kansas 67201; telephone: (316) 676–5034; fax: (316) 676–6614.

FOR FURTHER INFORMATION CONTACT:

Anthony Flores, Aerospace Engineer, Wichita Aircraft Certification Office, 1801 Airport Road, Room 100, Wichita, Kansas 67209; telephone: (316) 946–4174; fax: (316) 946–4107.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments regarding this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include the docket number, “FAA–2008–0492; Directorate Identifier 2008–CE–023–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of

the proposed AD. We will consider all comments received by the closing date and may amend the proposed AD in light of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive concerning this proposed AD.

Discussion

We have received information of nine occurrences of hydraulic fluid leaking from the engine hydraulic pump output fitting on HBC Model 390 airplanes. During installation of the elbow fitting, the preformed packing was installed on the fitting threads, which caused the fitting threads to damage the preformed packing when the fitting was tightened. The loss of hydraulic fluid can result in loss of airplane hydraulic system pressure and the consequent loss of hydraulic system functions including gear extension/retraction, spoiler functions, and anti-skid braking system actuation.

The current hydraulic system installation lacks the means of shutting off the flow of hydraulic fluid between the left and right engine hydraulic pump case drain return lines. The installation of check valves would allow flow from the hydraulic pump case drain to the reservoir and prevent flow back through the hydraulic pump case drain lines. This installation would reduce the volume of hydraulic fluid loss into the engine compartment in the event of a leak in the left or right engine hydraulic system. The inability of the hydraulic installation to isolate flow of hydraulic fluid could result in a hazardous amount of flammable fluid in the corresponding engine compartment.

These conditions, if not corrected, could result in loss of system functions and/or fire in the engine compartment.

Relevant Service Information

We have reviewed Hawker Beechcraft Mandatory Service Bulletin SB 29–3869, dated January 2008; and Hawker Beechcraft Mandatory Service Bulletin SB 29–3851, dated January 2008.

The service information describes procedures for:

- Removing the current preformed packing, elbow fitting, and jam nut from the left and right hydraulic pump pressure output port and replacing with new parts; and
- Installing a hydraulic pump case drain check valve.

FAA's Determination and Requirements of the Proposed AD

We are proposing this AD because we evaluated all information and determined the unsafe condition described previously is likely to exist or develop on other products of the same type design. This proposed AD would require you to remove the current preformed packing, elbow fitting, and jam nut from the left and right hydraulic pump pressure output port and replace with new parts. This proposed AD would also require you to install a hydraulic pump case drain check valve.

Costs of Compliance

We estimate that this proposed AD would affect 182 airplanes in the U.S. registry.

We estimate the following costs to do the proposed modifications:

| Labor cost | Parts cost | Total cost per airplane | Total cost on U.S. operators |
|----------------------------------------------------------------------------------------|------------|-------------------------|------------------------------|
| Hydraulic pressure output fitting assembly: 8 work-hours × \$80 per hour = \$640 | \$100 | \$740 | \$134,680 |
| Hydraulic Pump Case Drain Check Valve: 16 work-hours × \$80 per hour = \$1,280 | 4,353 | 5,633 | 1,025,206 |

HBC will provide warranty credit as specified in Hawker Beechcraft Mandatory Service Bulletin SB 29–3869, dated January 2008; and Hawker Beechcraft Mandatory Service Bulletin SB 29–3851, dated January 2008.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We have determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that the proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

Examining the AD Docket

You may examine the AD docket that contains the proposed AD, the

regulatory evaluation, any comments received, and other information on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Office (telephone (800) 647–5527) is located at the street address stated in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new AD:

Hawker Beechcraft Corporation: Docket No. FAA-2008-0492; Directorate Identifier 2008-CE-023-AD.

Comments Due Date

(a) We must receive comments on this airworthiness directive (AD) action by June 30, 2008.

Affected ADs

(b) None.

Applicability

(c) This AD applies to Model 390 airplanes, serial numbers RB-4 through RB-224, that are certificated in any category.

Unsafe Condition

(d) This AD results from nine occurrences of hydraulic fluid leaking from the engine hydraulic pump output fitting as a result of an improperly installed elbow connecting the output port to the pulse dampener hose. We are issuing this AD to prevent hydraulic fluid leaking from the left and right hydraulic fluid pump and to prevent the flow of hydraulic fluid into the engine compartment. The loss of hydraulic fluid can result in loss of

airplane hydraulic system pressure and the consequent loss of hydraulic system functions including gear extension/retraction, spoiler functions, and anti-skid braking system actuation. The inability of the hydraulic installation to isolate flow of hydraulic fluid could result in a hazardous amount of flammable fluid in the corresponding engine compartment. These conditions, if not corrected, could result in loss of system functions and/or fire in the engine compartment.

Compliance

(e) To address this problem, you must do the following, unless already done:

| Actions | Compliance | Procedures |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------|
| (1) Remove current preformed packing (part number (P/N) MS28778-6), elbow fitting (P/N MS21908J6), and jam nut (P/N AN924-6J) from the left and right hydraulic pump pressure output port and install new preformed packing (P/N MS28778-6), union (P/N MS21902J6), and swivel fitting (P/N NAS1762J0606) in the left and right hydraulic pressure pump output port. | Within the next 200 hours time-in-service (TIS) after the effective date of this AD or within the next 6 months after the effective date of this AD, whichever occurs first. | Follow Hawker Beechcraft Mandatory Service Bulletin SB 29-3869, dated January 2008. |
| (2) Install hydraulic pump case drain check valve Kit No. 390-5803-0001. | Within the next 200 hours TIS after the effective date of this AD or within the next 6 months after the effective date of this AD, whichever occurs first. | Hawker Beechcraft Mandatory Service Bulletin SB 29-3851, dated January 2008. |

Alternative Methods of Compliance (AMOCs)

(f) The Manager, Wichita Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Anthony Flores, Aerospace Engineer, Wichita ACO, 1801 Airport Road, Room 100, Wichita, Kansas 67209; telephone: (316) 946-4174; fax: (316) 946-4107. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

Related Information

(g) To get copies of the service information referenced in this AD, contact Hawker Beechcraft Corporation, 9709 East Central, Wichita, Kansas 67201; telephone: (316) 676-5034; fax: (316) 676-6614. To view the AD docket, go to U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590, or on the Internet at <http://www.regulations.gov>.

Issued in Kansas City, Missouri, on April 24, 2008.

James E. Jackson,

Acting Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. E8-9566 Filed 4-30-08; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2008-0178; Directorate Identifier 2007-NM-366-AD]

RIN 2120-AA64

Airworthiness Directives; Bombardier Model DHC-8-400 Series Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Supplemental notice of proposed rulemaking (NPRM); reopening of comment period.

SUMMARY: We are revising an earlier NPRM for the products listed above. This action revises the earlier NPRM by expanding the scope. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

Bombardier Aerospace has completed a system safety review of the aircraft fuel system against fuel tank safety standards * * *.

[A]ssessment showed that supplemental maintenance tasks [inspections of various fuel system components such as shields, harnesses, sleeves, and sealant] are required

to prevent potential ignition sources inside the fuel system, which could result in a fuel tank explosion. * * *

The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

DATES: We must receive comments on this proposed AD by May 21, 2008.

ADDRESSES: You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-40, 1200 New Jersey Avenue, SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The