

interested parties in the docket for this rulemaking.

### Signing Authority

This document of the Department of Energy was signed on May 13, 2022, by Kelly J. Speakes-Backman, Principal Deputy Assistant Secretary for Energy Efficiency and Renewable Energy, pursuant to delegated authority from the Secretary of Energy. That document with the original signature and date is maintained by DOE. For administrative purposes only, and in compliance with requirements of the Office of the Federal Register, the undersigned DOE Federal Register Liaison Officer has been authorized to sign and submit the document in electronic format for publication, as an official document of the Department of Energy. This administrative process in no way alters the legal effect of this document upon publication in the **Federal Register**.

Signed in Washington, DC, on May 13, 2022.

**Treena V. Garrett,**

*Federal Register Liaison Officer, U.S. Department of Energy.*

[FR Doc. 2022-10713 Filed 5-18-22; 8:45 am]

**BILLING CODE 6450-01-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2022-0522; Project Identifier MCAI-2022-00340-T]

RIN 2120-AA64

### Airworthiness Directives; Airbus SAS Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus SAS Model A330-200, A330-200 Freighter, A330-300, and A330-900 series airplanes; and all Model A340-200 and A340-300 series airplanes. This proposed AD was prompted by recent tests that demonstrated that when the upper secondary load path (SLP) of the trimmable horizontal stabilizer actuator (THSA) is engaged, the THSA might not stall, with consequently no indication of SLP engagement. This proposed AD would require modifying the THSA installation, implementing the electrical load sensing device (ELSD) wiring provisions, and installing and activating

the ELSD, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by July 5, 2022.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that will be incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this material on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0522.

### Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0522; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

### FOR FURTHER INFORMATION CONTACT:

Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3229; email [Vladimir.Ulyanov@faa.gov](mailto:Vladimir.Ulyanov@faa.gov).

### SUPPLEMENTARY INFORMATION:

#### Comments Invited

The FAA invites you to send any written relevant data, views, or

arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2022-0522; Project Identifier MCAI-2022-00340-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3229; email [Vladimir.Ulyanov@faa.gov](mailto:Vladimir.Ulyanov@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

### Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2022-0039, dated March 8, 2022 (EASA AD 2022-0039) (also referred to as the MCAI), to correct an unsafe condition for certain Airbus SAS Model A330-201, A330-202, A330-203, A330-223, A330-223F, A330-243, A330-243F, A330-301, A330-302, A330-303, A330-321, A330-

322, A330–323, A330–341, A330–342, A330–343, and A330–941 airplanes; and all Model A340–211, A340–212, A340–213, A340–311, A340–312, and A340–313 airplanes.

The trimmable horizontal stabilizer actuator (THSA) has a fail-safe design: Each attachment, upper and lower, has two load paths, a normally loaded primary load path (PLP) and a secondary load path (SLP); the SLP is engaged only in case of PLP rupture. When the SLP is engaged, the design purpose was to generate a stall of the THSA by friction and to detect a stall by the position monitoring with an indication provided to the flight crew. This proposed AD was prompted by recent tests that demonstrated that when the upper SLP is engaged, the THSA might not stall, with consequently no indication of SLP engagement. The FAA is proposing this AD to prevent damage on the upper THSA SLP attachment, with consequent mechanical disconnection of the THSA, possibly resulting in loss of control of the airplane. See the MCAI for additional background information.

#### Related Service Information Under 1 CFR Part 51

EASA AD 2022–0039 specifies procedures for modification to the THSA by installation and activation of the electrical load sensing device (ELSD), and installation of the wiring provisions for the ELSD. The installation and activation of the ELSD include installation of the ELSD on the THSA, modification of the electrical harness, and modification of the circuit breaker in the auxiliary power unit

(APU) control box. The installation of the wiring provisions for the ELSD includes modifying the structure at frame 87, installing the brackets at frame 87, installing the electrical dummy connectors, rerouting the wire between frame 56 and frame 69, modifying the circuit breaker box, modifying the electrical harness, and rerouting the wiring. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

#### FAA's Determination

These products have been approved by the aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of these same type designs.

#### Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2022–0039 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

#### Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD

process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2022–0039 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2022–0039 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2022–0039 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2022–0039. Service information required by EASA AD 2022–0039 for compliance will be available at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0522 after the FAA final rule is published.

#### Costs of Compliance

The FAA estimates that this proposed AD would affect 120 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

#### ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
57 work-hours × \$85 per hour = \$4,845 .....	Up to \$23,000 ..	\$27,845	\$3,341,400

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and

procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and

responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a “significant regulatory action” under Executive Order 12866,

(2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

## List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**Airbus SAS:** Docket No. FAA–2022–0522; Project Identifier MCAI–2022–00340–T.

#### (a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by July 5, 2022.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Airbus SAS airplanes specified in paragraphs (c)(1) and (2) of this AD, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2022–0039, dated March 8, 2022 (EASA AD 2022–0039).

(1) Model A330–201, –202, –203, –223, –223F, –243, –243F, –301, –302, –303, –321, –322, –323, –341, –342, –343, and –941 airplanes.

(2) Model A340–211, –212, –213, –311, –312, and –313 airplanes.

#### (d) Subject

Air Transport Association (ATA) of America Code 27, Flight Controls.

#### (e) Unsafe Condition

This AD was prompted by recent tests that demonstrated that when the upper secondary load path (SLP) of the trimmable horizontal stabilizer actuator (THSA) is engaged, the THSA might not stall, with consequently no indication of SLP engagement. The FAA is issuing this AD to prevent damage on the upper THSA SLP attachment, with consequent mechanical disconnection of the THSA, possibly resulting in loss of control of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2022–0039.

#### (h) Exceptions to EASA AD 2022–0039

(1) Where EASA AD 2022–0039 refers to its effective date, this AD requires using the effective date of this AD.

(2) The “Remarks” section of EASA AD 2022–0039 does not apply to this AD.

#### (i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: [9-AVS-AIR-730-AMOC@faa.gov](mailto:9-AVS-AIR-730-AMOC@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* Except as required by paragraph (i)(2) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (j) Related Information

(1) For EASA AD 2022–0039, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email [ADS@easa.europa.eu](mailto:ADS@easa.europa.eu); internet [www.easa.europa.eu](http://www.easa.europa.eu). You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. This material may be found in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0522.

(2) For more information about this AD, contact Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section,

International Validation Branch, FAA, 2200 South 216th Street, Des Moines, WA 98198; telephone and fax 206–231–3229; email [Vladimir.Ulyanov@faa.gov](mailto:Vladimir.Ulyanov@faa.gov).

Issued on May 13, 2022.

**Gaetano A. Sciortino,**

*Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2022–10722 Filed 5–18–22; 8:45 am]

**BILLING CODE 4910–13–P**

## CONSUMER PRODUCT SAFETY COMMISSION

### 16 CFR Chapter II

[Docket No. CPSC–2022–0015]

### Petitions Requesting Rulemaking To Amend the Safety Standard for Play Yards To Require a Minimum Thickness for Play Yard Mattresses, and To Standardize the Size of Play Yards and Play Yard Mattresses; Request for Comments

**AGENCY:** Consumer Product Safety Commission.

**ACTION:** Notice of petitions for rulemaking.

**SUMMARY:** The U.S. Consumer Product Safety Commission (Commission or CPSC) received two petitions regarding play yards and play yard mattresses. The Commission invites written comments concerning these petitions.

**DATES:** Submit comments by July 18, 2022.

**ADDRESSES:** Submit comments, identified by Docket No. CPSC–2022–0015, by any of the following methods:

*Electronic Submissions:* Submit electronic comments to the Federal eRulemaking Portal at: <https://www.regulations.gov>. Follow the instructions for submitting comments. CPSC typically does not accept comments submitted by electronic mail (email), except through <https://www.regulations.gov>. CPSC encourages you to submit electronic comments by using the Federal eRulemaking Portal, as described above.

*Mail/hand delivery/courier Written Submissions:* Submit comments by mail/hand delivery/courier to: Division of the Secretariat, Consumer Product Safety Commission, 4330 East-West Highway, Bethesda, MD 20814; telephone: (301) 504–7479. Alternatively, as a temporary option during the COVID–19 pandemic, you can email such submissions to: [cpsc-os@cpsc.gov](mailto:cpsc-os@cpsc.gov).

*Instructions:* All submissions must include the agency name and docket