

Rules and Regulations

Federal Register

Vol. 74, No. 172

Tuesday, September 8, 2009

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents. Prices of new books are listed in the first FEDERAL REGISTER issue of each week.

DEPARTMENT OF ENERGY

10 CFR Part 431

[Docket Number EERE-2006-STD-0125]

RIN 1904-AB58

Energy Conservation Program: Energy Conservation Standards for Refrigerated Bottled or Canned Beverage Vending Machines

Correction

In rule document E9-19392 beginning on page 44914 in the issue of Monday, August 31, 2009, make the following correction:

1. On page 44914, in the first column, under the **DATES** section, in the fourth line, "August 31, 2011" should read "August 31, 2012".

§431.296 [Corrected]

2. On page 44967, in § 431.296, in the third and fourth lines, "[Insert date 3 years from the date of publication of this final rule]" should read "August 31, 2012".

[FR Doc. Z9-19392 Filed 9-4-09; 8:45 am]

BILLING CODE 1505-01-D

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2009-0787; Directorate Identifier 2009-NM-090-AD; Amendment 39-16015; AD 2009-02-06 R1]

RIN 2120-AA64

Airworthiness Directives; Boeing Model 737-300, -400, and -500 Series Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: We are revising an existing airworthiness directive (AD) that applies to certain Boeing Model 737-300, -400, and -500 series airplanes. That AD currently requires repetitive high frequency eddy current inspections for cracking of the 1.04-inch nominal diameter wire penetration hole in the frame and frame reinforcement, between stringers S-20 and S-21, on both the left and right sides of the airplane, and related investigative and corrective actions if necessary. This new AD clarifies certain compliance requirements. This AD results from reports of cracking in the frame, or in the frame and frame reinforcement, common to the 1.04-inch nominal diameter wire penetration hole intended for wire routing. We are issuing this AD to detect and correct cracking in the fuselage frames and frame reinforcements, which could reduce the structural capability of the frames to sustain limit loads, and result in cracking in the fuselage skin and subsequent rapid depressurization of the airplane.

DATES: This AD is effective September 23, 2009.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of April 15, 2009 (74 FR 10469, March 11, 2009).

We must receive comments on this AD by November 9, 2009.

ADDRESSES: You may send comments by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** 202-493-2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.
- **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, Washington 98124-2207; telephone 206-544-5000, extension 1, fax 206-766-5680; e-mail

me.boecom@boeing.com; Internet <https://www.myboeingfleet.com>.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Wayne Lockett, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 917-6447; fax (425) 917-6590.

SUPPLEMENTARY INFORMATION:

Discussion

On January 9, 2009, we issued AD 2009-02-06, amendment 39-15796 (74 FR 10469, March 11, 2009), for certain Boeing Model 737-300, -400, and -500 series airplanes. That AD requires repetitive high frequency eddy current inspections for cracking of the 1.04-inch nominal diameter wire penetration hole in the frame and frame reinforcement, between stringers S-20 and S-21, on both the left and right sides of the airplane, and related investigative and corrective actions if necessary. That AD resulted from reports of cracking in the frame, or in the frame and frame reinforcement, common to the 1.04-inch nominal diameter wire penetration hole intended for wire routing. We issued that AD to detect and correct cracking in the fuselage frames and frame reinforcements, which could reduce the structural capability of the frames to sustain limit loads, and result in cracking in the fuselage skin and subsequent rapid depressurization of the airplane.

Actions Since Existing AD Was Issued

Since we issued AD 2009-02-06, January 9, 2009, amendment 39-15796 (74 FR 10469, March 11, 2009), we have determined that we need to clarify certain compliance requirements in the existing AD, as follows: