

# Rules and Regulations

Federal Register

Vol. 79, No. 150

Tuesday, August 5, 2014

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents. Prices of new books are listed in the first FEDERAL REGISTER issue of each week.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2012-0807; Directorate Identifier 2011-NM-191-AD; Amendment 39-17888; AD 2014-13-12]

RIN 2120-AA64

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for all Airbus Model A318, A319, A320, and A321 series airplanes. This AD was prompted by reports of silicon particles inside the oxygen generator manifolds, which had chafed from the mask hoses during installation onto the generator outlets. This AD requires identifying the part number and serial number of each passenger oxygen container, replacing the oxygen generator manifold of any affected oxygen container with a serviceable manifold, and performing an operational check of the manual mask release, and corrective actions if necessary. We are issuing this AD to detect and correct non-serviceable oxygen generator manifolds, which could reduce or block the oxygen supply and result in injury to passengers when oxygen supply is needed.

**DATES:** This AD becomes effective September 9, 2014.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of September 9, 2014.

**ADDRESSES:** You may examine the AD docket on the Internet at [http://www.regulations.gov/#!docketDetail;D=FAA-](http://www.regulations.gov/#!docketDetail;D=FAA-2012-0807)

2012-0807; or in person at the Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC.

For service information identified in this AD, contact Airbus, Airworthiness Office—ELAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**FOR FURTHER INFORMATION CONTACT:** Sanjay Ralhan, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1405; fax 425-227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a supplemental notice of proposed rulemaking (SNPRM) to amend 14 CFR part 39 by adding an AD that would apply to all Airbus Model A318 series airplanes and Model A319, A320, and A321 series airplanes. The SNPRM published in the **Federal Register** on February 10, 2014 (79 FR 7603). We preceded the SNPRM with a notice of proposed rulemaking (NPRM) that published in the **Federal Register** on August 16, 2012 (77 FR 49386).

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2012-0083, dated May 16, 2012 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for all Airbus Model A318, A319, A320, and A321 series airplanes. The MCAI states:

During production of passenger oxygen containers, the manufacturer B/E Aerospace detected some silicon particles inside the oxygen generator manifolds. Investigation revealed that those particles (chips) had chafed from the mask hoses during installation onto the generator outlets. It was discovered that a defective mask hose installation device had caused the chafing.

This condition, if not detected and corrected, could reduce or block the oxygen supply, possibly resulting in injury to passengers when oxygen supply is needed.

To address this potential unsafe condition, EASA issued AD 2011-0167 [[http://ad.easa.europa.eu/blob/easa\\_ad\\_2011\\_0167\\_superseded.pdf](http://ad.easa.europa.eu/blob/easa_ad_2011_0167_superseded.pdf)] to require the identification [of the part number and serial number] and modification of the affected [non-serviceable] oxygen container assemblies. That AD also prohibited the installation of the affected containers on any aeroplane as replacement parts.

Since that [EASA] AD was issued, it was established that the Models A318-121 and A318-122 were missing from the Applicability of the AD, and clarification was necessary regarding the affected containers, which are only those marked B/E Aerospace Systems on the equipment data plate.

For the reasons described above, this [EASA] AD retains the requirements of EASA AD 2011-0167, which is superseded, expands the Applicability by adding two aeroplane models, and provides clarity by providing a list of affected passenger oxygen containers.

Required actions also include replacing the oxygen generator manifold of the affected oxygen container with a serviceable manifold, doing an operational check of the manual mask release, and repairing the passenger oxygen container if necessary. You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov/#!documentDetail;D=FAA-2012-0807-0006>.

#### Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the SNPRM (79 FR 7603, February 10, 2014) or on the determination of the cost to the public.

#### “Contacting the Manufacturer” Paragraph in This AD

Since late 2006, we have included a standard paragraph titled “Airworthy Product” in all MCAI ADs in which the FAA develops an AD based on a foreign authority’s AD.

The MCAI or referenced service information in an FAA AD often directs the owner/operator to contact the manufacturer for corrective actions, such as a repair. Briefly, the Airworthy Product paragraph allowed owners/operators to use corrective actions provided by the manufacturer if those actions were FAA-approved. In addition, the paragraph stated that any

actions approved by the State of Design Authority (or its delegated agent) are considered to be FAA-approved.

In the SNPRM (79 FR 7603, February 10, 2014), we proposed to prevent the use of repairs that were not specifically developed to correct the unsafe condition, by requiring that the repair approval provided by the State of Design Authority or its delegated agent specifically refer to this FAA AD. This change was intended to clarify the method of compliance and to provide operators with better visibility of repairs that are specifically developed and approved to correct the unsafe condition. In addition, we proposed to change the phrase “its delegated agent” to include a design approval holder (DAH) with State of Design Authority design organization approval (DOA), as applicable, to refer to a DAH authorized to approve required repairs for the SNPRM.

No comments were provided to the SNPRM (79 FR 7603, February 10, 2014) about these proposed changes. However, a comment was provided for an NPRM having Directorate Identifier 2012–NM–101–AD (78 FR 78285, December 26, 2013). The commenter stated the following: “The proposed wording, being specific to repairs, eliminates the interpretation that Airbus messages are acceptable for approving minor deviations (corrective actions) needed during accomplishment of an AD mandated Airbus service bulletin.”

This comment has made the FAA aware that some operators have misunderstood or misinterpreted the Airworthy Product paragraph to allow the owner/operator to use messages provided by the manufacturer as approval of deviations during the accomplishment of an AD-mandated action. The Airworthy Product paragraph does not approve messages or other information provided by the manufacturer for deviations to the requirements of the AD-mandated actions. The Airworthy Product paragraph only addresses the requirement to contact the manufacturer for corrective actions for the identified unsafe condition and does not cover deviations from other AD requirements. However, deviations to AD-required

actions are addressed in 14 CFR 39.17, and anyone may request the approval for an alternative method of compliance to the AD-required actions using the procedures found in 14 CFR 39.19.

To address this misunderstanding and misinterpretation of the Airworthy Product paragraph, we have changed that paragraph and retitled it “Contacting the Manufacturer.” This paragraph now clarifies that for any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the FAA, the European Aviation Safety Agency (EASA), or Airbus’s EASA DOA.

The Contacting the Manufacturer paragraph also clarifies that, if approved by the DOA, the approval must include the DOA-authorized signature. The DOA signature indicates that the data and information contained in the document are EASA-approved, which is also FAA-approved. Messages and other information provided by the manufacturer that do not contain the DOA-authorized signature approval are not EASA-approved, unless EASA directly approves the manufacturer’s message or other information.

This clarification does not remove flexibility previously afforded by the Airworthy Product paragraph. Consistent with long-standing FAA policy, such flexibility was never intended for required actions. This is also consistent with the recommendation of the Airworthiness Directive Implementation Aviation Rulemaking Committee to increase flexibility in complying with ADs by identifying those actions in manufacturers’ service instructions that are “Required for Compliance” with ADs. We continue to work with manufacturers to implement this recommendation. But once we determine that an action is required, any deviation from the requirement must be approved as an alternative method of compliance.

Other commenters to the NPRM having Directorate Identifier 2012–NM–101–AD (78 FR 78285, December 26, 2013) pointed out that in many cases the foreign manufacturer’s service bulletin and the foreign authority’s MCAI might

have been issued some time before the FAA AD. Therefore, the DOA might have provided U.S. operators with an approved repair, developed with full awareness of the unsafe condition, before the FAA AD is issued. Under these circumstances, to comply with the FAA AD, the operator would be required to go back to the manufacturer’s DOA and obtain a new approval document, adding time and expense to the compliance process with no safety benefit.

Based on these comments, we removed the requirement that the DAH-provided repair specifically refer to this AD. Before adopting such a requirement, the FAA will coordinate with affected DAHs and verify they are prepared to implement means to ensure that their repair approvals consider the unsafe condition addressed in this AD. Any such requirements will be adopted through the normal AD rulemaking process, including notice-and-comment procedures, when appropriate. We also have decided not to include a generic reference to either the “delegated agent” or “DAH with State of Design Authority design organization approval,” but instead we have provided the specific delegation approval granted by the State of Design Authority for the DAH throughout this AD.

**Conclusion**

We reviewed the relevant data and determined that air safety and the public interest require adopting this AD with the changes described previously and minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the SNPRM (79 FR 7603, February 10, 2014) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the SNPRM (79 FR 7603, February 10, 2014).

We also determined that these changes will not increase the economic burden on any operator or increase the scope of this AD.

**Costs of Compliance**

We estimate that this AD affects 22 airplanes of U.S. registry.

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Replacement (The average number of oxygen containers per airplane is 50.)	3 work-hours × \$85 per hour = \$255 .....	\$0	\$255	\$5,610
Operational check .....	3 work-hours × \$85 per hour = \$255 .....	0	255	5,610

We estimate the following costs to do any necessary repairs that would be

required based on the results of the inspection. We have no way of

determining the number of aircraft that might need these repairs:

#### ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Repair (from operational check) .....	1 work-hour × \$85 per hour = \$85 .....	\$0	\$85
Repair (from part number check of the passenger oxygen container).	1 work-hour × \$85 per hour = \$85 .....	0	85

According to the manufacturer, some of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities

under the criteria of the Regulatory Flexibility Act.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov/#!docketDetail;D=FAA-2012-0807>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the ADDRESSES section.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2014-13-12 Airbus:** Amendment 39-17888. Docket No. FAA-2012-0807; Directorate Identifier 2011-NM-191-AD.

#### (a) Effective Date

This AD becomes effective September 9, 2014.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Airbus Model A318-111, -112, -121, and -122 airplanes; A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes; A320-111, -211, -212, -214, -231, -232, and -233 airplanes; A321-111, -112, -131, -211, -212, -213, -231, and -232

airplanes; certificated in any category; all manufacturer serial numbers (MSN).

#### (d) Subject

Air Transport Association (ATA) of America Code 35, Oxygen.

#### (e) Reason

This AD was prompted by reports of silicon particles inside the oxygen generator manifolds, which had chafed from the mask hoses during installation onto the generator outlets. We are issuing this AD to detect and correct non-serviceable oxygen generator manifolds, which could reduce or block the oxygen supply, and result in injury to passengers when oxygen supply is needed.

#### (f) Compliance

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### (g) Part Number and Serial Number Identification

Within 5,000 flight cycles, or 7,500 flight hours, or 24 months, whichever occurs first after the effective date of this AD, identify the part number and serial number of each passenger oxygen container. A review of airplane maintenance records is acceptable in lieu of this identification if the part number and serial number of the oxygen container can be conclusively determined from that review.

#### (h) Replacement, Check, Repair

If the part number of the passenger oxygen container is listed in paragraph (h)(1) of this AD and the serial number of the passenger oxygen container is listed in paragraph (h)(2) of this AD: Within the compliance time specified in paragraph (g) of this AD, do the actions specified in paragraphs (h)(3), (h)(4), and (h)(5) of this AD, except as provided by paragraphs (i)(1) through (i)(7) of this AD.

(1) (Type I: 15 and 22 minutes)  
12C15Lxxxxx0100, 12C15Rxxxxx0100, 13C15Lxxxxx0100, 13C15Rxxxxx0100, 14C15Lxxxxx0100, 14C15Rxxxxx0100, 12C22Lxxxxx0100, 12C22Rxxxxx0100, 13C22Lxxxxx0100, 13C22Rxxxxx0100, 14C22Lxxxxx0100, and 14C22Rxxxxx0100; and (Type II: 15 and 22 minutes)  
22C15Lxxxxx0100, 22C15Rxxxxx0100, 22C22Lxxxxx0100, and 22C22Rxxxxx0100.

**Note 1 to paragraph (h)(1) of this AD:** The passenger emergency oxygen container assemblies listed in paragraph (h)(1) of this AD are products having the mark "B/E AEROSPACE" on the identification plate.

(2) ARBA-0000 to ARBA-9999 inclusive, ARBB-0000 to ARBB-9999 inclusive, ARBC-0000 to ARBC-9999 inclusive, ARBD-0000 to ARBD-9999 inclusive, ARBE-0000 to ARBE-9999 inclusive, BEBF-0000 to BEBF-9999 inclusive, BEBH-0000 to BEBH-9999 inclusive, BEBK-0000 to BEBK-9999 inclusive, BEBL-0000 to BEBL-9999 inclusive, and BEBM-0000 to BEBM-9999 inclusive.

(3) Replace the oxygen generator manifold of any affected oxygen passenger container with a serviceable manifold, in accordance with the Accomplishment Instructions of Airbus Service Bulletin A320-35A1047, dated March 29, 2011.

(4) Do an operational check of the manual mask release, in accordance with the Accomplishment Instructions of Airbus Service Bulletin A320-35A1047, dated March 29, 2011. If the operational check fails, before further flight, repair the manual mask release, using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(5) Check if the part number of the passenger oxygen container is listed in B/E Aerospace Service Bulletin 1XCXX-0100-35-005, Revision 1, dated December 15, 2012; or B/E Aerospace Service Bulletin 22CXX-0100-35-003, Revision 1, dated December 20, 2011, as applicable. If the part number is listed in B/E Aerospace Service Bulletin 1XCXX-0100-35-005, Revision 1, dated December 15, 2012; or B/E Aerospace Service Bulletin 22CXX-0100-35-003, Revision 1, dated December 20, 2011: Within the compliance time specified in paragraph (g) of this AD, repair using a method

approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (i) Exceptions

(1) Oxygen containers that meet the conditions specified in paragraph (i)(1)(i) or (i)(1)(ii) of this AD are compliant with the requirements of paragraph (h) of this AD.

(i) Oxygen containers Type I having a part number listed in paragraph (h)(1) of this AD and having a serial number listed in paragraph (h)(2) of this AD, that have been modified prior to the effective date of this AD, as specified in the Accomplishment Instructions of B/E Aerospace Service Bulletin 1XCXX-0100-35-005, Revision 1, dated December 15, 2012.

(ii) Oxygen containers Type II having a part number listed in paragraph (h)(1) of this AD and having a serial number listed in paragraph (h)(2) of this AD, that have been modified prior to the effective date of this AD, as specified in the Accomplishment Instructions of B/E Aerospace Service Bulletin 22CXX-0100-35-003, Revision 1, dated December 20, 2011.

(2) Airplanes on which Airbus Modification 150703 or Airbus Modification 150704 has not been embodied in production do not have to comply with the requirements of paragraph (h) of this AD, unless an oxygen container having a part number listed in paragraph (h)(1) of this AD and having a serial number listed in paragraph (h)(2) of this AD has been replaced since the airplane's first flight.

(3) Airplanes on which Airbus Modification 150703 or Airbus Modification 150704 has been embodied in production

and which are not listed by model and MSN in Airbus Service Bulletin A320-35A1047, dated March 29, 2011, are not subject to the requirements of paragraphs (g) and (h) of this AD, unless an oxygen container having a part number listed in paragraph (h)(1) of this AD and having a serial number listed in paragraph (h)(2) of this AD has been replaced since the airplane's first flight.

(4) Model A319 airplanes that are equipped with a gaseous oxygen system for passengers, installed in production with Airbus Modification 33125, do not have the affected passenger oxygen containers installed. Unless these airplanes have been modified in-service (no approved Airbus modification exists), the requirements of paragraphs (g) and (h) of this AD do not apply to these airplanes.

(5) Airplanes that have already been inspected prior to the effective date of this AD, in accordance with the Accomplishment Instructions of Airbus Service Bulletin A320-35A1047, dated March 29, 2011, must be inspected and, depending on the findings, corrected, within the compliance time defined in paragraph (g) of this AD, as required by paragraph (h) of this AD, as applicable, except as specified in paragraph (i)(6) of this AD.

(6) Airplanes on which the passenger oxygen container has been replaced before the effective date of this AD, in accordance with the Accomplishment Instructions of Airbus Service Bulletin A320-35A1047, dated March 29, 2011, are compliant with the requirements of the paragraph (h) of this AD for that passenger oxygen container.

(7) The requirements of paragraphs (g) and (h) of this AD apply only to passenger oxygen containers that are Design A, as defined in figure 1 to paragraph (i)(7) of this AD.

**BILLING CODE 4910-13-P**

Figure 1 to paragraph (i)(7) of this AD – Design A of the Passenger Oxygen Containers Affected by this AD

**Design A:** The placard on the passenger oxygen container test button is as described in Picture A of Appendix 1 of this AD. The Mask configuration ("ZZ" in Picture A) is a number and the test button is as shown in Picture B.

**Picture A:**

View Z




YY/YYYY : Month and Year of Inspection of Container

X : number of masks

ZZ : Oxygen mask code from the 7. + 8. place of the Customer Part No.

**Picture B:**

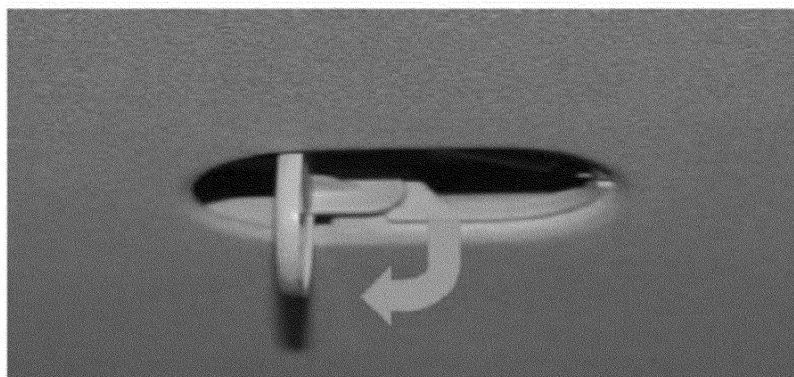

**BILLING CODE 4910-13-C**

**Note 1 to figure 1 to paragraph (i)(7) of this AD:** Figure 1 is a reproduction of material from EASA Airworthiness Directive 2012-0083, dated May 16, 2012. The words "Appendix 1 of this AD" in this figure refer to Appendix 1 of the EASA AD.

**(j) Parts Installation Limitations**

As of the effective date of this AD, no person may install an oxygen container having a part number specified in paragraph (h)(1) of this AD and having a serial number specified in paragraph (h)(2) of this AD, on any airplane, unless the container has been modified in accordance with the Accomplishment Instructions of any of the

service information specified in paragraph (j)(1), (j)(2), or (j)(3) of this AD, as applicable.

(1) Airbus Service Bulletin A320-35A1047, dated March 29, 2011.

(2) B/E AEROSPACE Service Bulletin 1XCXX-0100-35-005, Revision 1, dated December 15, 2012.

(3) B/E AEROSPACE Service Bulletin 22CXX-0100-35-003, Revision 1, dated December 20, 2011.

#### (k) Credit for Previous Actions

This paragraph provides credit for the actions required by paragraph (h) of this AD, if those actions were performed before the effective date of this AD using the service information specified in paragraph (k)(1) or (k)(2) of this AD, as applicable.

(1) B/E AEROSPACE Service Bulletin 1XCXX-0100-35-005, dated March 14, 2011, which is not incorporated by reference in this AD.

(2) B/E AEROSPACE Service Bulletin 22CXX-0100-35-003, dated March 17, 2011, which is not incorporated by reference in this AD.

#### (l) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Sanjay Ralhan, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1405; fax 425-227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (m) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information European Aviation Safety Agency Airworthiness Directive 2012-0083, dated May 16, 2012, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov/#!documentDetail;D=FAA-2012-0807-0006>.

(2) Service information identified in this AD that is not incorporated by reference may be viewed at the addresses specified in paragraphs (n)(3) and (n)(4) of this AD.

#### (n) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this

paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Airbus Service Bulletin A320-35A1047, dated March 29, 2011.

(ii) B/E AEROSPACE Service Bulletin 1XCXX-0100-35-005, Revision 1, dated December 15, 2012.

(iii) B/E AEROSPACE Service Bulletin 22CXX-0100-35-003, Revision 1, dated December 20, 2011.

(3) For service information identified in this AD, contact Airbus, Airworthiness Office—EIAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on July 9, 2014.

**Jeffrey E. Duven,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2014-16706 Filed 8-4-14; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2014-0514; Directorate Identifier 2014-SW-027-AD; Amendment 39-17925; AD 2014-16-01]**

**RIN 2120-AA64**

#### **Airworthiness Directives; MD Helicopters, Inc., Helicopters**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for MD Helicopters, Inc. (MDHI), Model MD900 helicopters. This AD requires an eddy current inspection of the main rotor upper hub assembly (upper hub) for a crack and replacing the upper hub with an airworthy upper hub before further flight if there is a crack. This AD is prompted by a report of cracks on an upper hub at the blade attach holes. The actions specified by this AD are

intended to detect a crack in the upper hub to prevent failure of the upper hub and subsequent loss of control of the helicopter.

**DATES:** This AD becomes effective August 20, 2014.

The Director of the Federal Register approved the incorporation by reference of a certain document listed in this AD as of August 20, 2014.

We must receive comments on this AD by October 6, 2014.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Docket:* Go to <http://www.regulations.gov>. Follow the online instructions for sending your comments electronically.

- *Fax:* 202-493-2251.

- *Mail:* Send comments to the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590-0001.

- *Hand Delivery:* Deliver to the "Mail" address between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

#### **Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> or in person at the Docket Operations Office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, any incorporated by reference service information, the economic evaluation, any comments received, and other information. The street address for the Docket Operations Office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

For service information identified in this AD, contact MD Helicopters, Inc., Attn: Customer Support Division, 4555 E. McDowell Rd., Mail Stop M615, Mesa, AZ 85215-9734; telephone 1-800-388-3378; fax 480-346-6813; or at <http://www.mdhelicopters.com>. You may review the referenced service information at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137.

**FOR FURTHER INFORMATION CONTACT:** Eric Schrieber, Aviation Safety Engineer, Los Angeles Aircraft Certification Office, Transport Airplane Directorate, FAA, 3960 Paramount Blvd., Lakewood, California 90712; telephone (562) 627-5348; email [eric.schrieber@faa.gov](mailto:eric.schrieber@faa.gov).

**SUPPLEMENTARY INFORMATION:**