

dated December 20, 2006, in accordance with 5 U.S.C. 552(a) and 1 CFR part 51.

(2) On March 27, 2006 (71 FR 12277, March 10, 2006), the Director of the Federal Register approved the incorporation by reference of Bombardier Alert Service Bulletin A601R-27-144, Revision A, dated February 14, 2006, including Appendix A, dated September 15, 2005.

(3) On February 13, 2004 (69 FR 4234, January 29, 2004), the Director of the Federal Register approved the incorporation by reference of Bombardier Temporary Revision 2B-1784, dated October 24, 2003, to the CL-600-2B19 Canadair Regional Jet Maintenance Requirements Manual, Part 2, Appendix B, "Airworthiness Limitations."

(4) Contact Bombardier, Inc., Canadair, Aerospace Group, P.O. Box 6087, Station Centre-ville, Montreal, Quebec H3C 3G9, Canada, for a copy of this service information. You may review copies at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on March 31, 2008.

Dionne Palermo,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. E8-7294 Filed 4-11-08; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2008-0011; Directorate Identifier 2007-NM-203-AD; Amendment 39-15460; AD 2008-08-08]

RIN 2120-AA64

Airworthiness Directives; Boeing Model 757 Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for certain Boeing Model 757 airplanes. This AD requires an inspection to determine the manufacturer and manufacture date of the oxygen masks in the passenger service units and the lavatory and attendant box assemblies, and corrective action if necessary. This AD results from a report that several passenger masks with broken in-line flow indicators were found following a mask deployment. We are issuing this AD to prevent the in-line flow indicators of the passenger oxygen masks from fracturing and

separating, which could inhibit oxygen flow to the masks and consequently result in exposure of the passengers and cabin attendants to hypoxia following a depressurization event.

DATES: This AD is effective May 19, 2008.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of May 19, 2008.

ADDRESSES: For service information identified in this AD, contact Boeing Commercial Airplanes, P.O. Box 3707, Seattle, Washington 98124-2207.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (telephone 800-647-5527) is the Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Robert Hettman, Aerospace Engineer, Cabin Safety and Environmental Systems Branch, ANM-150S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 917-6457; fax (425) 917-6590.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an airworthiness directive (AD) that would apply to certain Boeing Model 757 airplanes. That NPRM was published in the **Federal Register** on January 14, 2008 (73 FR 2195). That NPRM proposed to require an inspection to determine the manufacturer and manufacture date of the oxygen masks in the passenger service units and the lavatory and attendant box assemblies, and corrective action if necessary.

Comments

We gave the public the opportunity to participate in developing this AD. We considered the comment received. Boeing supports the NPRM.

Conclusion

We reviewed the relevant data, considered the comments received, and

determined that air safety and the public interest require adopting the AD as proposed.

Costs of Compliance

There are about 1,035 airplanes of the affected design in the worldwide fleet. This AD affects about 640 airplanes of U.S. registry. The required actions take about 20 work hours per airplane, for an average of 240 oxygen masks per airplane, at an average labor rate of \$80 per work hour. Based on these figures, the estimated cost of the AD for U.S. operators is \$1,024,000, or \$1,600 per airplane.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979), and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

You can find our regulatory evaluation and the estimated costs of compliance in the AD Docket.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new AD:

2008-08-08 Boeing: Amendment 39-15460. Docket No. FAA-2008-0011; Directorate Identifier 2007-NM-203-AD.

Effective Date

(a) This airworthiness directive (AD) is effective May 19, 2008.

Affected ADs

(b) None.

Applicability

(c) This AD applies to Boeing Model 757-200, -200CB, -200PF, and -300 series airplanes, certificated in any category; as identified in Boeing Special Attention Service Bulletin 757-35-0028, dated April 9, 2007.

Unsafe Condition

(d) This AD results from a report that several passenger masks with broken in-line flow indicators were found following a mask deployment. We are issuing this AD to prevent the in-line flow indicators of the passenger oxygen masks from fracturing and separating, which could inhibit oxygen flow to the masks and consequently result in exposure of the passengers and cabin attendants to hypoxia following a depressurization event.

Compliance

(e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

Inspection and Corrective/Other Specified Actions if Necessary

(f) Within 60 months after the effective date of this AD, do a general visual inspection to determine the manufacturer and manufacture date of the oxygen masks in the passenger service units and the lavatory and attendant box assemblies, and do the applicable corrective action, by accomplishing all of the applicable actions specified in the Accomplishment Instructions of Boeing Special Attention Service Bulletin 757-35-0028, dated April 9, 2007; except where the service bulletin specifies repairing the oxygen mask

assembly, replace it with a new or modified oxygen mask assembly having an improved flow indicator. The corrective action and other specified action must be done before further flight.

Note 1: The service bulletin refers to B/E Aerospace Service Bulletin 174080-35-01, dated February 6, 2006; and Revision 1, dated May 1, 2006; as additional sources of service information for modifying the oxygen mask assembly by replacing the flow indicator with an improved flow indicator.

Alternative Methods of Compliance (AMOCs)

(g)(1) The Manager, Seattle Aircraft Certification Office, FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) To request a different method of compliance or a different compliance time for this AD, follow the procedures in 14 CFR 39.19. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

Material Incorporated by Reference

(h) You must use Boeing Special Attention Service Bulletin 757-35-0028, dated April 9, 2007, to do the actions required by this AD, unless the AD specifies otherwise.

(1) The Director of the Federal Register approved the incorporation by reference of this service information under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, P.O. Box 3707, Seattle, Washington 98124-2207.

(3) You may review copies of the service information incorporated by reference at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html.

Issued in Renton, Washington, on March 31, 2008.

Dionne Palermo,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. E8-7297 Filed 4-11-08; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2007-29331; Directorate Identifier 2007-NM-136-AD; Amendment 39-15459; AD 2008-08-07]

RIN 2120-AA64

Airworthiness Directives; Saab Model SAAB-Fairchild SF340A (SAAB/SF340A) and SAAB 340B Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for the products listed above. This AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

A crack has been found in an axle adaptor during fatigue testing. It was found that the internal edges of the dowel holes did not have the correct radius and the crack had developed from the edge of one of the dowel holes.

A crack in the axle adaptor can cause the axle adaptor to fail and ultimately lead to loss of [the] wheels and total loss of brake capability.

We are issuing this AD to require actions to correct the unsafe condition on these products.

DATES: This AD becomes effective May 19, 2008.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of May 19, 2008.

ADDRESSES: You may examine the AD docket on the Internet at <http://www.regulations.gov> or in person at the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC.

FOR FURTHER INFORMATION CONTACT: Mike Borfitz, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-2677; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION:**Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR