

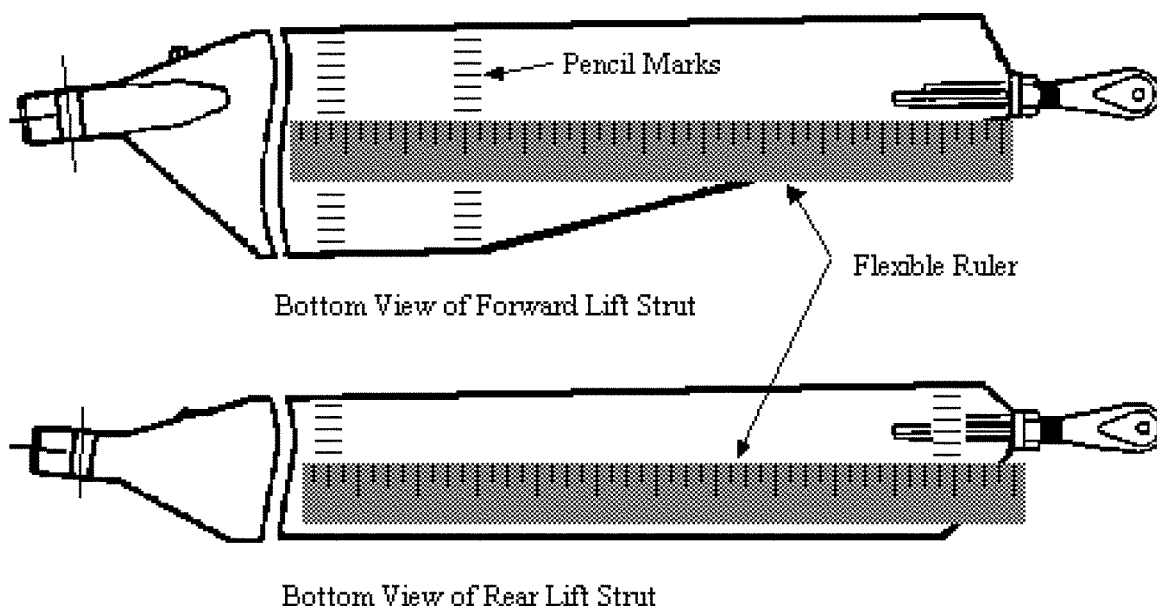


Figure 1

Issued in Kansas City, Missouri, on August 6, 2013.

**Earl Lawrence,**  
Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2013-19530 Filed 8-12-13; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2013-0687; Directorate Identifier 2012-NM-118-AD]

RIN 2120-AA64

#### Airworthiness Directives; Bombardier, Inc. Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all Bombardier, Inc. Model CL-600-2B19 (Regional Jet Series 100 & 440) airplanes. This proposed AD was prompted by reports of burr marks on the primary wheels, and cracked rings on the primary wheel shaft, on certain horizontal stabilizer trim actuators (HSTAs). This proposed AD would require replacing certain HSTAs. We are proposing this AD to prevent burr marks on the primary wheels, and cracked rings on the primary wheel shaft, on

certain HSTAs, which may lead to a disconnect of the pitch trim surface and subsequent loss of pitch control, resulting in loss of control of the airplane.

**DATES:** We must receive comments on this proposed AD by September 27, 2013.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Cesar Gomez, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office (ACO), 1600 Stewart Avenue, Suite 410, Westbury, New York 11590; telephone (516) 228-7318; fax (516) 794-5531.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2013-0687; Directorate Identifier 2012-NM-118-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the

closing date and may amend this proposed AD based on those comments. We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

Transport Canada Civil Aviation, which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2012-18, dated May 29, 2012 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

It was discovered that a number of primary wheels on the HSTA P/N [part number] 601R92305-5 (or vendor P/N 8396-4) had burr marks. Investigation revealed that the burr marks were a result of incorrectly using the manufacturing process. In addition, some rings that were fitted on the primary wheel shaft were found cracked. If not corrected, this condition may lead to a disconnect of the pitch trim surface and subsequent loss of pitch control. This [Canadian] AD mandates the removal of the affected units that have the above described manufacturing defect.

Corrective actions include replacement of certain HSTAs. You may obtain further information by examining the MCAI in the AD docket.

Relevant Service Information

Bombardier has issued Service Bulletin 601R-27-159, dated June 15, 2011. The actions described in this service bulletin are intended to correct the unsafe condition identified in the MCAI.

FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

Differences Between This AD and the MCAI or Service Information

While the Applicability of Transport Canada Civil Aviation (TCCA) Canadian

AD CF-2012-18, dated May 29, 2012, is Bombardier, Inc. Model CL-600-2B19 (Regional Jet Series 100 & 440) airplanes, serial numbers 7003 and subsequent, equipped with HSTAs having P/N 601R92305-5 or vendor P/N 8396-4, with serial numbers (S/N)s 287, 724, 813, 841, 998, 1031, 1035, 1049, 1053, 1067, 1068, 1136, 1252, 1268, 1303, 1319, 1338, 1354, 1374, 1378, 1445, 1470, 1498, 1513, 1546, 1632, 1736, 1766, 1846, 1849, 2002 through 2009, 2011, 2013 through 2016, 2019, 2020, and 2022; the applicability of this AD is for all Bombardier, Inc. Model CL-600-2B19 (Regional Jet Series 100 & 440) airplanes. This has been coordinated with TCCA.

While TCCA Canadian AD CF-2012-18, dated May 29, 2012, does not allow for a records review to verify part numbers, paragraph (g) of this AD does allow for a records review to be used to verify part numbers.

Costs of Compliance

We estimate that this proposed AD affects 575 airplanes of U.S. registry. We estimate the following costs to comply with this proposed AD:

ESTIMATED COSTS

| Action            | Labor cost                                    | Parts cost | Cost per product | Cost on U.S. operators |
|-------------------|-----------------------------------------------|------------|------------------|------------------------|
| Replacement ..... | 19 work-hours × \$85 per hour = \$1,615 ..... | \$0        | \$1,615          | \$928,625              |

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority. We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. For the reasons discussed above, I certify this proposed regulation: 1. Is not a “significant regulatory action” under Executive Order 12866; 2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); 3. Will not affect intrastate aviation in Alaska; and 4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:  
**Authority:** 49 U.S.C. 106(g), 40113, 44701.
- § 39.13 [Amended]
- 2. The FAA amends § 39.13 by adding the following new AD:

**Bombardier, Inc.:** Docket No. FAA–2013–0687; Directorate Identifier 2012–NM–118–AD.

**(a) Comments Due Date**

We must receive comments by September 27, 2013.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all Bombardier, Inc. Model CL–600–2B19 (Regional Jet Series 100 & 440) airplanes, certificated in any category.

**(d) Subject**

Air Transport Association (ATA) of America Code 27, Flight Controls.

**(e) Reason**

This AD was prompted by reports of burr marks on the primary wheels, and cracked rings on the primary wheel shaft, on certain HSTAs. We are issuing this AD to prevent burr marks on the primary wheels, and cracked rings on the primary wheel shaft, on certain HSTAs, which may lead to a disconnect of the pitch trim surface and subsequent loss of pitch control, resulting in loss of control of the airplane.

**(f) Compliance**

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**(g) Inspection**

Within 1,000 flight hours or 4 months after the effective date of this AD, whichever occurs first, inspect to determine if any HSTA having part number (P/N) 601R92305–5 or vendor P/N 8396–4, with serial numbers (S/N)s 287, 724, 813, 841, 998, 1031, 1035, 1049, 1053, 1067, 1068, 1136, 1252, 1268, 1303, 1319, 1338, 1354, 1374, 1378, 1445, 1470, 1498, 1513, 1546, 1632, 1736, 1766, 1846, 1849, 2002 through 2009, 2011, 2013 through 2016, 2019, 2020, and 2022 is installed. A review of airplane maintenance records is acceptable in lieu of this inspection if the part number of the HSTA can be conclusively determined from that review.

**(h) Replacement**

Within 1,000 flight hours or 4 months after the effective date of this AD, whichever occurs first, replace the affected HSTAs identified in paragraph (g) of this AD, with a serviceable HSTA, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 601R–27–159, dated June 15, 2011.

**(i) Parts Installation Limitations**

As of the effective date of this AD, no person may install any HSTA having P/N 601R92305–5 or vendor P/N 8396–4 with a S/N listed in paragraph (g) of this AD, unless the S/N has the suffix “A” beside it.

**(j) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft

Certification Office, (ACO), ANE–170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300; fax 516–794–5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

**(k) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information Canadian Airworthiness Directive CF–2012–18, dated May 29, 2012, for related information, which can be found in the AD docket on the internet at <http://www.regulations.gov>.

(2) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514–855–5000; fax 514–855–7401; email [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on August 6, 2013.

**Jeffrey E. Duven,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013–19534 Filed 8–12–13; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA–2013–0690; Directorate Identifier 2013–NM–088–AD]

**RIN 2120–AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to supersede airworthiness directive (AD) 2009–24–07, which applies to certain The Boeing Company Model 737–600, –700, –700C, and –800 series airplanes. AD 2009–24–07 currently requires repetitive lubrications of the right and left main landing gear (MLG) forward trunnion pins. AD 2009–24–07 also requires an inspection for discrepancies of the transition radius of the MLG forward trunnion pins, and corrective actions if necessary. For certain airplanes, AD 2009–24–07 requires repetitive detailed inspections for discrepancies (including finish damage, corrosion, pitting, and base metal scratches) of the transition radius of the left and right MLG trunnion pins, and corrective action if necessary. Replacing or overhauling the trunnion pins would terminate the actions required by AD 2009–24–07. This proposed AD would add airplanes to the applicability of AD 2009–24–07. We are proposing this AD to prevent stress corrosion cracking of the forward trunnion pins, which could result in fracture of the pins and consequent collapse of the MLG.

**DATES:** We must receive comments on this proposed AD by September 27, 2013.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H–65, Seattle, WA 98124–2207; telephone 206–544–5000, extension 1; fax 206–766–5680; Internet <https://www.myboeingfleet.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, Washington 98057–3356. For information on the availability of this material at the FAA, call 425–227–1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://>