

alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent chafing of the passenger seat wire assembly against a bracket at the lower sidewall panel due to insufficient clearance between the bracket and seat wire assembly, which could result in arcing damage to the passenger seat wire assembly and consequent smoke and fire in the main cabin, accomplish the following:

Inspection, Installation, and Repair, If Necessary

(a) Within 6 months after the effective date of this AD, perform a detailed visual inspection of the passenger seat wire assembly to detect chafed or damaged wires, and install protective sleeving, in accordance with McDonnell Douglas Alert Service Bulletin MD11-24A152, dated August 9, 1999. If any chafed or damaged wire is found, prior to further flight, repair in accordance with the service bulletin.

Note 2: For the purposes of this AD, a detailed visual inspection is defined as: "An intensive visual examination of a specific structural area, system, installation, or assembly to detect damage, failure, or irregularity. Available lighting is normally supplemented with a direct source of good lighting at intensity deemed appropriate by the inspector. Inspection aids such as mirror, magnifying lenses, etc., may be used. Surface cleaning and elaborate access procedures may be required."

Alternative Methods of Compliance

(b) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

Special Flight Permits

(c) Special flight permits may be issued in accordance with §§ 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(d) The actions shall be done in accordance with McDonnell Douglas Alert Service Bulletin MD11-24A152, dated August 9, 1999. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained

from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Technical Publications Business Administration, Dept. C1-L51 (2-60). Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register 800 North Capitol Street, NW., suite 700, Washington, DC.

(e) This amendment becomes effective on May 19, 2000.

Issued in Renton, Washington, on April 4, 2000.

Donald L. Riggins,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 00-8810 Filed 4-13-00; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 99-NM-264-AD; Amendment 39-11669; AD 2000-07-15]

RIN 2120-AA64

Airworthiness Directives; McDonnell Douglas Model MD-11 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain McDonnell Douglas Model MD-11 series airplanes, that requires a one-time detailed visual inspection of the electrical connections to detect corrosion; repair, if necessary; and installation of new circuit breakers and associated wiring. This amendment is prompted by a report that the ratings of certain circuit breakers of a certain video entertainment system exceed the ratings of their associated electrical connector contacts. The actions specified by this AD are intended to prevent a disparity between the ratings of certain circuit breakers and their associated electrical connector contacts, which could damage the electrical connector contacts and cause possible arcing and heat damage to the electrical connector.

DATES: Effective May 19, 2000.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of May 19, 2000.

ADDRESSES: The service information referenced in this AD may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Technical Publications Business Administration, Dept. C1-L51 (2-60). This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT:

Brett Portwood, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5350; fax (562) 627-5210.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model MD-11 series airplanes was published in the **Federal Register** on February 1, 2000 (65 FR 4782). That action proposed to require a one-time detailed visual inspection of the electrical connections to detect corrosion; repair, if necessary; and installation of new circuit breakers and associated wiring.

Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. Due consideration has been given to the single comment received.

The commenter supports the proposed rule.

Conclusion

After careful review of the available data, including the comment noted above, the FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

Cost Impact

There are approximately 12 airplanes of the affected design in the worldwide fleet. The FAA estimates that 12 airplanes of U.S. registry will be affected by this AD.

It will take approximately 30 work hours per airplane to accomplish the required actions, at an average labor rate of \$60 per work hour. The manufacturer

has committed previously to its customers that it will bear the cost of replacement parts. As a result, the cost of those parts is not attributable to this AD. Based on this information the cost impact of the AD on U.S. operators is estimated to be \$21,600, or \$1,800 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. However, the FAA has been advised that manufacturer warranty remedies are available for labor costs associated with accomplishing the actions required by this AD. Therefore, the future economic cost impact of this rule on U.S. operators may be less than the cost impact figure indicated above.

Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption ADDRESSES.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

2000-07-15 McDonnell Douglas:

Amendment 39-11669. Docket 99-NM-264-AD.

Applicability: Model MD-11 series airplanes, as listed in McDonnell Douglas Service Bulletin MD11-23-082, dated August 17, 1999; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent a disparity between the ratings of certain circuit breakers and their associated electrical connector contacts, which could damage the electrical connector contacts and possible arcing and heat damage to the electrical connector, accomplish the following:

Inspection, Installation, and Repair, If Necessary

(a) Within 1 year after the effective date of this AD, perform a detailed visual inspection of certain electrical connections to detect corrosion, and install new circuit breakers and associated electrical wiring (including modification of a certain nameplate), in accordance with McDonnell Douglas Service Bulletin MD11-23-082, dated August 17, 1999. If any corrosion is detected, prior to further flight, repair in accordance with the service bulletin.

Note 2: For the purposes of this AD, a detailed visual inspection is defined as: "An intensive visual examination of a specific structural area, system, installation, or assembly to detect damage, failure, or irregularity. Available lighting is normally supplemented with a direct source of good lighting at intensity deemed appropriate by the inspector. Inspection aids such as mirror, magnifying lenses, etc., may be used. Surface cleaning and elaborate access procedures may be required."

Alternative Methods of Compliance

(b) An alternative method of compliance or adjustment of the compliance time that

provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

Special Flight Permits

(c) Special flight permits may be issued in accordance with §§ sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(d) The actions shall be done in accordance with McDonnell Douglas Service Bulletin MD11-23-082, dated August 17, 1999. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Technical Publications Business Administration, Dept. C1-L51 (2-60). Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register 800 North Capitol Street, NW., suite 700, Washington, DC.

(e) This amendment becomes effective on May 19, 2000.

Issued in Renton, Washington, on April 4, 2000.

Donald L. Riggins,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 00-8811 Filed 4-13-00; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 99-NM-265-AD; Amendment 39-11670; AD 2000-07-16]

RIN 2120-AA64

Airworthiness Directives; McDonnell Douglas Model MD-11 and MD-11F Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment supersedes an existing airworthiness directive (AD),