

airplanes, certificated in any category, as identified in Boeing Alert Requirements Bulletin 737-53A1388 RB, dated October 27, 2020.

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage.

**(e) Unsafe Condition**

This AD was prompted by an evaluation by the design approval holder (DAH) indicating that the frame splice between stringer S-13 and S-14 is subject to widespread fatigue damage (WFD). The FAA is issuing this AD to address upper frame cracking common to the frame splice between stringer S-13 and S-14, which could interact with stringer S-14 skin lap splice lower fastener row cracking in lower skin and result in an uncontrolled decompression of the airplane and loss of structural integrity.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Except as specified by paragraph (h) of this AD: At the applicable times specified in the "Compliance" paragraph of Boeing Alert Requirements Bulletin 737-53A1388 RB, dated October 27, 2020, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin 737-53A1388 RB, dated October 27, 2020.

**Note 1 to paragraph (g):** Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin 737-53A1388, dated October 27, 2020, which is referred to in Boeing Alert Requirements Bulletin 737-53A1388 RB, dated October 27, 2020.

**(h) Exceptions to Service Information Specifications**

(1) Where Boeing Alert Requirements Bulletin 737-53A1388 RB, dated October 27, 2020, uses the phrase "the Original Issue date of Requirements Bulletin 737-53A1388 RB," this AD requires using "the effective date of this AD," except where Alert Requirements Bulletin 737-53A1388 RB, dated October 27, 2020, uses the phrase "the Original Issue date of Requirements Bulletin 737-53A1388 RB," in a note or flag note.

(2) Where Boeing Alert Requirements Bulletin 737-53A1388 RB, dated October 27, 2020, specifies contacting Boeing for repair instructions or for alternative inspections: This AD requires doing the repair, or doing the alternative inspections and applicable on-condition actions using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight

Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in Related Information. Information may be emailed to: [9-ANM-LAACO-AMOC-Requests@faa.gov](mailto:9-ANM-LAACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

**(j) Related Information**

(1) For more information about this AD, contact Wayne Ha, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5238; fax: 562-627-5210; email: [wayne.ha@faa.gov](mailto:wayne.ha@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on July 26, 2021.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2021-18069 Filed 8-23-21; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

**[Docket No. FAA-2021-0694; Project Identifier MCAI-2021-00305-T]**

**RIN 2120-AA64**

**Airworthiness Directives; De Havilland Aircraft of Canada Limited (Type Certificate Previously Held by Bombardier, Inc.) Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for De

Havilland Aircraft of Canada Limited Model DHC-8-401 and -402 airplanes. This proposed AD was prompted by reports of a possible hard contact between the #2 top high level sensor (HLS) terminal screw head and the #6 outer wing fuel access panel stiffener flange. This proposed AD would require removing and replacing or reworking the #6 outer wing fuel access panel assembly. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by October 8, 2021.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202-493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact De Havilland Aircraft of Canada Limited, Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd@dehavilland.com](mailto:thd@dehavilland.com); internet <https://dehavilland.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

**Examining the AD Docket**

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0694; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

**FOR FURTHER INFORMATION CONTACT:**

Thomas Niczky, Aerospace Engineer, Avionics and Electrical Systems Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7347; fax 516-794-5531; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

**SUPPLEMENTARY INFORMATION:**

### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2021-0694; Project Identifier MCAI-2021-00305-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be

placed in the public docket of this NPRM. Submissions containing CBI should be sent to Thomas Niczky, Aerospace Engineer, Avionics and Electrical Systems Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7347; fax 516-794-5531; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov). Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

### Background

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued TCCA AD CF-2021-08, dated March 9, 2021 (TCCA AD CF-2021-08) (also referred to after this as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for De Havilland Aircraft of Canada Limited Model DHC-8-401 and -402 airplanes, serial numbers 4001 and 4003 through 4628 inclusive. You may examine the MCAI in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0694.

This proposed AD was prompted by the discovery that as a result of build tolerances, a hard contact could occur between the #2 top HLS terminal screw head and the #6 outer wing fuel access panel stiffener flange. The FAA is proposing this AD to address the possibility of electrical arcing during a lightning strike, which could be a source of ignition inside the fuel tank. See the MCAI for additional background information.

### Related Service Information Under 1 CFR Part 51

De Havilland Aircraft of Canada Limited has issued Service Bulletin 84-

57-35, Revision A, dated February 11, 2021. This service information describes procedures for replacing or reworking the #6 outer wing fuel access panel assembly. The rework involves an eddy current or fluorescent liquid penetrant inspection of the rework area for crack indications. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

### FAA's Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI and service information referenced above. The FAA is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop on other products of the same type design.

### Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in the service information already described.

### Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 54 airplanes of U.S. registry. For either replacement or repair of the #6 outer wing fuel access panel, depending on the option selected by the operator to comply with this proposed AD, the FAA estimates the following costs:

### ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product
Replacement .....	Up to 10 work-hours × \$85 per hour = Up to \$850 .....	Up to \$16,430 .....	Up to \$17,280.
Repair .....	13 work-hours × \$85 per hour = \$1,105 .....	\$49 .....	\$1,154.

The FAA has included all known costs in its cost estimate. According to the manufacturer, however, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue

rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA

with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

## Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a “significant regulatory action” under Executive Order 12866,

(2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

## List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

## PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**De Havilland Aircraft of Canada Limited (Type Certificate Previously Held by Bombardier, Inc.):** Docket No. FAA–2021–0694; Project Identifier MCAI–2021–00305–T.

### (a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by October 8, 2021.

### (b) Affected ADs

None.

### (c) Applicability

This AD applies to De Havilland Aircraft of Canada Limited Model DHC–8–401 and –402 airplanes, certificated in any category, serial numbers 4001 and 4003 through 4628 inclusive.

### (d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

### (e) Unsafe Condition

This AD was prompted by reports of a possible hard contact between the #2 top high level sensor (HLS) terminal screw head and the #6 outer wing fuel access panel stiffener flange. The FAA is issuing this AD to address the possibility of electrical arcing during a lightning strike, which could be a source of ignition inside the fuel tank.

### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

### (g) Required Actions

Within 8,000 flight hours after the effective date of this AD: Do the actions specified in paragraph (g)(1) or (2) of this AD.

(1) Replace the #6 outer wing fuel access panel assembly in accordance with Section 3.B., Part A, of the Accomplishment Instructions of De Havilland Aircraft of Canada Limited Service Bulletin 84–57–35, Revision A, dated February 11, 2021.

(2) Rework the #6 outer wing fuel access panel assembly, including an eddy current or fluorescent liquid penetrant inspection for crack indications of the rework area, in accordance with Section 3.B., Part B, of the Accomplishment Instructions of De Havilland Aircraft of Canada Limited Service Bulletin 84–57–35, Revision A, dated February 11, 2021. If any crack indication is found, before further flight, repair using a method approved in accordance with the procedures specified in paragraph (j)(2) of this AD.

### (h) Parts Installation Prohibition

As of the effective date of this AD, no person may install a #6 outer wing fuel access panel assembly, part numbers (P/Ns) 85714233–003/–004 and 85714233–005/–006, on any airplane.

### (i) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using De Havilland Aircraft of Canada Limited Service Bulletin 84–57–35, dated October 1, 2020.

### (j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7300; fax 516–794–5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or De Havilland Aircraft of Canada Limited’s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

### (k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) TCCA AD CF–2021–08, dated March 9, 2021, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0694.

(2) For more information about this AD, contact Thomas Niczky, Aerospace Engineer, Avionics and Electrical Systems Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7347; fax 516–794–5531; email [9-avs-nyaco-cos@faa.gov](mailto:9-avs-nyaco-cos@faa.gov).

(3) For service information identified in this AD, contact De Havilland Aircraft of Canada Limited, Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416–375–4000; fax 416–375–4539; email [thd@dehavilland.com](mailto:thd@dehavilland.com); internet <https://dehavilland.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued on August 18, 2021.

**Gaetano A. Sciortino,**

*Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2021–18111 Filed 8–23–21; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

## Federal Aviation Administration

### 14 CFR Part 39

[Docket No. FAA–2021–0665; Project Identifier AD–2021–00270–T]

**RIN 2120–AA64**

### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede Airworthiness Directive (AD) 2017–23–02, which applies to certain The Boeing Company Model 737–200, –200C, –300, –400, and –500 series airplanes. AD 2017–23–02 requires