

(2) Relocate the EPS wiring harness by following steps 4 through 12 of the Instructions in Piper SB No. 1337.

**(h) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Atlanta ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (i) of this AD.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (h)(3)(i) and (ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(i) Related Information**

(1) For more information about this AD, contact Bryan Long, Aerospace Engineer, Atlanta ACO Branch, FAA, 1701 Columbia Avenue, College Park, Georgia 30337; phone: (404) 474-5578; fax: (404) 474-5606; email: [bryan.long@faa.gov](mailto:bryan.long@faa.gov).

(2) For service information identified in this AD, contact Piper Aircraft, Inc., 2916 Piper Drive, Vero Beach, Florida 32960; telephone (772) 567-4361; email: [customer.service@piper.com](mailto:customer.service@piper.com); internet: <https://www.piper.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Issued on July 22, 2020.

**Lance T. Gant, Director,**

*Compliance & Airworthiness Division,  
Aircraft Certification Service.*

[FR Doc. 2020-16207 Filed 7-27-20; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA-2020-0587; Product Identifier 2020-NM-086-AD]

**RIN 2120-AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for all The Boeing Company Model 737-100, -200, -200C, -300, -400, and -500 series airplanes. This proposed AD was prompted by crack indications found in the lower aft wing skin bolt holes where the flap tracks attach to the track support fitting. This proposed AD would require repetitive inspections for cracking of the left and right wing, lower aft wing skin aft edge, at certain flap track locations, and applicable on-condition actions. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by September 11, 2020.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202-493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet

at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0587.

**Examining the AD Docket**

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2020-0587; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:**

Wayne Ha, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: 562-627-5238; fax: 562-627-5210; email: [wayne.ha@faa.gov](mailto:wayne.ha@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2020-0587; Product Identifier 2020-NM-086-AD" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this NPRM because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The FAA will also post a report summarizing each substantive verbal contact received about this proposed AD.

**Confidential Business Information**

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important

that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to the person identified in the **FOR FURTHER INFORMATION CONTACT** section. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Discussion

The FAA has received a report indicating that during teardown of a Model 737–300 airplane, crack indications were found in the lower aft wing skin bolt holes where the flap tracks attach to the track support fitting at flap track numbers 1, 2, and 3. The crack findings occurred at 67,695 total flight cycles and 80,269 total flight hours. Crack indications at flap track number 2 and flap track number 3 were confirmed by a metallurgical lab. The indication at flap track number 1 was confirmed by the metallurgical lab to have some corrosion in the hole of the fitting, but no crack in the skin. This damage is the result of local stresses being higher than expected. In addition, the left and right wing, lower wing skin pad up length is insufficient to reduce stress. This condition, if not addressed, could result in undetected cracking in the lower wing skin, which could result in the inability of the structure to carry

limit load, and adversely affect the structural integrity of the airplane.

Related Service Information Under 1 CFR Part 51

The FAA reviewed Boeing Alert Requirements Bulletin 737–57A1349 RB, dated April 14, 2020. The service information describes procedures for repetitive high frequency eddy current inspections for cracking of the left and right wing, lower aft wing skin aft edge, at flap track numbers 1, 2, 3, 6, 7, and 8 attachment location and applicable on-condition actions. On-condition actions include repairing any cracking found.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

FAA’s Determination

The FAA is proposing this AD because the agency evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements

This proposed AD would require accomplishment of the actions identified in Boeing Alert Requirements Bulletin 737–57A1349 RB, dated April 14, 2020, described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

For information on the procedures and compliance times, see this service information at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2020–0587.

Explanation of Requirements Bulletin

The FAA worked in conjunction with industry, under the Airworthiness Directive Implementation Aviation Rulemaking Committee (AD ARC), to enhance the AD system. One enhancement is a process for annotating which steps in the service information are “required for compliance” (RC) with an AD. Boeing has implemented this RC concept into Boeing service bulletins.

In an effort to further improve the quality of ADs and AD-related Boeing service information, a joint process improvement initiative was worked between the FAA and Boeing. The initiative resulted in the development of a new process in which the service information more clearly identifies the actions needed to address the unsafe condition in the “Accomplishment Instructions.” The new process results in a Boeing Requirements Bulletin, which contains only the actions needed to address the unsafe condition (*i.e.*, only the RC actions).

Costs of Compliance

The FAA estimates that this proposed AD affects 141 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
HFEC inspections.	7 work-hours × \$85 per hour = \$595 per inspection cycle.	\$0	\$595 per inspection cycle .....	\$83,895 per inspection cycle.

The FAA has received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this proposed AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA

with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or

on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**The Boeing Company:** Docket No. FAA–2020–0587; Product Identifier 2020–NM–086–AD.

#### (a) Comments Due Date

The FAA must receive comments by September 11, 2020.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to all The Boeing Company Model 737–100, –200, 200C, –300, –400, and –500 series airplanes, certificated in any category.

#### (d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

#### (e) Unsafe Condition

This AD was prompted by crack indications found in the lower aft wing skin bolt holes where the flap tracks attach to the track support fitting. The FAA is issuing this AD to address undetected cracking in the lower wing skin, which could result in the inability of the structure to carry limit load, and adversely affect the structural integrity of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Required Actions

Except as specified by paragraph (h) of this AD: At the applicable times specified in the “Compliance” paragraph of Boeing Alert Requirements Bulletin 737–57A1349 RB, dated April 14, 2020, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin 737–57A1349 RB, dated April 14, 2020.

**Note 1 to paragraph (g):** Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin 737–57A1349, dated April 14, 2020, which is referred to in Boeing Alert Requirements Bulletin 737–57A1349 RB, dated April 14, 2020.

## (h) Exceptions to Service Information Specifications

(1) Where Boeing Alert Requirements Bulletin 737–57A1349 RB, dated April 14, 2020, uses the phrase “the original issue date of Requirements Bulletin 737–57A1349 RB,” this AD requires using “the effective date of this AD.”

(2) Where Boeing Alert Requirements Bulletin 737–57A1349 RB, dated April 14, 2020, specifies contacting Boeing for repair instructions: This AD requires doing the repair and applicable on-condition actions before further flight using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

(3) For airplanes identified as Group 1 in Boeing Alert Requirements Bulletin 737 57A1349 RB, dated April 14, 2020: Within 120 days after the effective date of this AD, do actions to correct the unsafe condition using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

## (i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Los Angeles ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: 9-ANM-LAACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

## (j) Related Information

(1) For more information about this AD, contact Wayne Ha, Aerospace Engineer, Airframe Section, FAA, Los Angeles ACO Branch, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5238; fax: 562–627–5210; email: wayne.ha@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the

availability of this material at the FAA, call 206–231–3195.

Issued on July 13, 2020.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2020–16210 Filed 7–27–20; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2020–0586; Product Identifier 2020–NM–066–AD]

**RIN 2120–AA64**

### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede Airworthiness Directive (AD) 2018–14–02, which applies to certain The Boeing Company Model 777–200, –200LR, –300, and –300ER series airplanes. AD 2018–14–02 requires an inspection for foam insulation on the dripshield above the overhead panel support structure and replacement if necessary. For certain airplanes, AD 2018–14–02 also requires replacement of foam insulation on the overhead panel support structure. Since the FAA issued AD 2018–14–02, additional areas of Boeing Material Specification (BMS) 8–39 flexible urethane foam were found on the overhead panel support structure. This proposed AD would continue to require the actions in AD 2018–14–02, and, for certain airplanes, this proposed AD would require an inspection of the foam insulation on the overhead panel support structure, and replacement if necessary. The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by September 11, 2020.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** 202–493–2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room