

the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

The Boeing Company: Docket No. FAA–2011–0475; Directorate Identifier 2010–NM–199–AD.

(a) Comments Due Date

We must receive comments by August 15, 2014.

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company Model 757–200, –200PF, –200CB, and –300 series airplanes, certificated in any category, as identified in Boeing Service Bulletin 757–27A0152, Revision 3, dated October 28, 2013.

(d) Subject

Air Transport Association (ATA) of America Code 27, Flight Controls.

(e) Unsafe Condition

This AD was prompted by numerous reports of unintended lateral oscillations during the final approach, just before landing. We are issuing this AD to reduce the chance of unintended lateral oscillations near touchdown, which could result in loss of lateral control of the airplane, and consequent airplane damage or injury to flight crew and passengers.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Installation and Inspection

Within 60 months after the effective date of this AD, do the applicable actions specified in paragraphs (g)(1), (g)(2), and (g)(3) of this AD.

(1) For Configuration 1 airplanes as defined in Boeing Service Bulletin 757–27A0152, Revision 3, dated October 28, 2013: Install three bracket assemblies and three new relays, and make changes to the wire bundles, in accordance with the Accomplishment Instructions of Boeing Service Bulletin 757–27A0152, Revision 3, dated October 28, 2013.

(2) For Configuration 2 airplanes as defined in Boeing Service Bulletin 757–27A0152, Revision 3, dated October 28, 2013: Torque the bracket assembly nuts and ground stud nuts, do bond resistance tests to verify that bonding requirements are met, do a general visual inspection to ensure that the three new relays do not touch the adjacent wire bundles, and do all applicable related

investigative and corrective actions, in accordance with the Accomplishment Instructions of Boeing Service Bulletin 757–27A0152, Revision 3, dated October 28, 2013. Do all applicable related investigative and corrective actions before further flight.

(3) For Configuration 3 airplanes as defined in Boeing Service Bulletin 757–27A0152, Revision 3, dated October 28, 2013: Do a general visual inspection to ensure that the three new relays do not touch the adjacent wire bundles, and do all applicable related investigative and corrective actions, in accordance with the Accomplishment Instructions of Boeing Service Bulletin 757–27A0152, Revision 3, dated October 28, 2013. Do all applicable related investigative and corrective actions before further flight.

(h) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Boeing Service Bulletin 757–27A0152, Revision 2, dated May 25, 2012.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Los Angeles Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: 9-ANM-LAACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO, to make those findings. For a repair method to be approved, the repair must meet the certification basis of the airplane and the approval must specifically refer to this AD.

(j) Related Information

(1) For more information about this AD, contact Marie Hogestad, Aerospace Engineer, Systems and Equipment Branch, ANM–130S, Seattle Aircraft Certification Office (ACO), FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; phone: 425–917–6418; fax: 425–917–6590; email: marie.hogestad@faa.gov.

(2) For information about AMOCs for this AD, contact Jen Pei, Aerospace Engineer, Systems and Equipment Branch, ANM–130L, Los Angeles Aircraft Certification Office (ACO), FAA, 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5320; fax: 562–627–5210; email: jen.pei@faa.gov.

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services

Management, P.O. Box 3707, MC 2H–65, Seattle, WA 98124–2207; telephone 206–544–5000, extension 1; fax 206–766–5680; Internet <https://www.myboeingfleet.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on June 24, 2014.

Jeffrey E. Duven,

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2014–15416 Filed 6–30–14; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2014–0348; Directorate Identifier 2014–NM–033–AD]

RIN 2120–AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 777–200, 777–200LR, 777–300ER, and 777F series airplanes. This proposed AD was prompted by a report indicating that sealant may not have been applied in production to the wing skin panel gaps above certain underwing fittings. This proposed AD would require an inspection for missing sealant, and applicable other specified, related investigative, and corrective actions. We are proposing this AD to detect and correct missing sealant from the wing skin panel gaps above the underwing fittings, which could result in corrosion and fatigue cracking in the wing skin panel, and consequent loss of limit load capability of the wing skin and potential subsequent structural failure of the wings.

DATES: We must receive comments on this proposed AD by August 15, 2014.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** 202–493–2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M–

30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0348; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Haytham Alaidy, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, Washington 98057-6573; phone: 425-917-6422; fax: 425-917-6590; email: haytham.alaidy@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2014-0348; Directorate Identifier 2014-NM-033-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any

personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

We received a report that sealant may not have been applied in production to the wing skin panel gaps above certain underwing fittings, as required by type design before their installation. Affected in-production airplanes have been inspected for proper sealant application, and Boeing has addressed production installation procedures for this sealant. Missing sealant from the wing skin panel gaps above the underwing fittings could result in corrosion and fatigue cracking in the wing skin panel, and consequent loss of limit load capability of the wing skin and potential subsequent structural failure of the wings.

Relevant Service Information

We reviewed Boeing Alert Service Bulletin 777-57A0097, dated January 10, 2014. For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for Docket No. FAA-2014-0348.

FAA's Determination

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements

This proposed AD would require accomplishing an inspection for missing sealant, and applicable other specified, related investigative, and corrective actions, specified in the service information described previously, except as discussed under "Difference Between This Proposed AD and the Service Information."

The phrase "related investigative actions" is used in this proposed AD. "Related investigative actions" are follow-on actions that (1) are related to the primary actions, and (2) further investigate the nature of any condition found. Related investigative actions in an AD could include, for example, inspections.

The phrase "corrective actions" is used in this proposed AD. "Corrective actions" are actions that correct or address any condition found. Corrective actions in an AD could include, for example, repairs.

The phrase "other specified actions" is used in this proposed AD. Other

specified actions in this proposed AD include restoring sealant.

Explanation of "RC" Steps in Service Information

The FAA worked in conjunction with industry, under the Airworthiness Directives Implementation Aviation Rulemaking Committee, to enhance the AD system. One enhancement was a new process for annotating which steps in the service information are required for compliance with an AD. Differentiating these steps from other tasks in the service information is expected to improve an owner's/operator's understanding of crucial AD requirements and help provide consistent judgment in AD compliance. The actions specified in the service information described previously include steps that are labeled as RC (required for compliance) because these steps have a direct effect on detecting, preventing, resolving, or eliminating an identified unsafe condition.

As noted in the specified service information, steps labeled as RC must be done to comply with the proposed AD. However, steps that are not labeled as RC are recommended. Those steps that are not labeled as RC may be deviated from, done as part of other actions, or done using accepted methods different from those identified in the service information without obtaining approval of an AMOC, provided the steps labeled as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to steps labeled as RC will require approval of an alternative method of compliance.

Difference Between This Proposed AD and the Service Information

Boeing Alert Service Bulletin 777-57A0097, dated January 10, 2014, specifies to contact the manufacturer for instructions on how to repair certain conditions, but this proposed AD would require repairing those conditions in one of the following ways:

- In accordance with a method that we approve; or
- Using data that meet the certification basis of the airplane, and that have been approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) whom we have authorized to make those findings.

Costs of Compliance

We estimate that this proposed AD affects 6 airplanes of U.S. registry. We estimate the following costs to comply with this proposed AD:

ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection	Up to 104 work-hours × \$85 per hour = \$8,840	\$0	Up to \$8,840	Up to \$53,040.

We estimate the following costs to do any necessary actions that would be

required based on the results of the proposed inspection. We have no way of

determining the number of aircraft that might need these actions:

ON-CONDITION COSTS

Action	Labor cost	Parts cost	Cost per product
Sealant restoration	1 work-hour × \$85 per hour = \$85	\$0	\$85.
Corrosion inspection	2 work-hours × \$85 per hour = \$170	0	\$170 per side.

We have received no definitive data that would enable us to provide cost estimates for the on-condition corrosion repair specified in this proposed AD.

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This proposed regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

(1) Is not a "significant regulatory action" under Executive Order 12866,

(2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

The Boeing Company: Docket No. FAA–2014–0348; Directorate Identifier 2014–NM–033–AD.

(a) Comments Due Date

We must receive comments by August 15, 2014.

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company Model 777–200, 777–200LR, 777–300ER, and

777F series airplanes, certificated in any category, as identified in Boeing Alert Service Bulletin 777–57A0097, dated January 10, 2014.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Unsafe Condition

This AD was prompted by a report indicating that sealant may not have been applied in production to the wing skin panel gaps above certain underwing fittings. We are issuing this AD to detect and correct missing sealant from the wing skin panel gaps above the underwing fittings, which could result in corrosion and fatigue cracking in the wing skin panel, and consequent loss of limit load capability of the wing skin and potential subsequent structural failure of the wings.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Inspection

At the applicable time specified in paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 777–57A0097, dated January 10, 2014, except as required by paragraph (h)(1) of this AD: Do a detailed inspection for missing sealant in the wing skin panel gaps above the underwing fittings, and do all applicable other specified, related investigative, and corrective actions, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 777–57A0097, dated January 10, 2014, except as required by paragraph (h)(2) of this AD. Do all applicable other specified, related investigative, and corrective actions before further flight.

(h) Exceptions to Service Information Specifications

(1) Where Boeing Alert Service Bulletin 777–57A0097, dated January 10, 2014, specifies a compliance time "after the original issue date of this service bulletin," this AD requires compliance within the specified compliance time after the effective date of this AD.

(2) Where Boeing Alert Service Bulletin 777–57A0097, dated January 10, 2014,

specifies to contact Boeing for appropriate action: Repair before further flight using a method approved in accordance with the procedures specified in paragraph (i) of this AD.

(i) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. For a repair method to be approved, the repair must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) If the service information contains steps that are labeled as RC (Required for Compliance), those steps must be done to comply with this AD; any steps that are not labeled as RC are recommended. Those steps that are not labeled as RC may be deviated from, done as part of other actions, or done using accepted methods different from those identified in the specified service information without obtaining approval of an AMOC, provided the steps labeled as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to steps labeled as RC require approval of an AMOC.

(j) Related Information

(1) For more information about this AD, contact Haytham Alaidy, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, Washington 98057-3356; phone: 425-917-6422; fax: 425-917-6573; email: haytham.alaidy@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on June 24, 2014.

Jeffrey E. Duven,

*Manager, Transport Airplane Directorate,
Aircraft Certification Service.*

[FR Doc. 2014-15369 Filed 6-30-14; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2014-0424; Directorate Identifier 2014-NM-003-AD]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc. Model BD-700-1A10 and BD-700-1A11 airplanes. This proposed AD was prompted by reports of an incorrectly assembled check tee fitting used in fire extinguishing (FIREEX) distribution lines. This proposed AD would require inspecting to determine the part number and for all affected check tee fittings measuring for correct depth, and replacing if necessary. We are proposing this AD to detect and correct faulty check tee fittings, which will reduce fire extinguishing protection.

DATES: We must receive comments on this proposed AD by August 15, 2014.

ADDRESSES: You may send comments by any of the following methods:

- Federal eRulemaking Portal: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- Fax: (202) 493-2251.
- Mail: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- Hand Delivery: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact—Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email thd.crij@aero.bombardier.com; Internet

<http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0424; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Cesar Gomez, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office, 1600 Stewart Avenue, Suite 410, Westbury, New York 11590; telephone (516) 228-7318; fax (516) 794-5531.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2014-0424; Directorate Identifier 2014-NM-003-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

Transport Canada Civil Aviation, which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2013-41, dated December 30, 2013 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states: