

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Transport Canada AD CF-2022-67, dated December 6, 2022.

(ii) [Reserved]

(3) For Transport Canada AD CF-2022-67, contact Transport Canada, Transport Canada National Aircraft Certification, 159 Cleopatra Drive, Nepean, Ontario K1A 0N5, Canada; telephone 888-663-3639; email [TC.AirworthinessDirectives-Consignesdenavigabilite.TC@tc.gc.ca](mailto:TC.AirworthinessDirectives-Consignesdenavigabilite.TC@tc.gc.ca); website [tc.canada.ca/en/aviation](http://tc.canada.ca/en/aviation).

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit [www.archives.gov/federal-register/cfr/ibr-locations](http://www.archives.gov/federal-register/cfr/ibr-locations), or email [fr.inspection@nara.gov](mailto:fr.inspection@nara.gov).

Issued on March 4, 2024.

**Victor Wicklund,**

*Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2024-04955 Filed 3-8-24; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2024-0463; Project Identifier AD-2023-00792-T

RIN 2120-AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 737-8, 737-9, and 737-8200 airplanes. This proposed AD was prompted by a report of a non-conforming installation of spoiler wire bundles that led to unintended spoiler motion, including one instance of spoiler hardover. Further investigation identified the potential for a hardover of more than one flight spoiler on the same wing, which can exceed full lateral control capability leading to loss of control of the airplane. This proposed AD would require a one-time inspection of the clearance between the spoiler control wire bundles and the adjacent structure, and applicable on-condition actions.

The FAA is proposing this AD to address the unsafe condition on these products.

**DATES:** The FAA must receive comments on this proposed AD by April 25, 2024.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](http://regulations.gov). Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building, Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

*AD Docket:* You may examine the AD docket at [regulations.gov](http://regulations.gov) under Docket No. FAA-2024-0463; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

*Material Incorporated by Reference:*

- For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; website [myboeingfleet.com](http://myboeingfleet.com).

- You may view the service information that will be incorporated by reference at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available at [regulations.gov](http://regulations.gov) by searching for and locating Docket No. FAA-2024-0463.

**FOR FURTHER INFORMATION CONTACT:** Michael Closson, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3973; email: [Michael.P.Closson@faa.gov](mailto:Michael.P.Closson@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2024-0463; Project Identifier AD-2023-00792-T” at the beginning of your comments. The most helpful comments

reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to [regulations.gov](http://regulations.gov), including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

#### Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Michael Closson, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3973; email: [Michael.P.Closson@faa.gov](mailto:Michael.P.Closson@faa.gov). Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

#### Background

The FAA has received a report of multiple unusual spoiler deployments, which resulted in an un-commanded roll to the right during cruise. The related “SPOILERS” fault light on the P5-3 panel came on, and the spoiler control electronics (SCE) issued spoiler 10 fault code 27-01630. This event was noted as intermittent and was seen on multiple flights. A subsequent investigation found the root cause of the event was wire chafing damage due to spoiler control wire bundles riding on the landing gear beam rib in the right wing trailing edge due to non-conforming installation of spoiler wire bundles that occurred during production. This condition, if not

addressed, could result in loss of control of the airplane.

**FAA’s Determination**

The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop on other products of the same type design.

**Related Service Information Under 1 CFR Part 51**

The FAA reviewed Boeing Alert Requirements Bulletin 737-27A1325 RB, dated July 14, 2023. This service information specifies procedures for spoiler control wire bundles clearance measurement and applicable on-

condition actions. On-condition actions include a detailed inspection of the spoiler control wire bundles and adjacent structure for chafing damage, repair of any spoiler control wire bundles and any structural damage, and adjustment of the spoiler control wire bundles to ensure clearance requirements are met.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in **ADDRESSES**.

**Proposed AD Requirements in This NPRM**

This proposed AD would require accomplishing the actions specified in the service information already described, except for any differences identified as exceptions in the regulatory text of this proposed AD. For information on the procedures, see this service information at *regulations.gov* under Docket No. FAA-2024-0463.

**Costs of Compliance**

The FAA estimates that this AD, if adopted as proposed, would affect 207 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Measurement of wire bundle clearance .....	1 work-hour × \$85 per hour = \$85 .....	\$0	\$85	\$17,595

The FAA estimates the following costs to do any necessary repairs that

would be required based on the results of the proposed inspection. The agency

has no way of determining the number of aircraft that might need these repairs:

**ON-CONDITION COSTS**

Action	Labor cost	Parts cost	Cost per product
Inspection .....	1 work-hour × \$85 .....	\$0	\$85
Rework cable bundles without chafing damage to wires or airplane structure.	2 work-hours × \$85 per hour = \$170 .....	0	170
Rework cable bundles with chafing damage to wires or airplane structure.	5 work-hours × \$85 per hour = \$425 .....	0	425

The FAA has included all known costs in its cost estimate. According to the manufacturer, however, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce.

This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities

under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**The Boeing Company:** Docket No. FAA-2024-0463; Project Identifier AD-2023-00792-T.

**(a) Comments Due Date**

The FAA must receive comments on this airworthiness directive (AD) by April 25, 2024.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to The Boeing Company Model 737-8, 737-9, and 737-8200 airplanes, certificated in any category, as identified in Boeing Alert Requirements Bulletin 737-27A1325 RB, dated July 14, 2023.

**(d) Subject**

Air Transport Association (ATA) of America Code 27, Flight controls.

**(e) Unsafe Condition**

This AD was prompted by a report of a non-conforming installation of spoiler wire bundles that led to unintended spoiler motion, including one instance of spoiler hardover. Further investigation identified the potential for a hardover of more than one flight spoiler on the same wing, which can exceed full lateral control capability leading to loss of control of the airplane. The FAA is issuing this AD to address improper clearance between the spoiler control wire bundles and the adjacent structure, which can lead to damage to the wire bundle, causing unintentional spoiler motion. The unsafe condition, if not addressed, could result in loss of control of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Except as specified by paragraph (h) of this AD: At the applicable times specified in the "Compliance" paragraph of Boeing Alert Requirements Bulletin 737-27A1325 RB, dated July 14, 2023, do all applicable actions identified in, and in accordance with, the Accomplishment Instructions of Boeing Alert Requirements Bulletin 737-27A1325 RB, dated July 14, 2023.

**Note 1 to paragraph (g):** Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin 737-27A1325, dated July 14, 2023, which is referred to in Boeing Alert Requirements Bulletin 737-27A1325 RB, dated July 14, 2023.

**(h) Exception to Service Information Specifications**

Where the Condition and Compliance Time columns of the tables in the "Compliance" paragraph of Boeing Alert Requirements Bulletin 737-27A1325 RB, dated July 14, 2023, use the phrase "the original issue date of Requirements Bulletin 737-27A1325 RB," this AD requires using the effective date of this AD.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, AIR-520, Continued Operational Safety Branch, FAA, has the

authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (j)(1) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, AIR-520, Continued Operational Safety Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

**(j) Related Information**

(1) For more information about this AD, contact Michael Closson, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; phone: 206-231-3973; email: [Michael.P.Closson@faa.gov](mailto:Michael.P.Closson@faa.gov).

(2) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraph (k)(3) of this AD.

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Requirements Bulletin 737-27A1325 RB, dated July 14, 2023.

(ii) [Reserved]

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; website [myboeingfleet.com](http://myboeingfleet.com).

(4) You may view this service information that is incorporated by reference at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit [www.archives.gov/federal-register/cfr/ibr-locationsoremailfr.inspection@nara.gov](http://www.archives.gov/federal-register/cfr/ibr-locationsoremailfr.inspection@nara.gov).

Issued on March 4, 2024.

**Victor Wicklund,**

*Deputy Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2024-04956 Filed 3-8-24; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2024-0462; Project Identifier MCAI-2022-00523-R]**

**RIN 2120-AA64**

**Airworthiness Directives; Airbus Helicopters Deutschland GmbH (AHD) Helicopters**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to supersede Airworthiness Directive (AD) 2021-11-17 and AD 2021-11-22, which apply to all Airbus Helicopters Deutschland GmbH (AHD) Model EC135P1, EC135P2, EC135P2+, EC135P3, EC135T1, EC135T2, EC135T2+, and EC135T3 helicopters. AD 2021-11-17 requires a one-time visual inspection of certain part-numbered main rotor actuators (MRAs). AD 2021-11-22 requires revising the life limits of certain parts and removing each part that has reached its life limit. Since the FAA issued those ADs, it was determined that repetitive inspections of the MRAs are necessary, new and more restrictive tasks and limitations have been issued, and that it is necessary to expand the applicability. This proposed AD would continue to require the actions required by AD 2021-11-17 and AD 2021-11-22, except this proposed AD would require changing the one-time MRA inspection to a repetitive inspection and incorporating other new and more restrictive tasks and limitations by revising the airworthiness limitations section (ALS) of the existing helicopter maintenance manual or instructions for continued airworthiness and the existing approved maintenance or inspection program, as applicable. This proposed AD would also expand the applicability by adding Model EC635T2+ helicopters. These actions are specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.