

(d) Subject

Air Transport Association (ATA) of America Code 24, Electrical Power.

(e) Unsafe Condition

This AD was prompted by multiple reports of erratic electrical system status on the push button annunciators (PBAs) and the engine instrument and crew alerting system (EICAS) while on-ground and during flight. The FAA is issuing this AD to address erratic indications, which could cause the flight crew to turn off fully-operational electrical power sources, leading to partial or complete loss of electrical power. The unsafe condition, if not addressed, could result in loss of electrical power could result in the loss of flight displays and reduced controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Records Check

Within 60 days after the effective date of this AD, verify the total flight hours of the left-hand (LH) direct current power center (DCPC) unit since the date of manufacture by doing a records check in accordance with paragraph 2.B.(1) of the Accomplishment Instructions of the applicable service bulletin identified in paragraphs (g)(1) and (2) of this AD.

(1) For airplanes having serial number 20001 through 20500 inclusive, use Bombardier Service Bulletin 100–24–29, dated April 9, 2021.

(2) For airplanes having serial number 20501 through 20999 inclusive, use Bombardier Service Bulletin 350–24–004, dated April 9, 2021.

(h) Replacement of the LH DCPC

If, during the records check required by paragraph (g) of this AD, the total flight hours since date of manufacture of the LH DCPC unit is equal to or more than 3,100 total flight hours and the LH DCPC has not been cleaned as specified in Safran Service Bulletin 975GC02Y–24–018 before the effective date of this AD: Within 19 months after the effective date of this AD, replace the LH DCPC unit in accordance with paragraphs 2.B.(2) through 2.B.(5) and 2.C. of the Accomplishment Instructions of the applicable service bulletin identified in paragraphs (g)(1) and (2) of this AD.

(i) Exception to the Service Information

Although the note in paragraph 2.B.(4) of the Accomplishment Instructions of Bombardier Service Bulletins 100–24–29, and 350–24–004, both dated April 9, 2021, specifies that actions will reset “the unit total flight hours to zero at date of incorporation,” this AD does not include that requirement.

(j) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In

accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the New York ACO Branch, mail it to ATTN: Program Manager, Continuing Operational Safety, at the address identified in paragraph (k)(1) of this AD or email to: 9-avs-nyaco-cos@faa.gov. If mailing information, also submit information by email. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada; or Bombardier, Inc.’s Transport Canada Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(k) Additional Information

(1) Refer to Transport Canada AD CF–2022–28, dated May 26, 2022, for related information. This Transport Canada AD may be found in the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2022–1662.

(2) For more information about this AD, contact Steven Dzierzynski, Aerospace Engineer, Avionics & Electrical Systems Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7367; email 9-avs-nyaco-cos@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier Service Bulletin 100–24–29, dated April 9, 2021.

(ii) Bombardier Service Bulletin 350–24–004, dated April 9, 2021.

(3) For Bombardier service information identified in this AD, contact Bombardier Business Aircraft Customer Response Center, 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514–855–2999; email ac.yul@aero.bombardier.com; website [bombardier.com](https://www.bombardier.com).

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to: www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on January 2, 2023.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2023–00062 Filed 1–11–23; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA–2022–1659; Project Identifier MCAI–2022–01254–T]

RIN 2120–AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Airbus SAS Model A350–941 and –1041 airplanes. This proposed AD was prompted by reports of broken lower attachment studs on the AFT galley complex. This proposed AD would require repetitive detailed inspections of the lower attachment studs and, depending on findings, replacement of the lower attachment studs, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by February 27, 2023.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to [regulations.gov](https://www.regulations.gov). Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA–2022–1659; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket

contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For EASA material that is proposed for IBR in this NPRM, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; website easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

FOR FURTHER INFORMATION CONTACT: Dat Le, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 516-228-7317; email Dat.V.Le@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA-2022-1659; Project Identifier MCAI-2022-01254-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as

private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Dat Le, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 516-228-7317; email Dat.V.Le@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2022-0196, dated September 20, 2022 (EASA AD 2022-0196) (also referred to as the MCAI), to correct an unsafe condition for certain Airbus SAS Model A350-941 and -1041 airplanes. The MCAI states that the manufacturer has received reports of broken lower attachment studs on the AFT galley complex. The manufacturer's investigation indicates that the broken lower attachment studs resulted from a hydrogen-induced failure. This condition, if not addressed, could lead to galley detachment, resulting in injury to airplane occupants and reduced capacity for emergency evacuation of the airplane.

The FAA is proposing this AD to address the unsafe condition on these products.

You may examine the MCAI in the AD docket at regulations.gov under Docket No. FAA-2022-1659.

Related Service Information Under 1 CFR Part 51

EASA AD 2022-0196 specifies procedures for repetitive detailed inspections for broken lower attachment studs and, depending on findings, replacement of the lower attachment studs on the AFT galley complex. The MCAI specifies that replacement of the lower attachment studs on the AFT galley complex constitutes a terminating action for the repetitive detailed inspections. The MCAI also prohibits the installation of affected parts on any airplane. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in **ADDRESSES**.

FAA's Determination

This product has been approved by the aviation authority of another country and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, it has notified the FAA of the unsafe condition described in the MCAI described above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2022-0196 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2022-0196 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2022-0196 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2022-0196 does not mean that operators need comply only with that section. For example, where the AD requirement refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2022-0196. Service information required by EASA AD 2022-0196 for compliance will be available at regulations.gov under Docket No. FAA-2022-1659 after the FAA final rule is published.

Interim Action

The FAA considers that this proposed AD would be an interim action. If final action is later identified, the FAA may consider further rulemaking.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 8

airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
2 work-hours × \$85 per hour = \$170	\$0	\$170	\$1,360

The FAA estimates the following costs to do any necessary on-condition action that would be required based on

the results of any required actions. The FAA has no way of determining the

number of aircraft that might need this on-condition action:

ESTIMATED COSTS OF ON-CONDITION ACTIONS

Labor cost	Parts cost	Cost per product
7 work-hours × \$85 per hour = \$595	\$95	\$690

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities

under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Airbus SAS: Docket No. FAA–2022–1659; Project Identifier MCAI–2022–01254–T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by February 27, 2023.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus SAS Model A350–941 and –1041 airplanes, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2022–0196, dated September 20, 2022 (EASA AD 2022–0196).

(d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/furnishings.

(e) Unsafe Condition

This AD was prompted by reports of broken lower attachment studs on the AFT galley complex. The FAA is issuing this AD to address broken lower attachment studs on the AFT galley complex. The unsafe condition, if not addressed, could lead to galley module detachment, resulting in injury to airplane occupants and reduced capacity for emergency evacuation of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2022–0196.

(h) Exceptions to EASA AD 2022–0196

(1) Where EASA AD 2022–0196 refers to its effective date, this AD requires using the effective date of this AD.

(2) Where paragraph (3) of EASA AD 2022–0196 specifies terminating action, for this AD, replacing all affected parts of all affected galleys terminates the repetitive inspections for that airplane.

(3) This AD does not adopt the "Remarks" section of EASA AD 2022–0196.

(i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the International Validation Branch, send it to the attention of the person identified in paragraph (j) of this AD. Information may be

emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* Except as required by paragraph (i)(2) of this AD, if any service information referenced in EASA AD 2022-0196 contains paragraphs that are labeled as RC, the instructions in RC paragraphs, including subparagraphs under an RC paragraph, must be done to comply with this AD; any paragraphs, including subparagraphs under those paragraphs, that are not identified as RC are recommended. The instructions in paragraphs, including subparagraphs under those paragraphs, not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the instructions identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to instructions identified as RC require approval of an AMOC.

(j) Additional Information

For more information about this AD, contact Dat Le, Aerospace Engineer, Large Aircraft Section, FAA, International Validation Branch, 2200 South 216th St., Des Moines, WA 98198; telephone 516-228-7317; email Dat.V.Le@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2022-0196, dated September 20, 2022.

(ii) [Reserved]

(3) For EASA AD 2022-0196, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; website easa.europa.eu. You may find this EASA AD on the EASA website at ad.easa.europa.eu.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fr.inspection@nara.gov, or go to:

www.archives.gov/federal-register/cfr/ibr-locations.html.

Issued on December 27, 2022.

Christina Underwood,

Acting Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022-28584 Filed 1-11-23; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2022-1660; Project Identifier MCAI-2022-01268-T]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all Airbus SAS Model A300 B4-600, B4-600R, and F4-600R series airplanes, and Model A300 C4-605R Variant F airplanes (collectively called Model A300-600 series airplanes). This proposed AD was prompted by a determination that new or more restrictive airworthiness limitations are necessary. This proposed AD would require revising the existing maintenance or inspection program, as applicable, to incorporate new or more restrictive airworthiness limitations, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by February 27, 2023.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to regulations.gov. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

• *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at regulations.gov under Docket No. FAA-2022-1660; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For material that is proposed for IBR in this NPRM, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; website easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu. It is also available at regulations.gov under Docket No. FAA-2022-1660.

- You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

FOR FURTHER INFORMATION CONTACT: Dan Rodina, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3225; email dan.rodina@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2022-1660; Project Identifier MCAI-2022-01268-T" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and