

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2022-0100; Project Identifier MCAI-2021-01128-R]

RIN 2120-AA64

Airworthiness Directives; Airbus Helicopters Deutschland GmbH (AHD) Helicopters

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all Airbus Helicopters Deutschland GmbH (AHD) Model MBB-BK 117 C-2 helicopters. This proposed AD was prompted by a report of restricted collective lever movement caused by entanglement of the emergency flashlight strap with the cargo hook emergency release lever, causing the emergency flashlight to leave its seat. This proposed AD would require replacing each affected emergency flashlight with a serviceable part, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by April 1, 2022.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** (202) 493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For EASA material that is proposed for IBR in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find the EASA material on the EASA website at <https://ad.easa.europa.eu>. For Airbus Helicopters service information identified in this NPRM, contact Airbus Helicopters, 2701 North

Forum Drive, Grand Prairie, TX 75052; telephone (972) 641-0000 or (800) 232-0323; fax (972) 641-3775; or at <https://www.airbus.com/helicopters/services/technical-support.html>. You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110. The EASA material is also available at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0100.

Examining the AD Docket

You may examine the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0100; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the EASA AD, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT:

Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Suite 410, Westbury, NY 11590; telephone (516) 228-7330; email andrea.jimenez@faa.gov.

SUPPLEMENTARY INFORMATION:**Comments Invited**

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include "Docket No. FAA-2022-0100; Project Identifier MCAI-2021-01128-R" at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and

actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart Ave., Suite 410, Westbury, NY 11590; telephone (516) 228-7330; email andrea.jimenez@faa.gov. Any commentary that the FAA receives that is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2021-0231, dated October 15, 2021 (EASA AD 2021-0231), to correct an unsafe condition for all serial-numbered Airbus Helicopters Deutschland GmbH (AHD) Model MBB-BK 117 C-2 helicopters.

This proposed AD was prompted by a report of restricted collective lever movement caused by entanglement of the emergency flashlight strap with the cargo hook emergency release lever, causing the emergency flashlight to leave its seat. The FAA is proposing this AD to address entanglement of the emergency flashlight strap with the cargo hook emergency release lever. The unsafe condition, if not addressed, could result reduced control of the helicopter, resulting in damage to the helicopter and injury to occupants. See EASA AD 2021-0231 for additional background information.

Related Service Information Under 14 CFR Part 51

EASA AD 2021-0231 requires replacing each affected emergency flashlight with a serviceable part. EASA AD 2021-0231 also specifies that an affected part can be modified and re-identified into a serviceable part. EASA AD 2021-0231 also prohibits the installation of an affected part.

This material is reasonably available because the interested parties have

access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Other Related Service Information

The FAA also reviewed Airbus Helicopters Alert Service Bulletin ASB MBB-BK117 C-2-25A-021, Revision 0, dated August 25, 2021. This service information specifies procedures for removing the strap from the emergency flashlight and then writing a new part number on the emergency flashlight.

FAA's Determination

These helicopters have been approved by EASA and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the European Union, EASA has notified the FAA about the unsafe condition described in its AD. The FAA is proposing this AD after evaluating all known relevant information and determining that the unsafe condition described previously is likely to exist or develop on other helicopters of the same type design.

Proposed AD Requirements in This NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2021-0231, described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this proposed AD and except as discussed under "Differences Between This Proposed AD and the EASA AD."

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2021-0231 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2021-0231 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2021-0231 does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times,"

compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in EASA AD 2021-0231.

Service information referenced in EASA AD 2021-0231 for compliance will be available at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2022-0100 after the FAA final rule is published.

Differences Between This Proposed AD and the EASA AD

EASA AD 2021-0231 requires compliance within 12 months after the effective date of the EASA AD, whereas this proposed AD would require compliance within 3 months after the effective date of this AD.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 117 helicopters of U.S. Registry. Labor rates are estimated at \$85 per work-hour. Based on these numbers, the FAA estimates the following costs to comply with this proposed AD.

Replacing an emergency flashlight would take about 1 work-hour and parts would cost about \$219 for an estimated cost of \$304 per flashlight and up to \$35,568 for the U.S. fleet. Alternatively, modifying an emergency flashlight would take about 1 work-hour for an estimated cost of \$85 per flashlight.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the

national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Airbus Helicopters Deutschland GmbH (AHD): Docket No. FAA-2022-0100; Project Identifier MCAI-2021-01128-R.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by April 1, 2022.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Airbus Helicopters Deutschland GmbH (AHD) Model MBB-BK 117 C-2 helicopters, certificated in any category.

(d) Subject

Joint Aircraft Service Component (JASC) Code: 2510, Flight Compartment Equipment.

(e) Unsafe Condition

This AD was prompted by a report of restricted collective lever movement. Subsequent inspection determined that the emergency flashlight was stuck under that lever caused by entanglement of the emergency flashlight strap with the cargo hook emergency release lever, causing the emergency flashlight to leave its seat. The FAA is issuing this AD to address entanglement of the emergency flashlight strap with the cargo hook emergency release lever. The unsafe condition, if not addressed,

could result in reduced control of the helicopter, possibly resulting in damage to the helicopter and injury to occupants.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2021–0231, dated October 15, 2021 (EASA AD 2021–0231).

(h) Exceptions to EASA AD 2021–0231

(1) Where EASA AD 2021–0231 refers to its effective date, this AD requires using the effective date of this AD.

(2) This AD does not mandate compliance with the “Remarks” section of EASA AD 2021–0231.

(3) Where paragraph (1) of EASA AD 2021–0231 requires replacing each affected part with a serviceable part within 12 months, this AD requires compliance within 3 months after the effective date of this AD.

(i) No Reporting Requirement

Although the service information referenced in EASA AD 2021–0231 specifies to submit certain information to the manufacturer, this AD does not include that requirement.

(j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the International Validation Branch, send it to the attention of the person identified in paragraph (k)(2) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(k) Related Information

(1) For EASA AD 2021–0231, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may view this material at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N–321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222–5110. This material may be found in the AD docket at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2022–0100.

(2) For more information about this AD, contact Andrea Jimenez, Aerospace Engineer, COS Program Management Section, Operational Safety Branch, Compliance & Airworthiness Division, FAA, 1600 Stewart

Ave., Suite 410, Westbury, NY 11590; telephone (516) 228–7330; email andrea.jimenez@faa.gov.

Issued on February 7, 2022.

Lance T. Gant,

Director, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2022–03108 Filed 2–14–22; 8:45 am]

BILLING CODE 4910–13–P

CONSUMER PRODUCT SAFETY COMMISSION

16 CFR Parts 1112 and 1260

[Docket No. CPSC–2013–0028]

Safety Standard for Operating Cords on Custom Window Coverings; Notice of Opportunity for Oral Presentation of Comments

AGENCY: Consumer Product Safety Commission.

ACTION: Notice of proposed rulemaking; notice of opportunity for oral presentation of comments.

SUMMARY: The Consumer Product Safety Commission (Commission or CPSC) will be providing an opportunity for interested parties to present oral comments on the notice of proposed rulemaking (NPR) the Commission issued regarding a safety standard for operating cords on custom window coverings. Any oral comments will be part of the rulemaking record.

DATES: The hearing will begin at 10 a.m. Eastern Standard Time (EST) on March 16, 2022, via webinar. All attendees should pre-register for the webinar online at: <https://attendee.gotowebinar.com/register/2824746947802696460>. Any individual interested in making an oral presentation must register for the webinar and submit a request to make an oral presentation to the Division of the Secretariat, along with the written text of the oral presentation, and such requests must be received no later than 5 p.m. EST on March 2, 2022. All other individuals who wish to attend the hearing should register before the start of the hearing.

ADDRESSES: The hearing will be held via webinar. Attendance is free of charge. Submit requests to make oral presentations and the written text of oral presentations to the Division of the Secretariat, with the caption, “Custom Window Coverings NPR; Oral Presentation,” by email to cpsc-os@cpsc.gov, or by mail to the Division of the Secretariat, Consumer Product Safety Commission, 4330 East-West Highway, Bethesda, MD 20814. Detailed instructions for those making oral

presentations and other attendees will be made available on the CPSC public calendar.

FOR FURTHER INFORMATION CONTACT: For information about the subject matter of this hearing, contact Rana Balci-Sinha, Director, Division of Human Factors, Directorate for Engineering Sciences, Office of Hazard Identification and Reduction, Consumer Product Safety Commission, National Product Testing and Evaluation Center, 5 Research Place, Rockville, MD 20850; telephone: 301–987–2584; rbalcisinha@cpsc.gov. For information about the procedure to make an oral presentation, contact Alberta E. Mills, Division of the Secretariat, Consumer Product Safety Commission, 4330 East-West Highway, Bethesda, MD 20814; cpsc-os@cpsc.gov.

SUPPLEMENTARY INFORMATION:

I. Background

On January 7, 2022, the Commission published a notice of proposed rulemaking (NPR) in the **Federal Register**, proposing to issue a Safety Standard for Operating Cords on Custom Window Coverings under the Consumer Product Safety Act (CPSA; 15 U.S.C. 2051–2089), and seeking written comments. 87 FR 1014. The NPR seeks to address an unreasonable risk of strangulation to children 8 years old and younger associated with custom window coverings that have accessible operating cords that are longer than 8 inches. The NPR would require that operating cords on custom window coverings meet the same requirements as operating cords on stock window coverings, as set forth in the applicable voluntary standard, ANSI/WCMA A100.1—2018, American National Standard for Safety of Corded Window Covering Products. Thus, the proposed rule proposes that operating cords on custom window coverings must be cordless, inaccessible, or 8 inches or shorter in length in any use position. If finalized, operating cords on custom window coverings would require testing and certification to the rule under section 14 of the CPSA. Moreover, operating cords on custom window coverings that meet the definition of a “children’s product” would require third party testing by a CPSC-accredited third party conformity assessment body. Accordingly, the proposed rule also proposes to amend the Commission’s regulation at 16 CFR part 1112 to add “Safety Standard for Operating Cords on Custom Window Coverings” to the list of rules that require third party testing. The NPR is available at: <https://www.federalregister.gov/d/2021-27896>, and CPSC staff’s briefing package for the