

SB230041–00 RB, Issue 002, dated September 14, 2020.

Note 1 to paragraph (g): Guidance for accomplishing the actions required by this AD can be found in Boeing Alert Service Bulletin B787–81205–SB230041–00, Issue 002, dated September 14, 2020, which is referred to in Boeing Alert Requirements Bulletin B787–81205–SB230041–00 RB, Issue 002, dated September 14, 2020.

(h) Exception to Service Information Specifications

Where Boeing Alert Requirements Bulletin B787–81205–SB230041–00 RB, Issue 002, dated September 14, 2020, uses the phrase “the Issue 001 date of Requirements Bulletin B787–81205–SB230041–00 RB,” this AD requires using “the effective date of this AD.”

(i) Credit for Previous Actions

This paragraph provides credit for the actions specified in paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Boeing Alert Requirements Bulletin B787–81205–SB230041–00 RB, Issue 001, dated April 24, 2020.

(j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (k)(1) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by The Boeing Company Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(k) Related Information

(1) For more information about this AD, contact Frank Carreras, Aerospace Engineer, Systems and Equipment Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206–231–3539; email: frank.carreras@faa.gov.

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des

Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued on March 25, 2021.

Gaetano A. Sciortino,

Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021–07164 Filed 4–6–21; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2021–0261; Project Identifier MCAI–2020–01502–T]

RIN 2120–AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to supersede Airworthiness Directive (AD) 2019–19–06, which applies to certain Airbus SAS Model A330–202, –243, –243F, –302, –323, and –343 airplanes. AD 2019–19–06 requires an inspection to determine the part number and serial number of the slat geared rotary actuators (SGRAs), and replacement of each affected SGRA with a serviceable part. Since the FAA issued AD 2019–19–06, it was determined that the requirements of AD 2019–19–06 may not ensure the permanent removal from service of affected SGRAs. This proposed AD would continue to require replacement of each affected SGRA with a serviceable part, and would expand the applicability to include all airplanes on which the affected part may be installed. This proposed AD would also prohibit installation of an affected part, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by May 24, 2021.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** 202–493–2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M–

30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

• **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For material that will be incorporated by reference (IBR) in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; internet www.easa.europa.eu. You may find this IBR material on the EASA website at <https://ad.easa.europa.eu>. You may view this IBR material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. It is also available in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0261.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0261; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT:

Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3229; email Vladimir.Ulyanov@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA–2021–0261; Project Identifier MCAI–2020–01502–T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR

11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this proposed AD.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as "PROPIN." The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Vladimir Ulyanov, Aerospace Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3229; email Vladimir.Ulyanov@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Discussion

The FAA issued AD 2019-19-06, Amendment 39-19742 (84 FR 51960, October 1, 2019) (AD 2019-19-06), which applies to certain Airbus SAS Model A330-202, -243, -243F, -302, -323, and -343 airplanes. AD 2019-19-06 requires an inspection to determine the part number and serial number of the SGRAs, and replacement of each affected SGRA with a serviceable part. The FAA issued AD 2019-19-06 to address cracking of an SGRA, which, in combination with an independent failure on the second SGRA of the same slat surface, could lead to an uncontrolled movement of the affected slat surface in flight, or detachment of the slat surface, and could possibly result in damage to the stabilizers and reduced controllability of the airplane.

Actions Since AD 2019-19-06 Was Issued

Since the FAA issued AD 2019-19-06, it was confirmed that the affected parts were still installed on the

airplanes specified in that AD. It was also determined that the requirements of AD 2019-19-06 may not ensure the permanent removal from service of affected SGRAs. Therefore, affected parts that were removed from airplanes could later be installed on other airplanes. EASA and the FAA have determined that a new AD is necessary to prohibit the (re)installation of affected parts.

The EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2020-0245, dated November 9, 2020 (EASA AD 2020-0245) (also referred to as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for all Airbus A330-201, A330-202, A330-203, A330-223, A330-223F, A330-243, A330-243F, A330-301, A330-302, A330-303, A330-321, A330-322, A330-323, A330-341, A330-342, A330-343, A330-743L, A330-841, and A330-941 airplanes. EASA AD 2020-0245 supersedes EASA AD 2019-0093 (which corresponds to FAA AD 2019-19-06). Model A330-743L airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this AD therefore does not include those airplanes in the applicability.

This proposed AD was prompted by a report that cracks have been found within the ring gears of the SGRAs due to a change in the manufacturing process and inadequate post-production non-destructive testing for potential cracking, and a determination that the requirements of AD 2019-19-06 may not ensure the permanent removal from service of affected SGRAs. The FAA is proposing this AD to address cracking of an SGRA, which, in combination with an independent failure on the second SGRA of the same slat surface, could lead to an uncontrolled movement of the affected slat surface in flight, or detachment of the slat surface, and could possibly result in damage to the stabilizers and reduced controllability of the airplane. See the MCAI for additional background information.

Explanation of Retained Requirements

Although this proposed AD does not explicitly restate the requirements of AD 2019-19-06, this proposed AD would retain certain requirements of AD 2019-19-06. Those requirements are referenced in EASA AD 2020-0245, which, in turn, is referenced in paragraph (g) of this proposed AD.

Related Service Information Under 1 CFR Part 51

EASA AD 2020-0245 describes procedures for replacing each affected SGRA, and specifies a prohibition against installation of an affected part.

This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA's Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI referenced above. The FAA is proposing this AD because the FAA evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in EASA AD 2020-0245 described previously, as incorporated by reference, except for any differences identified as exceptions in the regulatory text of this AD.

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA initially worked with Airbus and EASA to develop a process to use certain EASA ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has since coordinated with other manufacturers and civil aviation authorities (CAAs) to use this process. As a result, EASA AD 2020-0245 will be incorporated by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2020-0245 in its entirety, through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in the EASA AD does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance

Time(s) in the EASA AD. Service information specified in EASA AD 2020-0245 that is required for compliance with EASA AD 2020-0245 will be available on the internet at

<https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0261 after the FAA final rule is published.

Costs of Compliance

The FAA estimates that this proposed AD affects 123 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

ESTIMATED COSTS FOR REQUIRED ACTIONS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Retained action from AD 2019-19-06.	17 work-hours × \$85 per hour = \$1,445	*\$0	\$1,445	\$177,735.
New proposed actions ..	Up to 15 work-hours × \$85 per hour = Up to \$1,275.	*\$0	Up to \$1,275	Up to \$156,825.

* The FAA has received no definitive data on which to base the cost estimates for the parts specified in this proposed AD.

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected operators. The FAA does not control warranty coverage for affected operators. As a result, the FAA has included all known costs in the cost estimate

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by:
 - a. Removing Airworthiness Directive (AD) 2019-19-06, Amendment 39-19742 (84 FR 51960, October 1, 2019) (AD 2019-19-06), and
 - b. Adding the following new AD:

Airbus SAS: Docket No. FAA-2021-0261; Project Identifier MCAI-2020-01502-T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) action by May 24, 2021.

(b) Affected ADs

This AD replaces AD 2019-19-06, Amendment 39-19742 (84 FR 51960, October 1, 2019) (AD 2019-19-06).

(c) Applicability

This AD applies to all Airbus SAS airplanes specified in paragraphs (c)(1) through (5) of this AD, certificated in any category.

- (1) Model A330-201, -202, -203, -223, and -243 airplanes.
- (2) Model A330-223F and -243F airplanes.
- (3) Model A330-301, -302, -303, -321, -322, -323, -341, -342, and -343 airplanes.

- (4) Model A330-841 airplanes.
- (5) Model A330-941 airplanes.

(d) Subject

Air Transport Association (ATA) of America Code 27, Flight controls.

(e) Reason

This AD was prompted by a report that cracks have been found within the ring gears of the slat geared rotary actuators (SGRAs) due to a change in the manufacturing process and inadequate post-production non-destructive testing for potential cracking, and a determination that the requirements of AD 2019-19-06 may not ensure the permanent removal from service of affected SGRAs. The FAA is issuing this AD to address cracking of an SGRA, which, in combination with an independent failure on the second SGRA of the same slat surface, could lead to an uncontrolled movement of the affected slat surface in flight, or detachment of the slat surface, and could possibly result in damage to the stabilizers and reduced controllability of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

■ (g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2020-0245, dated November 9, 2020 (EASA AD 2020-0245).

(h) Exceptions to EASA AD 2020-0245

(1) Where EASA AD 2020-0245 refers to May 10, 2019 (the effective date of EASA AD 2019-0093), this AD requires using November 5, 2019 (the effective date of AD 2019-19-06).

(2) Where paragraph (1) of EASA AD specifies to "replace each affected part with a serviceable part in accordance with the instructions of the SB," this AD requires "removal of each affected part and installation of a serviceable part in accordance with paragraphs 3.C. (2) and 3.C. (3) of the SB."

(3) Where EASA AD 2020–0245 refers to its effective date, this AD requires using the effective date of this AD.

(4) The “Remarks” section of EASA AD 2020–0245 does not apply to this AD.

■ (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Large Aircraft Section, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the Large Aircraft Section, International Validation Branch, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: 9-AVS-AIR-730-AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, Large Aircraft Section, International Validation Branch, FAA; or EASA; or Airbus SAS’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: For any service information referenced in EASA AD 2020–0245 that contains RC procedures and tests: Except as required by paragraph (i)(2) of this AD, RC procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(j) Related Information

(1) For information about EASA AD 2020–0245, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu; Internet www.easa.europa.eu. You may find this EASA AD on the EASA website at <https://ad.easa.europa.eu>. You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195. This material may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0261.

(2) For more information about this AD, contact Vladimir Ulyanov, Aerospace

Engineer, Large Aircraft Section, International Validation Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206–231–3229; email Vladimir.Ulyanov@faa.gov.

Issued on March 30, 2021.

Ross Landes,

Deputy Director for Regulatory Operations, Compliance & Airworthiness Division, Aircraft Certification Service.

[FR Doc. 2021–07090 Filed 4–6–21; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2021–0264; Project Identifier MCAI–2020–01416–T]

RIN 2120–AA64

Airworthiness Directives; MHI RJ Aviation ULC (Type Certificate Previously Held by Bombardier, Inc.) Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain MHI RJ Aviation ULC Model CL–600–2D15 (Regional Jet Series 705) and CL–600–2D24 (Regional Jet Series 900) airplanes. This proposed AD was prompted by a report that the lower aft outboard supporting structure of galley 2 does not meet certification requirements for all flight and/or emergency landing loads. This proposed AD would require modifying the floor structure between certain fuselage stations. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by May 24, 2021.

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact MHI RJ Aviation ULC, 12655 Henri-Fabre Blvd., Mirabel, Québec J7N 1E1 Canada; Widebody Customer Response Center North America toll-free telephone +1–844–272–2720 or direct-dial telephone +1–514–855–8500; fax +1–514–855–8501; email thd.crj@mhjrj.com; internet <https://mhjrj.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA–2021–0264; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above.

FOR FURTHER INFORMATION CONTACT:

Andrea Jimenez, Aerospace Engineer, Airframe and Propulsion Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7330; fax 516–794–5531; email 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under **ADDRESSES**. Include “Docket No. FAA–2021–0264; Project Identifier MCAI–2020–01416–T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this proposed AD.