

Actions	Compliance	Procedures
(1) Inspect visually the rudder and vertical fin hinge attachment for loose fasteners; and inspect the rudder or vertical fin skins, spars, hinges or brackets for cracks and/or corrosion.	Initially inspect when the airplane reaches a total of 3,500 hours time-in-service (TIS) or within the next 100 hours TIS after the effective date of this AD, whichever occurs later, unless already done. Thereafter, repetitively inspect at intervals not to exceed every 100 hours TIS. Installation of the external doubler at the upper rudder hinge required by paragraph (e)(2)(ii) or (e)(3) of this AD is terminating action for the repetitive inspections required by this AD.	Follow Snow Engineering Co. Service Letter #247, revised June 2, 2008.
(2) If you find any damage as a result of any inspection required by paragraph (e)(1) of this AD, you must: (i) Replace any damaged parts with new parts and (ii) Do the installation of the external doubler at the upper rudder hinge.	Before further flight after any inspection required by paragraph (e)(1) of this AD where you find any damaged parts. The installation of the external doubler at the upper rudder hinge required by paragraph (e)(2)(ii) or (e)(3) of this AD terminates the action for the repetitive inspections required by this AD.	Follow Snow Engineering Co. Service Letter #247, revised June 2, 2008; and Snow Engineering Co. Process Specification Number 145, dated December 6, 1991.
(3) Do the installation of the external doubler at the upper rudder hinge.	When the airplane reaches a total of 5,000 hours TIS after the effective date of this AD or within the next 100 hours TIS after the effective date of this AD, whichever occurs later, unless already done. The installation of the external doubler at the upper rudder hinge required by paragraph (e)(2)(ii) or (e)(3) of this AD terminates the action for the repetitive inspections required by this AD.	Follow Snow Engineering Co. Service Letter #247, revised June 2, 2008; and Snow Engineering Co. Process Specification Number 145, dated December 6, 1991.
(4) Do not install any rudder without the external doubler at the upper rudder hinge required by paragraph (e)(3) of this AD.	As of the effective date of this AD	Not Applicable.

Alternative Methods of Compliance (AMOCs)

(f) The Manager, Fort Worth Aircraft Certification Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Andrew McAnaul, Aerospace Engineer, ASW-150 (c/o MIDO-43), 10100 Reunion Place, Suite 650, San Antonio, Texas 78216; telephone: (210) 308-3365; facsimile: (210) 308-3370. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

Related Information

(g) To get copies of the service information referenced in this AD, contact Air Tractor, Inc., P.O. Box 485, Olney, Texas 76374; telephone: (940) 564-5616; facsimile: (940) 564-5612. To view the AD docket, go to U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590, or on the Internet at <http://www.regulations.gov>.

Issued in Kansas City, Missouri, on July 1, 2008.

John Colomy,

Acting Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. E8-15456 Filed 7-7-08; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2008-0748; Directorate Identifier 2008-CE-041-AD]

RIN 2120-AA64

Airworthiness Directives; EADS SOCATA Model TBM 700 Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

It has been discovered that a risk of mechanical interference exists in the movement of the emergency landing gear bypass selector, due to an insufficient functional gap between a floor panel attachment lug and the landing gear control button.

This condition, if not corrected, causes mechanical interference which could result in a situation where, during emergency procedures, the landing gear cannot be extended.

The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

DATES: We must receive comments on this proposed AD by August 7, 2008.

ADDRESSES: You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through

Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Albert Mercado, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4119; fax: (816) 329-4090.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2008-0748; Directorate Identifier 2008-CE-041-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued Emergency AD No. 2008-0081-E, dated April 25, 2008, (referred to after this as "the MCAI"), to correct an unsafe condition for the specified products. The MCAI states:

It has been discovered that a risk of mechanical interference exists in the movement of the emergency landing gear by-pass selector, due to an insufficient functional gap between a floor panel attachment lug and the landing gear control button.

This condition, if not corrected, causes mechanical interference which could result in a situation where, during emergency procedures, the landing gear cannot be extended.

For the reasons described above, this EASA Emergency Airworthiness Directive (AD) requires a check of the gap between the landing gear control button and the floor panel and, if the gap is found to be insufficient, modification of the floor panel. You may obtain further information by examining the MCAI in the AD docket.

Relevant Service Information

EADS SOCATA has issued Mandatory TBM Aircraft Service Bulletin SB 70-154, dated April 2008. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

FAA's Determination and Requirements of the Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with this State of Design Authority, they have notified us of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

Differences Between This Proposed AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have proposed different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are highlighted in a NOTE within the proposed AD.

Costs of Compliance

We estimate that this proposed AD will affect 72 products of U.S. registry. We also estimate that it would take about 1 work-hour per product to comply with the basic requirements of this proposed AD. The average labor rate is \$80 per work-hour (no labor cost; work-hour warranty given by manufacturer until May 31, 2009).

Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$5,760 or \$80 per product.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new AD:

EADS SOCATA: Docket No. FAA-2008-0748; Directorate Identifier 2008-CE-041-AD.

Comments Due Date

(a) We must receive comments by August 7, 2008.

Affected ADs

(b) None.

Applicability

(c) This AD applies to TBM 700 airplanes, serial numbers 364, 367, and 370 through 439, certificated in any category.

Subject

(d) Air Transport Association of America (ATA) Code 53: Fuselage.

Reason

(e) The mandatory continuing airworthiness information (MCAI) states:

It has been discovered that a risk of mechanical interference exists in the movement of the emergency landing gear by-pass selector, due to an insufficient functional gap between a floor panel attachment lug and the landing gear control button.

This condition, if not corrected, causes mechanical interference which could result in a situation where, during emergency procedures, the landing gear cannot be extended.

For the reasons described above, this EASA Emergency Airworthiness Directive (AD) requires a check of the gap between the landing gear control button and the floor panel and, if the gap is found to be insufficient, modification of the floor panel.

Actions and Compliance

(f) For airplanes that have had the floor panel removed for maintenance or if it cannot be positively determined that the floor panel has not been removed at any time, do the following actions, unless already done:

(1) Before further flight after the effective date of this AD, inspect the gap between the landing gear control button and the floor panel. Do the inspection following paragraph A of the Accomplishment Instructions in EADS SOCATA Mandatory TBM Aircraft Service Bulletin SB 70-154, dated April 2008.

(2) If the gap is below the limits specified in paragraph A of EADS SOCATA Mandatory TBM Aircraft Service Bulletin SB 70-154, dated April 2008, before further flight after the inspection required in paragraph (f)(1) of this AD, modify the floor panel following paragraph C of the Accomplishment Instructions in EADS SOCATA Mandatory TBM Aircraft Service Bulletin SB 70-154, dated April 2008.

(g) For airplanes in which it can be positively determined that the floor panel has not been removed at any time, within the next 30 days after the effective date of this AD, modify the floor panel following paragraph C of the Accomplishment Instructions in EADS SOCATA Mandatory TBM Aircraft Service Bulletin SB 70-154, dated April 2008.

FAA AD Differences

Note: This AD differs from the MCAI and/or service information as follows: No differences.

Other FAA AD Provisions

(h) The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Standards Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Albert Mercado, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4119; fax: (816) 329-4090. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act (44 U.S.C. 3501 et seq.), the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

Special Flight Permit

(i) A single ferry flight of the airplane with landing gear extended is allowed in order to reach the nearest maintenance facility where the inspection and modification is to be done.

Related Information

(j) Refer to MCAI European Aviation Safety Agency (EASA) Emergency AD No. 2008-0081-E, dated April 25, 2008; and EADS SOCATA Mandatory TBM Aircraft Service Bulletin SB 70-154, dated April 2008 for related information.

Issued in Kansas City, Missouri, on July 1, 2008.

John Colomy,

Acting Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. E8-15461 Filed 7-7-08; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2006-26598; Directorate Identifier 2006-CE-087-AD]

RIN 2120-AA64

Airworthiness Directives; Empresa Brasileira de Aeronautica S. A. (EMBRAER) Models EMB-110P1 and EMB-110P2 Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Supplemental notice of proposed rulemaking (NPRM); reopening of the comment period.

SUMMARY: We are revising an earlier supplemental NPRM for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

It has been found cases of corrosion at the regions of Wings-to-Fuselage attachments, Vertical Stabilizer to Fuselage attachments, Rib 1 Half-wing and Passenger Seat Tracks. Such corrosion may lead to subsequent cracking of the affected parts, compromising the aircraft structural integrity, which may in turn lead to structural failure and/or loss of some control surface.

The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

DATES: We must receive comments on this proposed AD by September 8, 2008.

ADDRESSES: You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* (202) 493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the