

for the inspections required by those paragraphs. Do not intermix BACB30MR\*K\* bolts with BACB30LE\*K\* or BACB30US\*K\* bolts in the joints subject to this AD.

**Model 767-400ER Series Airplanes: Initial Inspection and Corrective Actions**

(d) For Model 767-400ER series airplanes: Within 90 days after August 27, 2002, do a one-time general visual inspection to determine if any bolt is missing from the inboard and outboard support of the inboard main flap, and do a detailed inspection for a gap between the nut and surrounding structure or between shim and joint (which would indicate a loose bolt), per Figure 2 of Boeing Alert Service Bulletin 767-27A0176, Revision 1, dated June 6, 2002.

(1) If no bolt is missing and no gap is found: No further action is required by this paragraph.

(2) If any bolt is missing or any gap is found: Do paragraphs (d)(2)(i) and (d)(2)(ii) of this AD.

(i) Before further flight, repair per a method approved by the Manager, Seattle Aircraft Certification Office (ACO), FAA; or per data meeting the type certification basis of the airplane approved by a Boeing Company Designated Engineering Representative who has been authorized by the Manager, Seattle ACO, to make such findings. For a repair method to be approved as required by this paragraph, the approval must specifically refer to this AD.

(ii) Within 10 days after the inspections: Submit a report of inspection findings to the Manager, Boeing Certificate Management Office, FAA, Transport Airplane Directorate, 2500 East Valley Road, Suite C2, Renton, Washington 98055; fax (425) 227-1159. The report must include the airplane's serial number, the total number of flight cycles and flight hours on the airplane, the number and specific location of discrepant bolts, and the nature of the discrepancy (i.e., missing bolt or gap found). Information collection requirements contained in this AD have been approved by the Office of Management and Budget (OMB) under the provisions of the Paperwork Reduction Act of 1980 (44 U.S.C. 3501 *et seq.*) and have been assigned OMB Control Number 2120-0056.

**Previously Accomplished Inspections and Bolt Replacements**

(e) Inspections and bolt replacements accomplished before the effective date of this AD per Boeing Alert Service Bulletin 767-27A0176, dated November 16, 2001, are acceptable for compliance with the corresponding actions required by this AD.

**New Requirements of This AD**

**Group 1 and 2 Airplanes: One-Time Inspection for Missing or Loose Bolts**

(f) Within 90 days after the effective date of this AD: Do the one-time general visual inspection required by paragraph (a) of this AD to determine if any bolt is missing from the inboard support of the inboard main flap, per Part 2 or Part 8, as applicable, of the Accomplishment Instructions of Boeing Alert Service Bulletin 767-27A0176, Revision 1, dated June 6, 2002. Group 1 airplanes may comply with the replacement specified in

paragraph (c) of this AD in lieu of the inspection in this paragraph, provided that the replacement per paragraph (c) of this AD is accomplished within the compliance time specified in this paragraph.

**Alternative Methods of Compliance**

(g)(1) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Seattle ACO. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Seattle ACO.

(2) Alternative methods of compliance, approved previously in accordance with AD 2002-16-05, amendment 39-12844, are approved as alternative methods of compliance with paragraph (d)(2)(i) of this AD.

**Note 3:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Seattle ACO.

**Special Flight Permits**

(h) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

**Incorporation by Reference**

(i) Unless otherwise provided in this AD, the actions shall be done per Boeing Alert Service Bulletin 767-27A0176, Revision 1, dated June 6, 2002. This incorporation by reference was approved previously by the Director of the Federal Register as of August 27, 2002 (67 FR 52401, August 12, 2002). Copies may be obtained from Boeing Commercial Airplane Group, P.O. Box 3707, Seattle, Washington 98124-2207. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

**Effective Date**

(j) This amendment becomes effective on November 14, 2002.

Issued in Renton, Washington, on October 24, 2002.

**Ali Bahrami,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 02-27557 Filed 10-29-02; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF HEALTH AND HUMAN SERVICES**

**Food and Drug Administration**

**21 CFR Part 172**

**Food Additives Permitted for Direct Addition to Food for Human Consumption**

**CFR Correction**

In Title 21 of the Code of Federal Regulations, parts 170 to 199, revised as of April 1, 2002, on page 31, § 172.133 is corrected by revising paragraphs (b)(2) and (b)(3) to read as follows:

**§ 172.133 Dimethyl dicarbonate.**

\* \* \* \* \*

(b) \* \* \*

(2) In ready-to-drink teas in an amount not to exceed 250 parts per million.

(3) In carbonated or noncarbonated, nonjuice-containing (less than or equal to 1 percent juice), flavored or unflavored beverages containing added electrolytes (5-20 milliequivalents/liter sodium ion (Na+) and 3-7 milliequivalents/liter potassium ion (K+)) in an amount not to exceed 250 parts per million.

\* \* \* \* \*

[FR Doc. 02-55523 Filed 10-29-02; 8:45 am]

**BILLING CODE 1505-01-D**

**DEPARTMENT OF STATE**

**22 CFR Part 41**

**[Public Notice 4181]**

**Visas: Documentation of Nonimmigrants Under the Immigration and Nationality Act: XIX Olympic Winter Games and VIII Paralympic Winter Games in Salt Lake City, UT, 2002**

**AGENCY:** Department of State, Bureau of Consular Affairs.

**ACTION:** Removal of interim rule.

**SUMMARY:** The Department of State is removing its interim rule on special procedures relating to visa documentation and visa processing for the 2002 Winter Olympic and Paralympic Games in Salt Lake City. Now that the 2002 Winter Games are over there is no longer a need for the interim rule.

**DATES:** This final rule is effective August 1, 2002.

**FOR FURTHER INFORMATION CONTACT:** For information regarding the publication of this regulation under the Administrative